#### TRANSPORTATION PROJECT REPORT

# DRAFT DESIGN REPORT / DRAFT ENVIRONMENTAL IMPACT STATEMENT / DRAFT 4(f) EVALUATION

# **VOLUME 9**Appendix B12:

# B12 – Hazardous Waste / Contaminated Materials Screening – Volume II

November 2016

PIN 5470.22 NYS Route 198 (Scajaquada Expressway) Corridor Grant Street Interchange to Parkside Avenue Intersection City of Buffalo Erie County





#### TRANSPORTATION PROJECT REPORT

# DRAFT DESIGN REPORT / DRAFT ENVIRONMENTAL IMPACT STATEMENT / DRAFT 4(f) EVALUATION

#### **APPENDIX B12**

Hazardous Waste / Contaminated Materials Screening - Volume II

#### November 2016

PIN 5470.22

NYS Route 198 (Scajaquada Expressway Corridor)
Grant Street Interchange to Parkside Avenue Intersection
City of Buffalo
Erie County







#### PRELIMINARY SCREENING INVESTIGATION REPORT

#### FOR THE

#### HAZARDOUS WASTE/CONTAMINATED MATERIALS ASSESSMENT

OF

RECONSTRUCTION OF NY ROUTE 198, SCAJAQUADA EXPRESSWAY FROM I-190 TO ROUTE 33 (KENSINGTON EXPRESSWAY)

CITY OF BUFFALO, ERIE COUNTY

PIN 5470.22

VOLUME II of II

SEPTEMBER 2008 (UPDATED NY SPILLS SEARCH - MAY 2016)

PREPARED FOR:
BERGMANN ASSOCIATES, P.C.
200 FIRST FEDERAL PLAZA
28 EAST MAIN STREET
ROCHESTER, NY 14614

FOR SUBMISSION TO:
NEW YORK STATE DEPARTMENT OF TRANSPORTATION
REGION FIVE
125 MAIN STREET
BUFFALO, NEW YORK 14203



#### PRELIMINARY SCREENING INVESTIGATION REPORT

#### FOR THE

#### HAZARDOUS WASTE/CONTAMINATED MATERIALS ASSESSMENT

OF

RECONSTRUCTION OF NY ROUTE 198, SCAJAQUADA EXPRESSWAY FROM I-190 TO ROUTE 33 (KENSINGTON EXPRESSWAY) CITY OF BUFFALO, ERIE COUNTY PIN 5470.22

**VOLUME II of II** 

SEPTEMBER 2008 (UPDATED NY SPILLS SEARCH - MAY 2016)

PREPARED FOR:
BERGMANN ASSOCIATES, P.C.
200 FIRST FEDERAL PLAZA
28 EAST MAIN STREET
ROCHESTER, NY 14614

FOR SUBMISSION TO:
NEW YORK STATE DEPARTMENT OF TRANSPORTATION
REGION FIVE
125 MAIN STREET
BUFFALO, NEW YORK 14203

PREPARED BY:

WATTS ARCHITECTURE & ENGINEERING 95 PERRY STREET BUFFALO, NEW YORK 14203

#### **VOLUME II of II**

#### TABLE OF CONTENTS


Section	Page
1.0 INTRODUCTION	1
1.1 Project Description	1
1.2 Purpose	
2.0 SCOPE AND METHODOLOGY	
2.1 Investigation of Previous Activities and Site Use	2
2.1.1 USGS Topographic Map	2
2.1.2 Historic Land Use Maps	2
2.1.3 Sanborn Fire Insurance Maps	2
2.1.4 City Directories	
2.1.5 Aerial Photographs	3
2.1.6 Soil Survey of Erie County	
2.2 Review of Government Records and Databases	
2.3 Field Inspection	
2.4 Interviews	
3.0 FINDINGS	
3.1 Specific Properties Considered to be Potential Environmental Concerns	
3.1.1 Site A: Scajaquada Creek/Hoyt Lake	
3.1.2 Site B: B&B Collision – 1660 Niagara St.	
3.1.3 Site C: Zeller Electric – 1675 Niagara St.	
3.1.4 Site D: Railroad ROW – Niagara St.	
3.1.5 Site E: Niagara Mohawk – 1626 Niagara St.	
3.1.6 Site F: I-190 — Niagara Section	
3.1.7 Site G: City of Buffalo Park – Niagara St.	
3.1.8 Site H: City of Buffalo Park Bike Path Area beneath Route 198 – Niagara St	
3.1.9 Site I: Hohl Machine & Conveyor Company – 1540-1590 Niagara St	
3.1.10 Site J: Vincent's Self-Storage – 1573 Niagara St.	
3.1.11 Site K: Infinity Architectural Windows – 1555 Niagara St	
3.1.12 Site L: G&G Sunoco Gas Station – 1531-1543 Niagara St	
3.1.13 Site M: Rascal's Restaurant – 1516 Niagara St.	
3.1.14 Site N: Contract Pharmaceuticals Parking Lot – 80 Forest Ave.	
3.1.15 Site O: Vacant Lot – Former Pratt & Lambert Lacquer Plant – 1451 West Ave	
3.1.16 Site P: Contract Pharmaceuticals Limited Niagara – 100 Forest Ave	
3.1.17 Site Q: Pagan Auto Sales – 18 Tonawanda St	
3.1.18 Site R: Fort Knox Business Center – 31 Tonawanda St	2/
3.1.19 Site S: Vacant Lot – Former Pratt & Lambert Paint and Varnish Plant – 75	0.0
Tonawanda St.	
3.1.20 Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Mole	
Marsh Metal Plating, & Kellex Polymers – 125-137 Tonawanda St	
3.1.21 Site U: Former Pratt & Letchworth - 189-205 Tonawanda St	
3.1.22 Site V: City of Buffalo Impound Lot – 166 Dart St.	
3.1.23 Site W: Buffalo State College Parking Lot – Grant St	3/

3.1.24 Site X: Buffalo State College Stadium & Parking Lots – 1300 Elmwood Ave.	38
3.1.25 Site Y: On/Off Ramp – Grant St.	41
3.1.26 Site Z: Tops Grocery Store/Burger King – 333-365 Amherst St	42
3.1.27 Site AA: Former Buffalo Fire Station – 395 Amherst St	43
3.1.28 Site AB: Wegman's – 601 Amherst St	
3.1.29 Site AC: Marcon Erectors – 1 Howell St.	
3.1.30 Site AD: Contractor Storage Area – 18 Howell St.	
3.1.31 Site AE: Residential Property – 227 Middlesex Rd	
3.1.32 Site AF: Buffalo Police Radio Tower – Route 198 Eastbound	
3.1.33 Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Pl	
3.1.34 Site AH: Delaware Park – Parkside Ave	
3.1.35 Site Al: Metro-Rail Subway Station – 2085 Main St	
3.1.36 Site AJ: Buffalo Lining & Fabricating – 93 Gillette Ave.	
3.1.37 Site AK: Wm. Maunz Co. – 387 East Delavan Ave.	
3.1.38 Site AL: Route 33	
3.1.39 Site AM: Railroad ROW – East End	
3.1.40 Site AN: Residential Property – 413 East Delevan Ave.	
3.1.41 Site AO: Sears, Roebuck & Co. & North Extension – 370-440 E. Delevan A	
3.1.42 Site AP: Brookline Machine & North Extension – 1870-1896 Fillmore Ave.	
3.2 Properties Considered to be Potential Environmental Concerns Identified Outsi	
Project Limits	
3.2.1 DiVal Safety – 1701 Niagara St.	
3.2.2 Hudson Ramsey Co. – 1679 Niagara St	
3.2.3 Volland Electric Equipment Co. & Mead Supply Co. – 1511-1527 Niagara	
3.2.4 Buffalo Metal Finishing – 135 Dart St.	
3.2.5 Willard Machine Corporation – 73 Forest Ave.	
3.2.6 Luigi's Family Bakery – 77-83 Forest Ave.	
3.2.7 Vacant Lot – 1354-1360 West Ave	
3.2.8 Liberty Auto Plus Inc. – 980 Grant St	
3.2.9 Vacant Building - Former Gas Station – 479-481 Amherst St	
3.2.10 Quality Binding Company & Habitat for Humanity ReStore – 501 Amherst	
3.2.11 Medaille College – 18 Agassiz Cir	
3.2.12 Forest Lawn Cemetery Garage – 1994 Main St.	
3.2.13 Sisters of Charity Hospital – 2127-2157 Main St	
3.2.14 J.W. Danforth – 1940 Fillmore Ave	/0
3.2.15 Trinidad Neighborhood Association & Garden – 113 Gillette Ave./237	70
Kensington Ave.	
3.2.16 Contractor Storage Area - 239 Kensington Ave	/
3.2.17 Kentucky Fried Chicken & Niagara Mohawk Power Station – 448-470 E.	71
Delevan Ave	۱ / 73
+ U	7.3

#### LIST OF TABLES

Table 1-Sur	mmar	y of Recommendations	76
		LIST OF FIGURES	
		Location Map Potential Environmental Concern  LIST OF ATTACHMENTS	
Attachment Attachment Attachment	B C	Sources of Information (VOLUME I of II) Site Photographs (VOLUME I of II) FirstSearch Technologies Environmental Report (VOLUM) Third Party Correspondences and Information	E I of II)




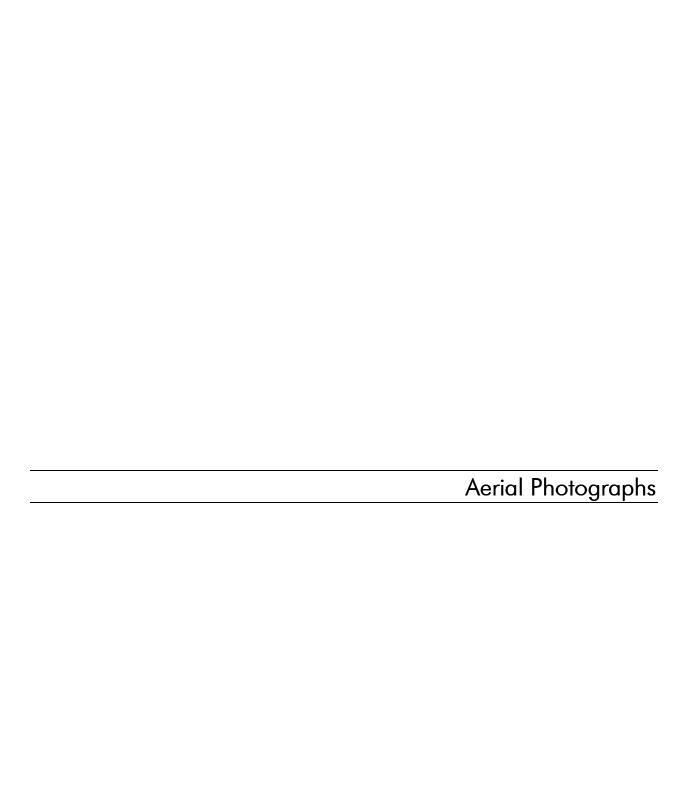





SOURCE: Erie County, Public Works, Division of Highways 1927

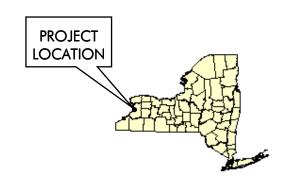


## 1927 Aerial Photo

NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York

Not to Scale


June 2008



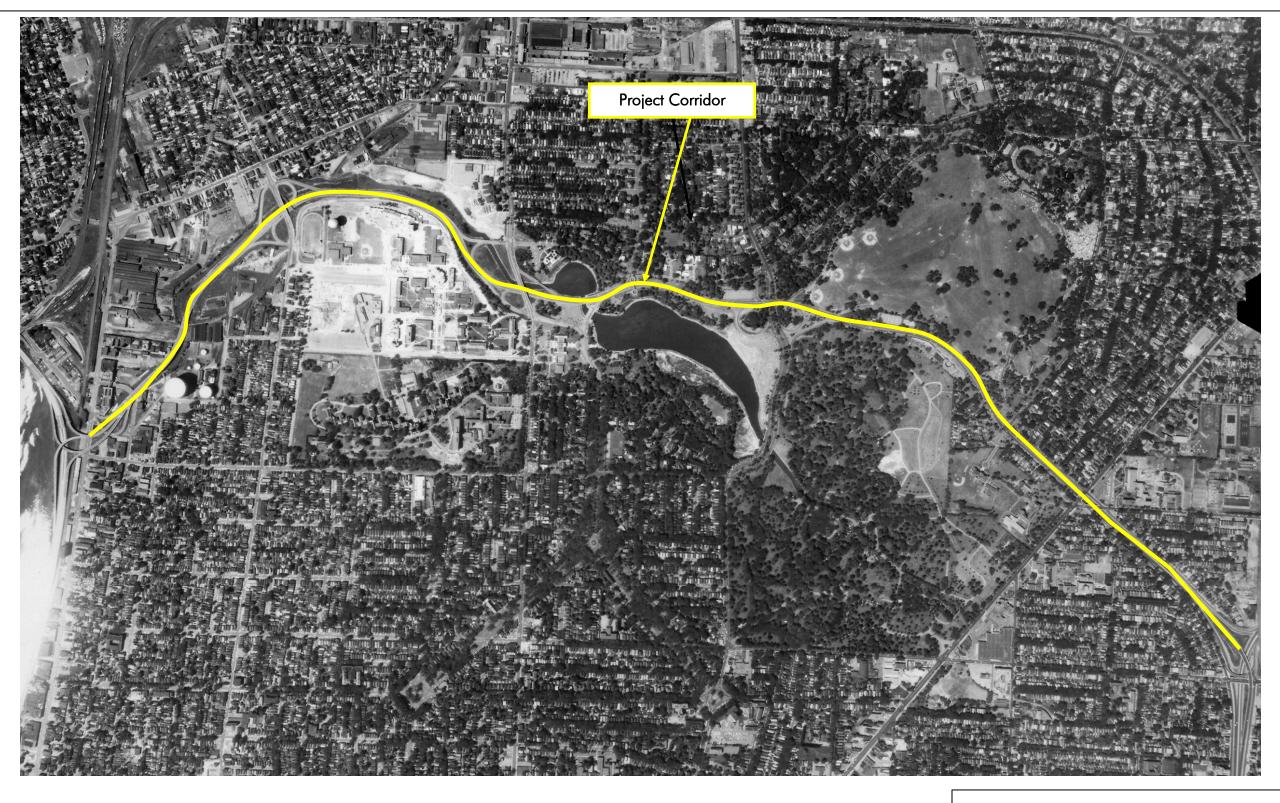



SOURCE: University of Buffalo Library Map Collection, 1966

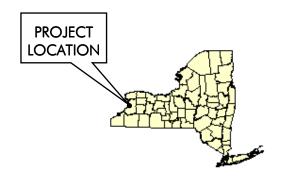


## 1966 Aerial Photo

NYS Route 198 – Scajaquada Expressway
PIN 5470.22
Buffalo, Erie County, New York

Not to Scale

June 2008

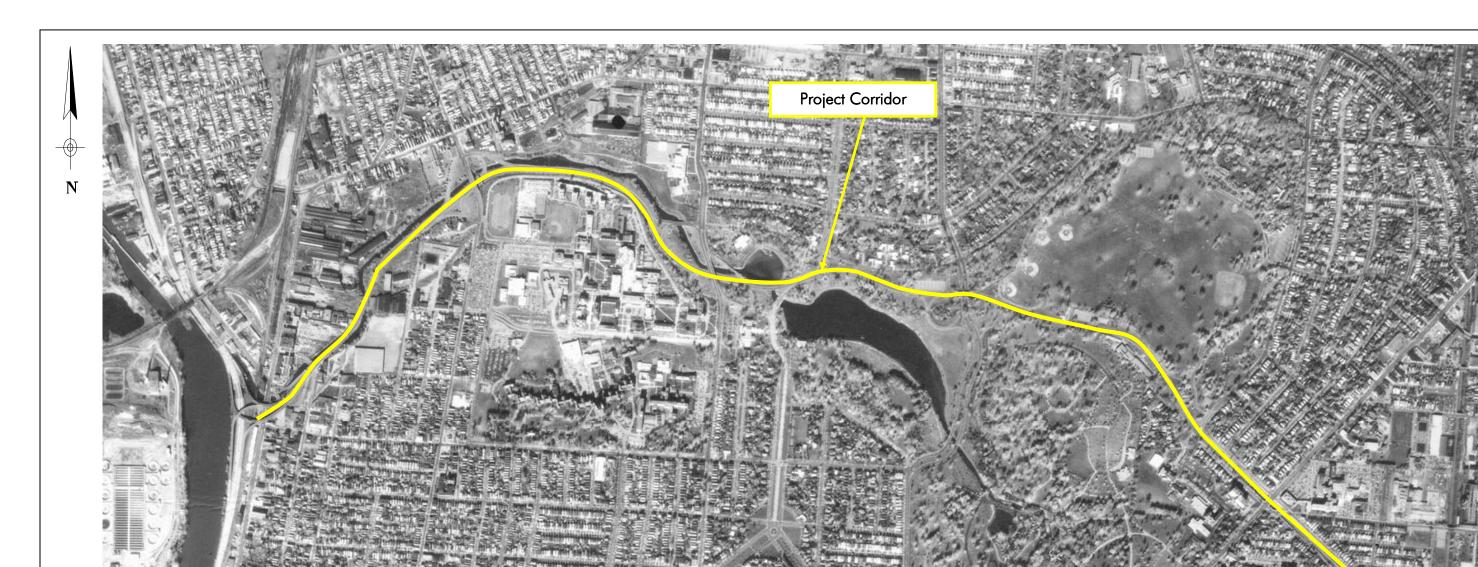



1978 Aerial Photo


NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York

Not to Scale

June 2008

Watts Architecture & Engineering, P.C. 3826 Main Street Buffalo, New York


SOURCE: University of Buffalo Library Map Collection, 1978

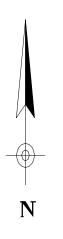





SOURCE: TerraServer USA 1995

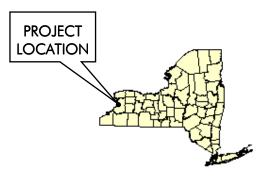


## 1995 Aerial Photo

NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York


Not to Scale

June 2008

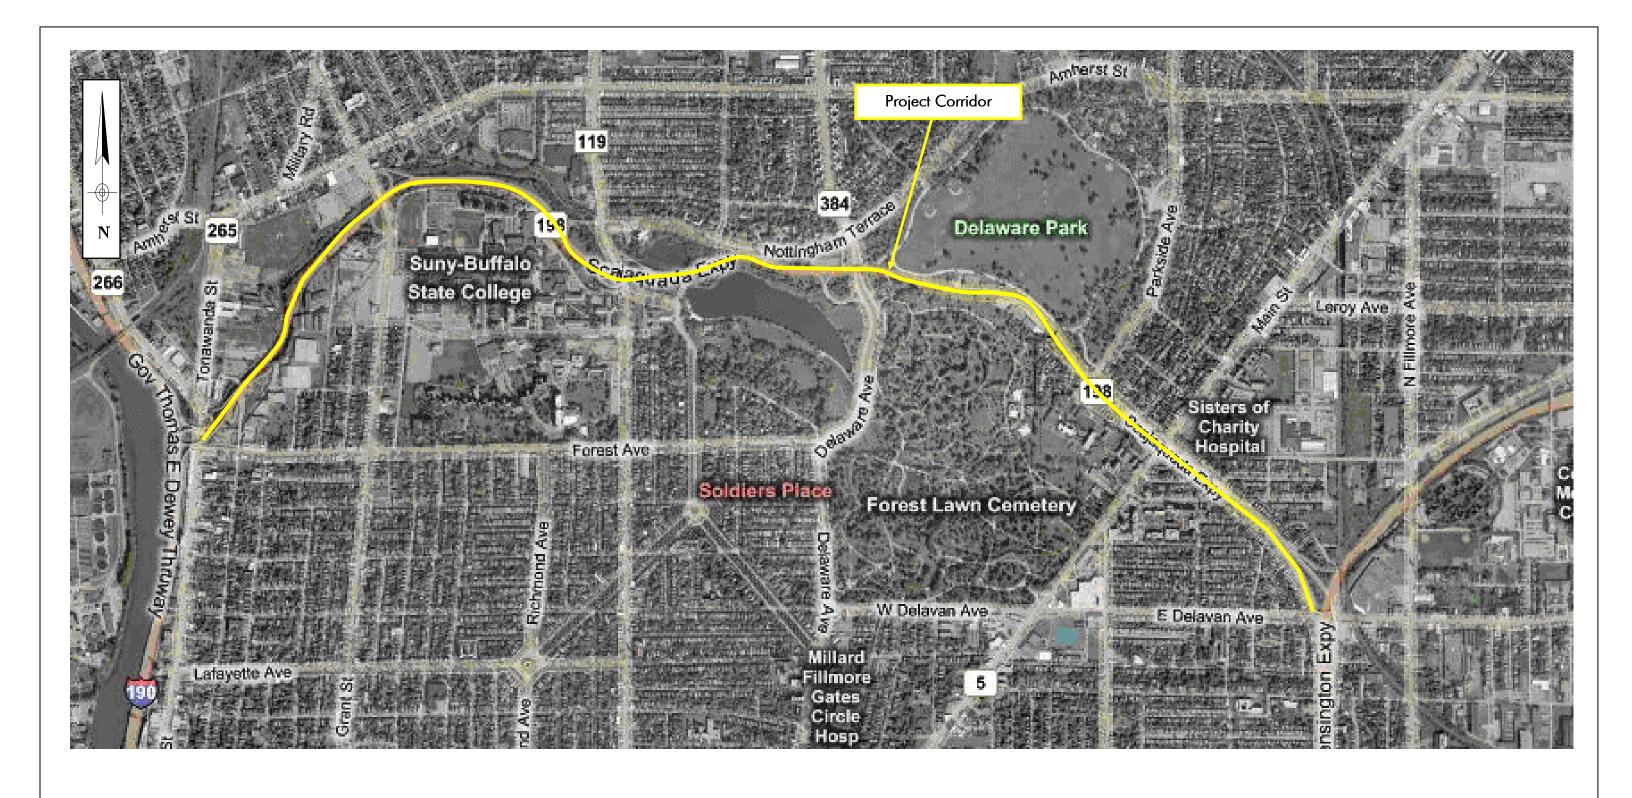



SOURCE: Microsoft Virtual Earth 2008

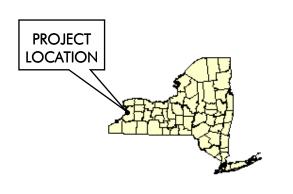



### 2008 Aerial Photo

NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York

Not to Scale

June 2008

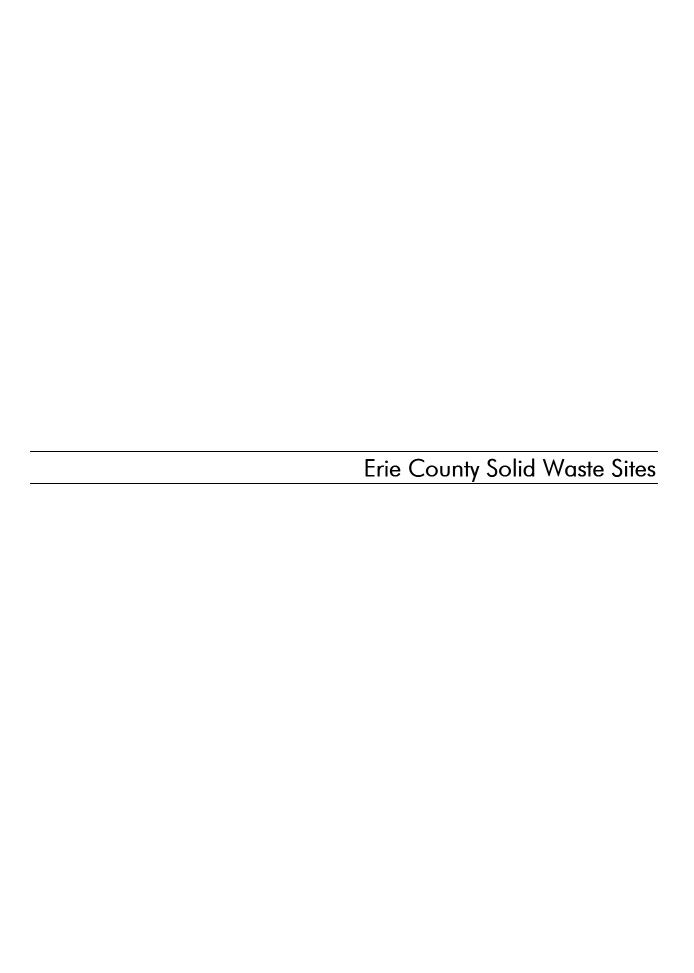

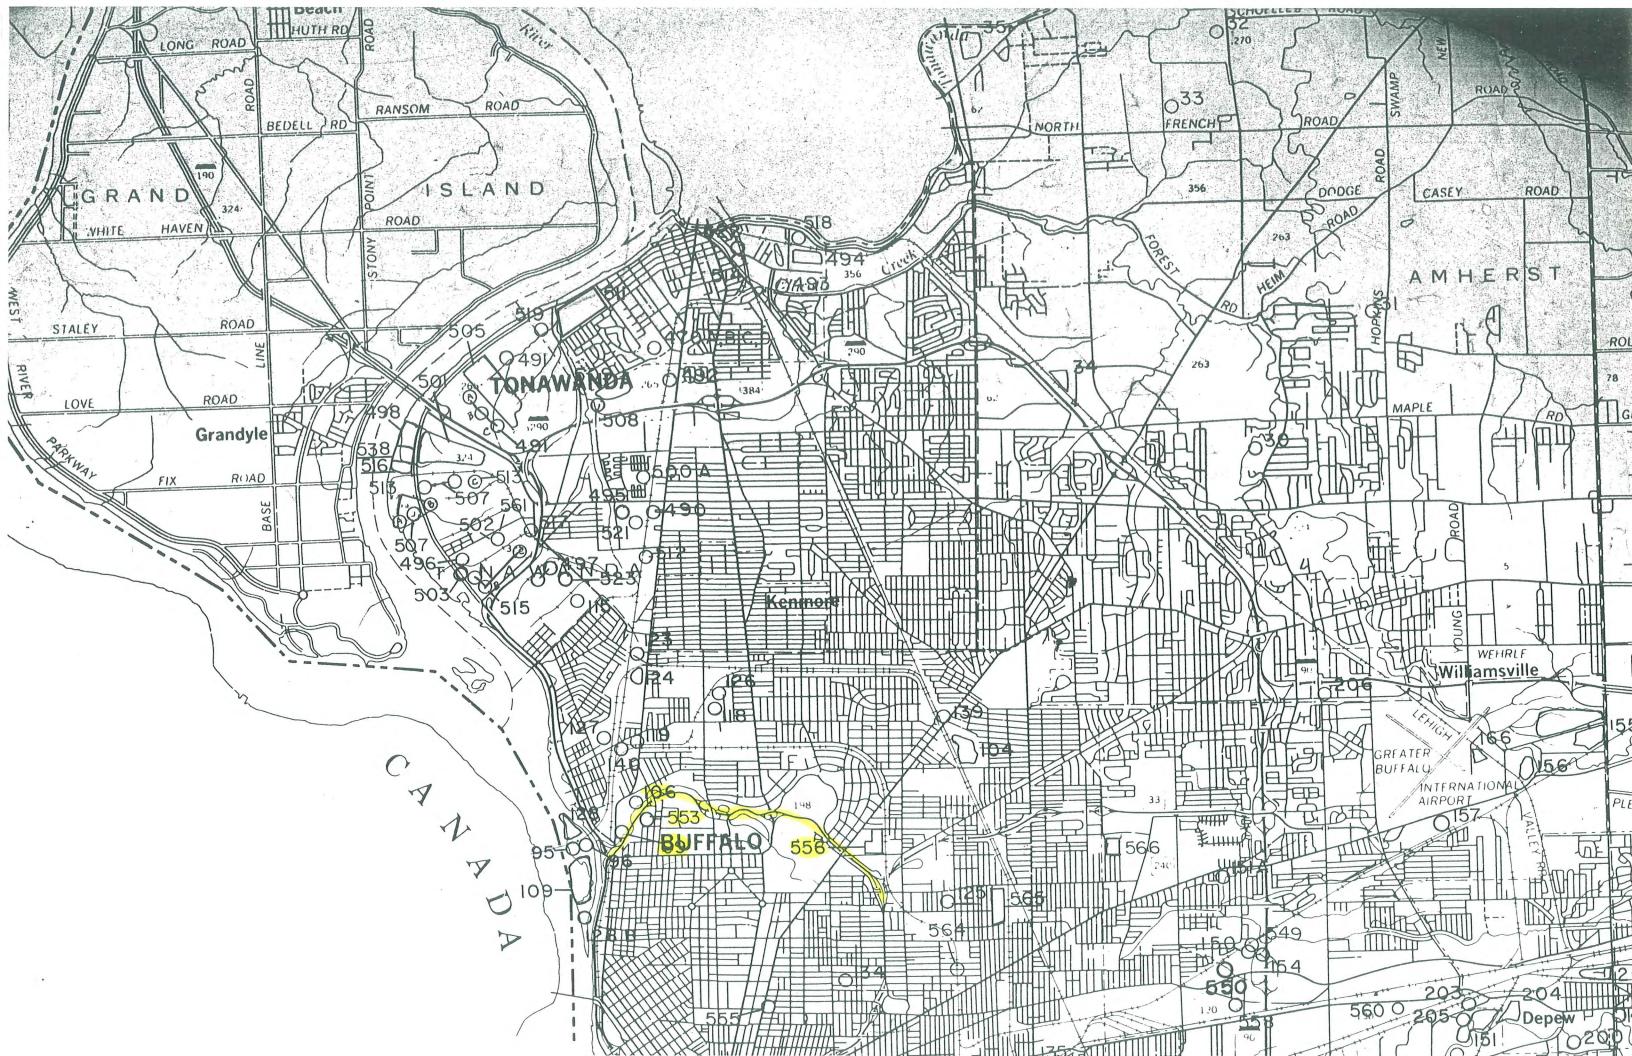

# ERIE COUNTY SOLID WASTE SITES BODEP DIVISION OF PLANNING LAST UPDATED ON 08/16/96 USING 04/96 DEC REPORT


DEF #				QUÁD.	NYS DEC	NYS	TYPES	DATE SITE	IN AN-
FROM MAP	NAME OF SITE	ADDRESS OF SITE	MUNICIPALIT OF SITE		SITE #	DEC	OF WASTE	WAS 1ST MAPPED	COUNTY 7
63	PROCKNAL AND KATRA TRUCKING CO INC	LAKE AVE	BLASDELL	7	915085	D0190	MC	08-85	N
64	J W COMPER CO	MILE STRIP PD	BLASDELL	7			D	08-85	N.
80	BRANT LANDFILL	HARDPAN RD .	BRANT	16	915103	D1285	GMX.	06-25	V.
81	WIDE BEACH	WIDE BEACH OFF O	BRANT	26	915119	(L)	IT	08-85	N
90	ALLIED CHEM-SPEC CHEM DIV	LAKESHORE RD 35 LEE ST	BUFFALO	7	915004	D0493	IT	08-85	N
91	ALLTIFFT	TIFFT ST	BUFFALO	7	915054	2	17	08-85	M
92	BENGART AND MEMEL INC	1091 CLINTON ST	BUFFALO	5	915115	Ŀ	IT	08-85	Ν
93	CITY BUFFALO TRANSFER STA	793 SO OGDEN ST	BUFFALO	5			GMX	08-85	N
93A	AGWAY CHEMICAL	BABCOCK AND FLEMING STS	BUFFALO	5		210	IT ?5	08-85	N '
94	CITY OF BUFFALO	HOPKINS ST	BUFFALO	7	915011		M	08-85	N
95	CITY OF BUFFALO INCINERATOR	SQUAW ISLAND	BUFFALO	6			IM	08-85	N
96	CITY OF BUFFALO TRANSFER STA	SQUAW ISLAND	BUFFALO	6			X	08-85	N
97	BUFFALO COLOR	340 ELK ST	BUFFALO	7	915012	2	17.	08-85	N
97B	BUFFALO COLOR-WEATHER ING AREA "D"	MERGED WITH A TO FORM 97	BUFFALO	7	915012			08-85	N.
97C	BUFFALO COLOR-DEEP WELL	340 ELK ST	BUFFALO	7	9150120	D1089	<u>I</u> ī	01-90	N
	DONNER HANNA COKE	ABBY AND MYSTIC STS	BUFFALO	7	915017	3	DI	08-85	. 61
	FEDDERS AUTO	57 TONAWANDA ST	BUFFALO	6	915024	3	IŤ	08-85	1-1
101		1818 FUHRMANN BLVD	BUFFALO	7	915029	24	DI	08-85	N
	HOUDAILLE MANZEL DIV	315 BABCOCK ST	BUFFALO	7	915037	D0494	\$T	08-95	N


ERIS COUNTY SOCIO WASTE SITES ECDEP DIVISION OF PLANNING LAST UPDATED ON 08/16/96 USING 04/96 DEC REPORT

DEP					NYS			DATE	In Alv-
FROM MAP	NAME OF SITE	ADDRESS OF SITE	MUNICIPALITY OF SITE	QUAD. MAP #	DEC SITE #	NYS DEC CLASS	TYPES OF WASTE	SITE WAS 1ST MAPPED	OTHER COUNTY
109	HOUGHTON PARK LASALLE RESERVOIR	CLINTON ST AMHERST ST	BUFFALO BUFFALO	7 6	915059 915033	3 D0493	DIT	08-85 08-85	N N
105	LEHIGH VALLEY	TIFFT ST ADJACENT TIFFT FARM	BUFFALO	Ŧ	915071	5	IT .	08-85	N
106	PRATT AND LETCHWORTH	189 TONAWANDA	BUFFALC	6	915045	2019	6	08-85	N
107A	MOLLENBERG-BE		BUFFALO	5	915041	D0791	I	.08-85	N
107A	MOLLENBERG-BE	300 SCOTT ST	BUFFALO	7	915041	D0791	Ī	08-85	6)
107B	INDEPENDENT CEMENT CO	1751 FUHRMANN BLVD	BUFFALO	7			D	OS-85	N
108	MOBIL OIL CORP	535 ELF ST	BUFFALO	7	915040	3	IT.	05-85	14
109	CITY OF BUFFALO LANDFILL	SQUAW ISLAND	BUFFALO	6.	915052	D0192	DGFIMT	08-85	N
110	RAMCO STEEL	110 HOPKINS ST	BUFFALO	7	915046B	2	IT	23-35	N
111	REPUBLIC STEEL (LTV)(MARILLA ST LF)	MARILLA ST(S) & HOPKINS ST(W)	BUFFALO	7	915047	2	ĪŢ	08-85	N
113	TIFFT FARM NATURE PRESERVE	1200 FUHRMANN BLVD	BUFFALO	7	915072	5	îT	08-85	N
	TIMES BEACH	FUHRMANN BLVD	BUFFALO	6	915080	D1091	IT.	08-85	N
	TIMES BEACH	FUHRMANN BLVD	BUFFALO	7	915080	D1091	IT	08-85	N
	STEEL-EASTERN LIMESTONE DIV	KATHERINE ST	BUFFALO	7	215113	D0495	1	08-85	N
	ERIE BASIN MARINA	ERIE ST	BUFFALO	6	915013	D1285	I	08-85	N .
	TRW-J H WILLIAMS DIV	400 VULCAN ST	TONAWANDA T	6	915057	D0188	1	08-85	.N
:17A		BAILEY AVE NEAR WILLIAM ST	BUFFALO	5			D	08-85	N
		SOUTH OF TIFFT ST	BUFFALO	7			DI	08-85	N
118	KITTENGER CO		BUFFALO	6			ΞŢ	08-85	<b>N</b>

# ERIE COUNTY SOLID WASTE SITES ECDEP DIVISION OF PLANNING LAST UPDATED ON 08/15/96 USING 04/96 DEC REPORT

DEP		OLDATED ON OS	/15/96	USING	04/96	DEC REPO	OPT.		
FROM MAP NAME OF S		MUNICIPAL: OF SITE	ITY	QUAD. MAP	NYS DEC SITE #	I dealer and the second	DATE TYPES SITE OF WAS WASTE MAPP	1ST CO	AN- HER UNTY
549 PYRAMID CO 550 DELAVAN INDUSTRIES 551 CLOUSE	1728 WALD	EN CHEEKTOWAG	A A	5 9	915137 115138	D0491	T 05-8	9 N	
RESIDENCE (FLETCHER SITE)		CHER NEWSTEAD		31 9	15139		7 06-89	14	
552 TENNESEE G PIPELINE S' 229	AS 7586 EAST TA EDEN RD	EDEN		18 91	5140	2 <u>I</u>	T 12-89	T.	
553 IROQUOIS GAS/WESTWCC PHARMACEUTI	DART (& DD BRADLEY) ST CA	BUFFALO	6	91	5141 5	2 17		N	
554 B.B.C. ENTERPRISES	25 DEPOT ST	BUFFALO	5	915	5142 D	0493 IT	X		le
PRESERVING (	CO ST	ALO	5		143 2	0493 IT IT	09-90	N	
MOHAWK DEWEY AVE SERVICE	95 DEWEY AVE (144 KENSINGTON)	E BUFFALO	5		144 5	ĪT	09-90	N	
STA 7557 LEHIGH INDUSTRIAL PARK (ROBLIN	31 SOUTH ST	LACKAWANNA	7	915	145 2	ΙŢ	04-91	N	
SCRAP) 558 NIAGARA TRANSFORMER 559 NATIONAL FUEL	1747 DALE RD	CHEEKTOWAGA	5	9151	46 2	IT	04-91		
GAS 560 ARO	ST	BUFFALO	6			Ī	04-91	N	
CORPORATION 561 O-CEL-O	3695 BROADWAY		20	91514	47 2	I	05-91	N	
SPONGE (SEE NO. 502) 562 SCOTT	AVE	TONAWANDA T	6	91514	8 3	Ï	08-91	N	
AVIATION	225 ERIE ST.	LANCASTER	20	91514	9 2	I	11.02		
(VOELKER ANALYSIS)	31.	BUFFALO	š	915150		I	11-91. 03-92	. N	
54 318 URBAN ST. ; (PYRAMID STEEL)			5	915151	D049.		03-92	N	
SS SAGINAW-BUFFA 1	001 DELAVAN E	BUFFALO	5	915152	3	ΙT	09-92	N	

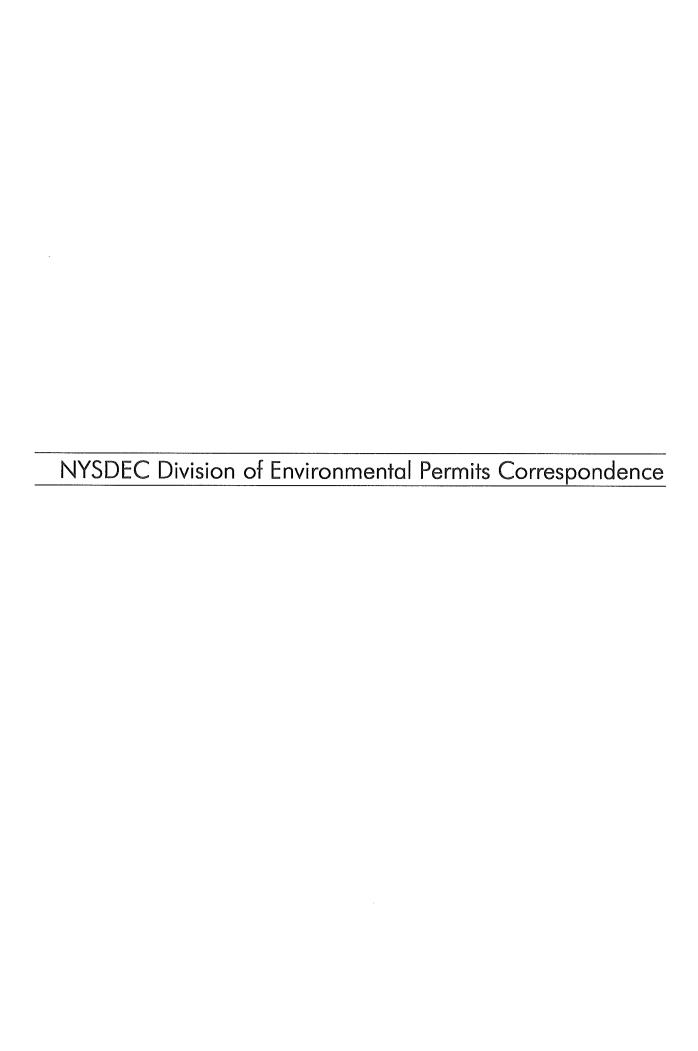

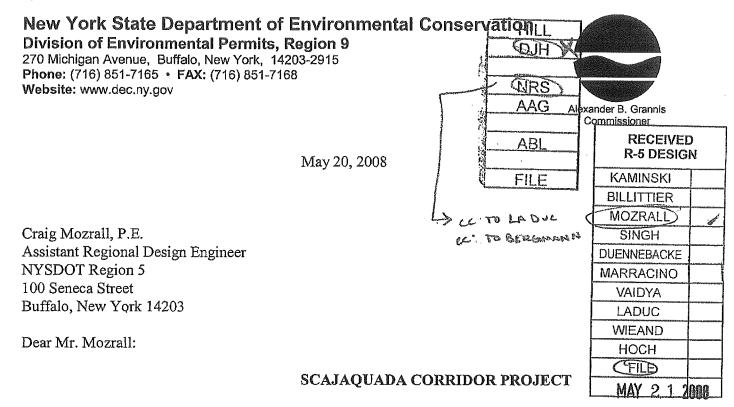

We have reviewed available materials regarding the Scajaquada Corridor project. A section of Scajaquada Creek is immediately adjacent to the Scajaquada Expressway. The plans also show increasing the size of Hoyt Lake to what is called its "historic size". Any impacts, either direct or indirect, to the creek or lake would be of concern to the Department.

When the environmental setting is described in the Draft Environmental Impact Statement (DEIS), the creek and its corridor should be included. However, the project is in such an early stage of design that the Department is not able to advise how much data collection regarding the creek should occur. It is also difficult to be specific regarding issues the Department would wish to comment on until more information is available on each alternative. In general terms, the scope and amount of data collection to be done should be commensurate with the maximum amount of impact (to the creek and lake) from the most intrusive alternative.

We recommend that a final scope for the project be created after plans are developed that identify the construction activities. That would include any changes to stormwater management.

Background Information and Possible Issues:

1. There are several remediation sites immediately north of Scajaquada Creek.

Mr. Greg Sutton of our Division of Hazardous Waste Remediation should be contacted for information about those remediation sites. Remedial work for one of the sites included dredging contaminated sediments in Scajaquada Creek. There were also wells drilled under the creek to collect contaminated groundwater. Since remedial action has taken place in the creek, it is necessary to determine if any of the highway design alternatives have the potential to affect any of the sites or locations where off-site remediation has occurred. There are also contaminated sections of the creek where no remediation occurred. The amount of information that should be included in the DEIS would have to be reflective of where physical disturbances could occur and the extent of those disturbances.

- 2. Floodplain The Department, acting in its capacity as state coordinating agency to the National Flood Insurance Program, can provide comments on any floodplain issues. Mr. Donald J. Poleto, City of Buffalo Floodplain Coordinator, 502 City Hall, Division of Engineering, Department of Public Works, (716/851-5359) can be included in the stakeholders group if there are any impacts to the floodplain.
- 3. Hoyt Lake Federal "Clean Lake" funds were used in the early 1980s to improve the water quality of the lake. Any proposed activities that negatively affected the water quality of the lake may be in conflict with the purpose of that federal funding. Conversely, the project may provide opportunities that would improve the water quality of Hoyt Lake. The disposal options for any excavated materials would have to be determined if Hoyt Lake were to be returned to its historic size.
- 4. Stormwater Pollution Prevention Plan (SWPP) Mr. Bill Smythe of the Department's Division of Water will be reviewing the SWPP and can be contacted (716/851-7070) regarding its development. There may be design opportunities to improve the water quality of any highway related discharges to Scajaquada Creek and/or Hoyt Lake.
- 5. Sediments may require special handling by construction workers since pathogens have been found in sediments in the area.
- 6. Our Division of Air Resources, Albany staff, can review the model created to describe the changes in vehicular air emissions that would result from both road design and motorist behavior changes. Mr. Larry Sitzman, the Regional Air Pollution Control Engineer (716/851-7130), is the contact for air pollution issues.
- 7. Disturbances to Scajaquada Creek may be regulated by the U.S. Department of the Army, Corps of Engineers, Buffalo District Office. The Corps could require that an individual Water Quality Certification be obtained from DEC.
- 8. The riparian vegetation along the creek corridor should not be compromised by the project. The vegetation should be maintained or enhanced. Plantings adjacent to the creek are shown in the alternatives. The choices of particular tree species should consider their benefits to wildlife especially in the vicinity of the creek. Additional mowing in the stream corridor would not be recommended. Wading birds such as black-crowned night herons, green herons, and great-blue herons likely use this creek in which to feed and rest, using the overhanging shrubs and branches as cover. In addition to the use by local breeding birds (herons listed), this corridor contributes to migration habitat for passerine (perching) birds. Delaware Park and Woodlawn Cemetery, which the creek passes through, are significant birding areas. It is likely that painted turtles use the stream bank in which to lay eggs so the bank should remain relatively undisturbed and available for their use. Steelhead trout use the creek, and several other fish species are found there. Siltation brought on by construction would be a detriment to their survival. It is likely the Department will request a complete survey of the fish and wildlife species of this corridor as the design stages progress.

Craig Mozrall, P.E. May 20, 2008 Page 3

9. Cleanup of the creek bed itself should be considered part of the renovation of the parkway, including removal of all debris and litter. Installation and maintenance of trash receptacles along the walkways should be part of the long-term maintenance of this parkway.

If you have any questions or need clarification on any items in this letter, please do not hesitate to contact me at this office.

Respectfully,

Douglas E. Borschel

Deputy Permit Administrator

Doyler P. Borselif

#### DEB:vm

cc: Ms. Abby Snyder, Regional Director

Mr. Gregory Sutton, Division of Environmental Remediation

Mr. Gerard Palumbo, Division of Water; Attn: Mr. William Smythe


Mr. Larry Sitzman, Division of Air Resources

Mr. Paul McKeown, Division of Fish, Wildlife and Marine Resources; Attn: Mr. Michael Wilkinson


Mr. Mark Kandel, Division of Fish, Wildlife and Marine Resources; Attn: Ms. Connie Adams

Mr. Donald Poleto, City of Buffalo, Floodplain Coordinator

U.S. Department of the Army, Corps of Engineers, Buffalo District Office

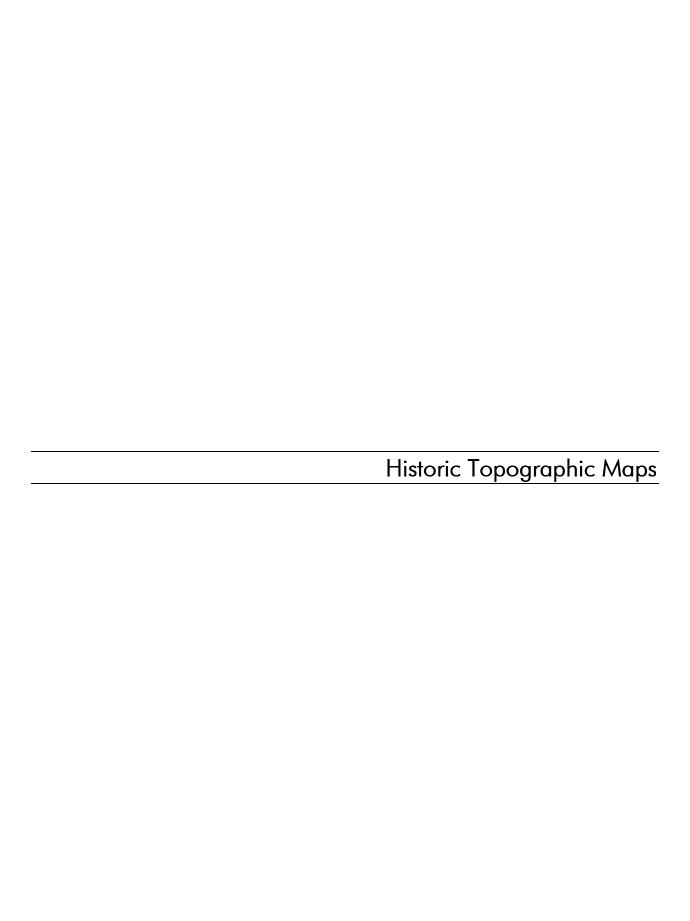



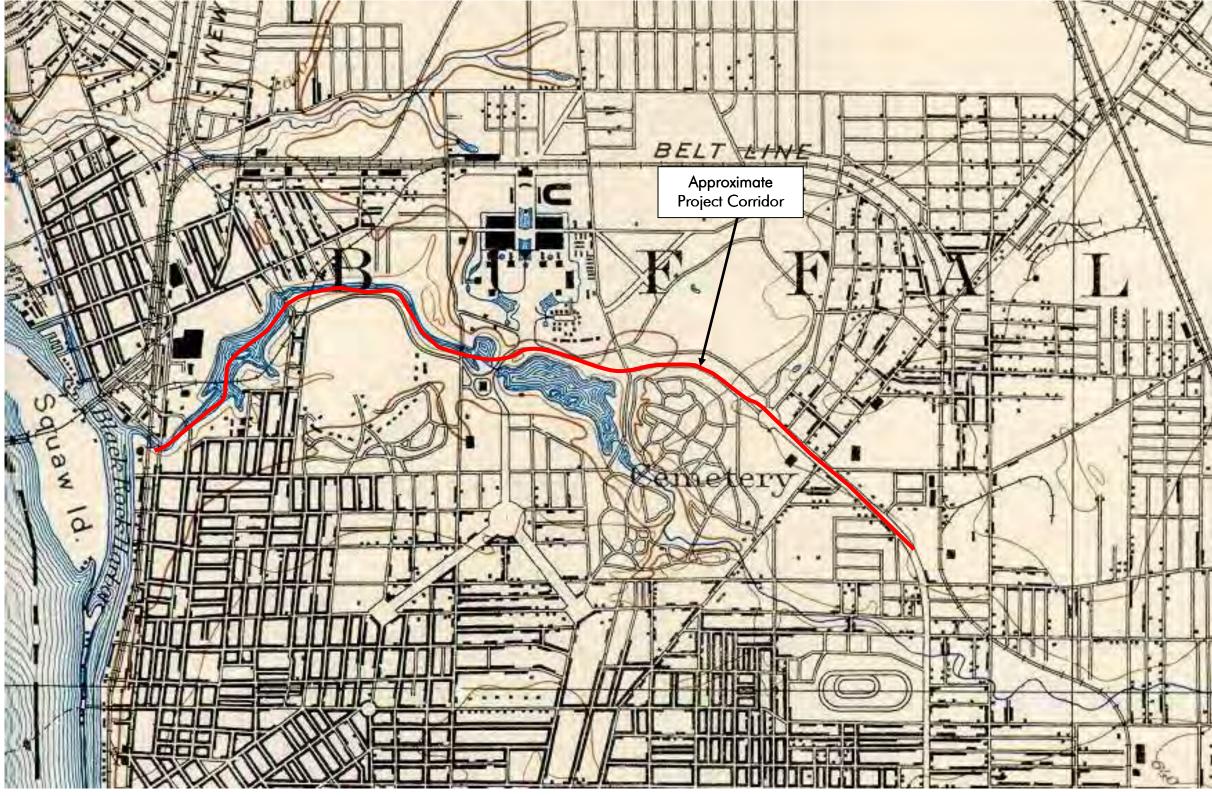



Source: USGS 7.5 x 15' QUADRANGLE "Buffalo" 1901




### 1901 Topographic Map

NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York


Not to Scale

July 2008

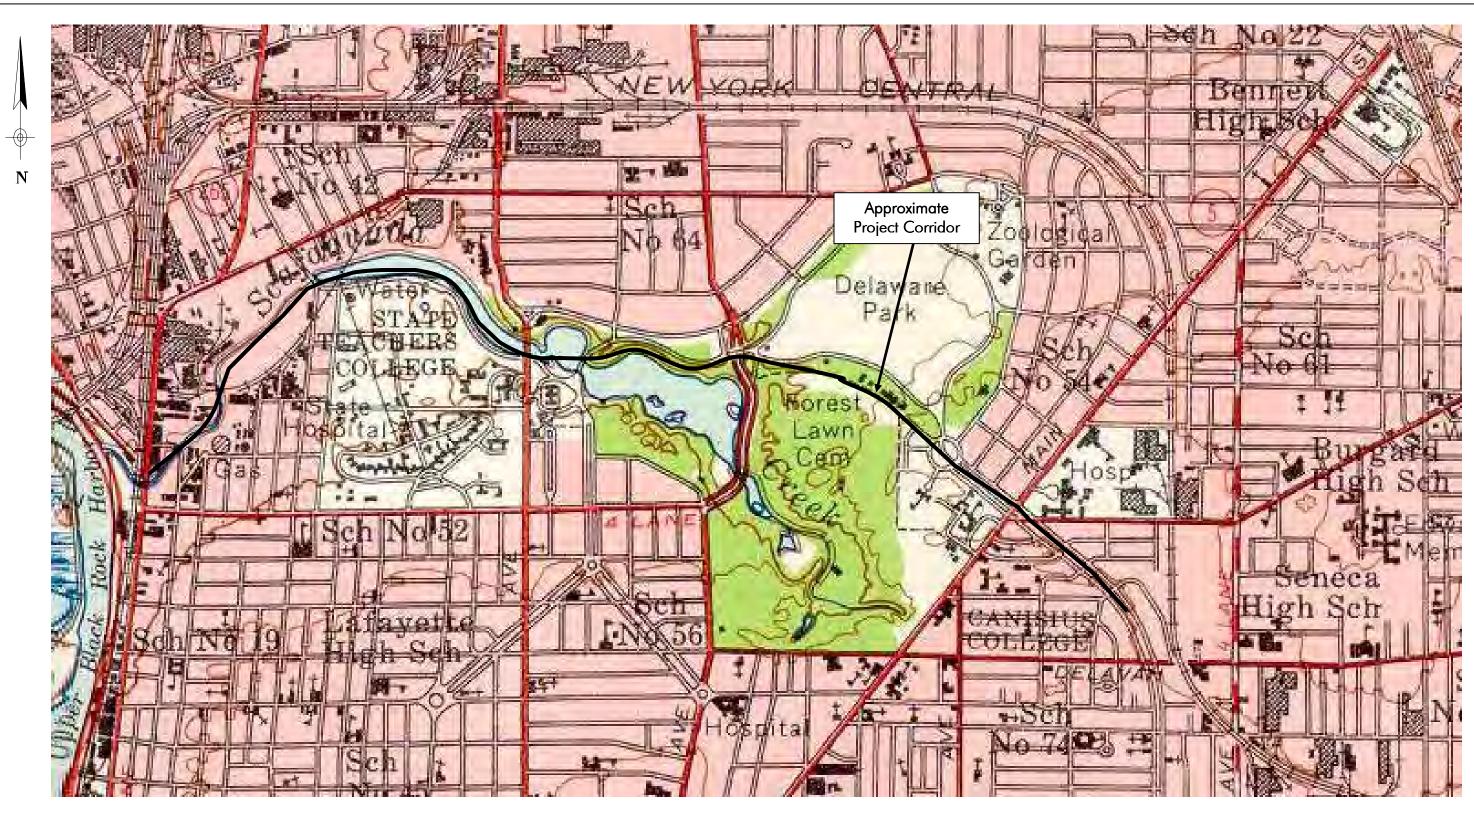



Source: USGS 7.5 x 15' QUADRANGLE "Buffalo" 1948

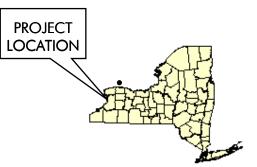


### 1948 Topographic Map

NYS Route 198 – Scajaquada Expressway PIN 5470.22 Buffalo, Erie County, New York

Not to Scale

July 2008

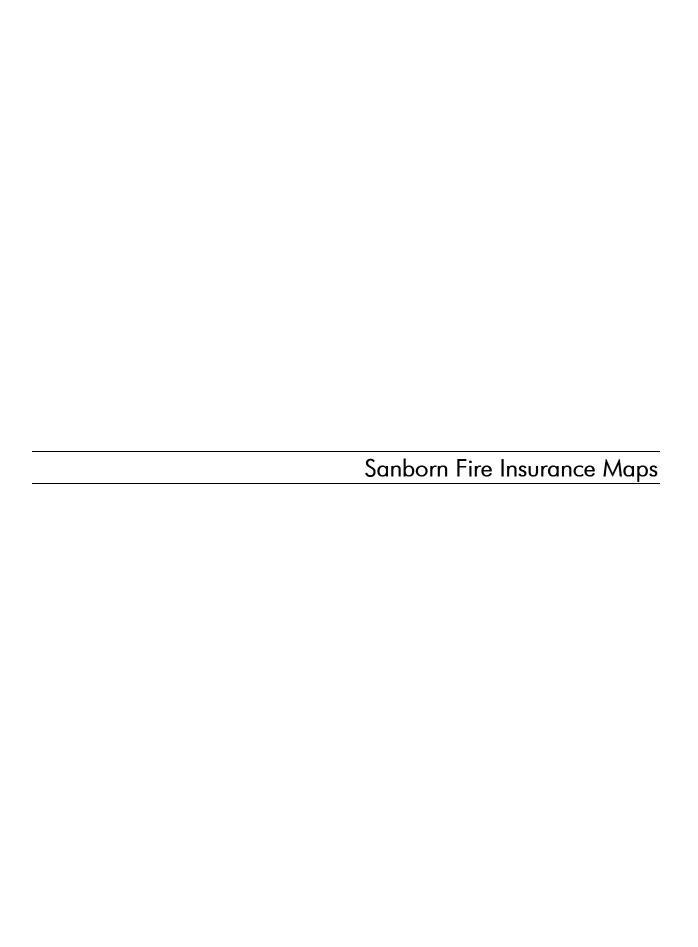



#### FIRE INSURANCE MAP ABSTRACT RESEARCH RESULTS

4/25/2008

5466

#### NY 198 BUFFALO, NY 14216

Listed below, please find the results of our search for historic fire insurance maps, performed in conjunction with your Environmental FirstSearch® report.

State	City	Date	Volume	Sheet Number(s)
New York	Buffalo	1986	4	INDEX, 331, 339, 363, 364, 365, 366, 367,
				368, 369, 370, 371, 406, 407, 408, 423
New York	Buffalo	1986	5	INDEX, 475, 476, 480, 481, 482, 483, 484,
				486, 491, 492, 501, 502, 503, 504, 505, 506, 535
New York	Buffalo	1981	4	INDEX, 331, 339, 363, 364, 365, 366, 367,
				368, 369, 370, 371, 406, 407, 408, 423
New York	Buffalo	1950	4	INDEX, 331, 339, 363, 364, 365, 366, 367,
		1	T	368, 369, 370, 371, 406, 407, 408, 423
New York	Buffalo	1950	5	INDEX, 475, 476, 480, 481, 482, 483, 484,
				486, 491, 492, 501, 502, 503, 504, 505, 506,
		T	Т	535
New York	Buffalo	1935	5	INDEX, 475, 476, 480, 481, 482, 483, 484,
				486, 491, 492, 501, 502, 503, 504, 505, 506, 535
New York	Buffalo	1916	4	INDEX, 331, 339, 363, 364, 365, 366, 367,
				368, 369, 370, 371, 406, 407, 408, 423
New York	Buffalo	1916	5	INDEX, 469, 470, 487, 488, 489, 494, 496,
				527, 528, 529, 530, 538
New York	Buffalo	1900	4	INDEX, 329, 330, 335, 336, 337, 338, 339,
				342, 350, 354, 370, 375, 408, 409, 414, 416, 420
New York	Buffalo	1893	4	INDEX, 177, 177a
New York	Buffalo	1889	3	INDEX, 104a, 114a, 116a, 117, 117a, 120, 120a


This abstract is the result of a visual inspection of various Sanborn® Map collections. Supporting documentation follows in the Appendix. Use of this material is meant for research purposes only.


#### Copyright Policy Disclaimer


Certain Sanborn® Fire Insurance Maps are copyrighted material and may not be reproduced without the expressed permission of the Sanborn Map Company or other authorized third party distributors. Any reproduction of this material is covered under the copyright law of the United States (Title 17 U.S. Code) for which customer assumes all liability for the making of photocopies or other reproductions of copyrighted material. FirstSearch Technology Corporation warrants that it will employ its best efforts to maintain and deliver its information in an efficient and timely manner. Customer acknowledges that it understands that FirstSearch Technology Corporation obtains the above information from sources FirstSearch Technology Corporation considers reliable. However, THE WARRANTIES EXPRESSED HEREIN ARE IN LIEU OF ALL OTHER WARRANTIES, either expressed or implied, including without limitation any implied warranty of merchantability or fitness or suitability for a particular purpose (whether or not FirstSearch Technology Corporation may know, have reason to know, or have been advised of such purpose), whether arising by law or by reason of industry custom or usage. ALL SUCH OTHER WARRANTIES ARE HEREBY EXPRESSLY DISCLAIMED.


# Appendix


Supporting Documentation

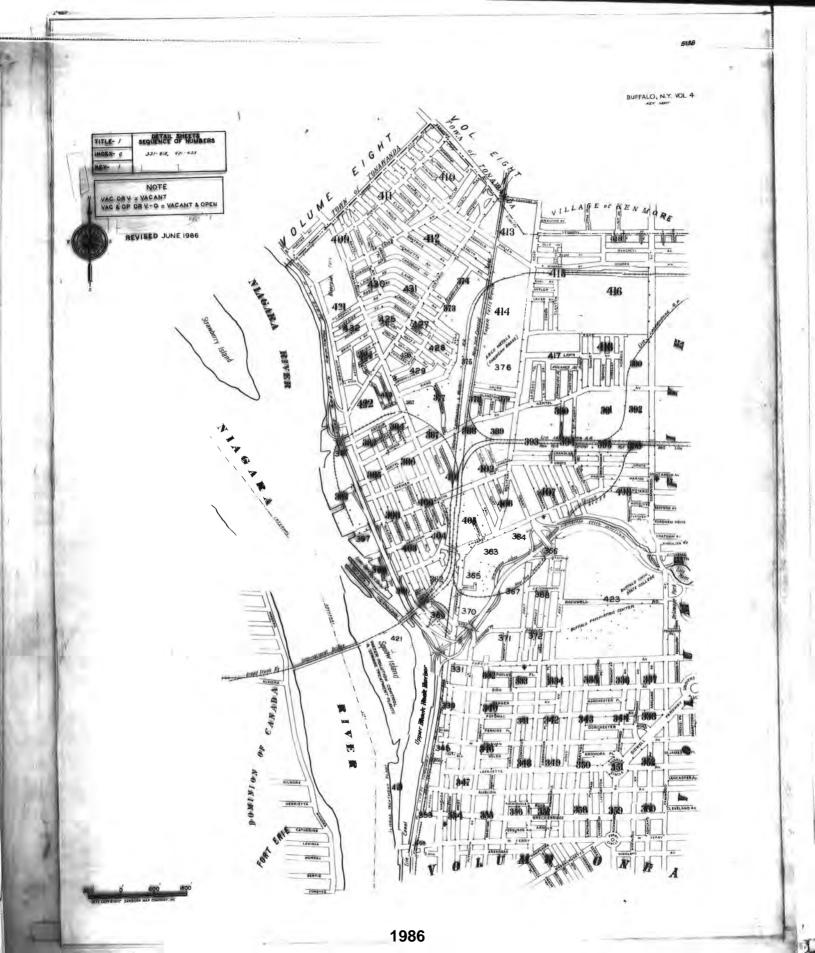


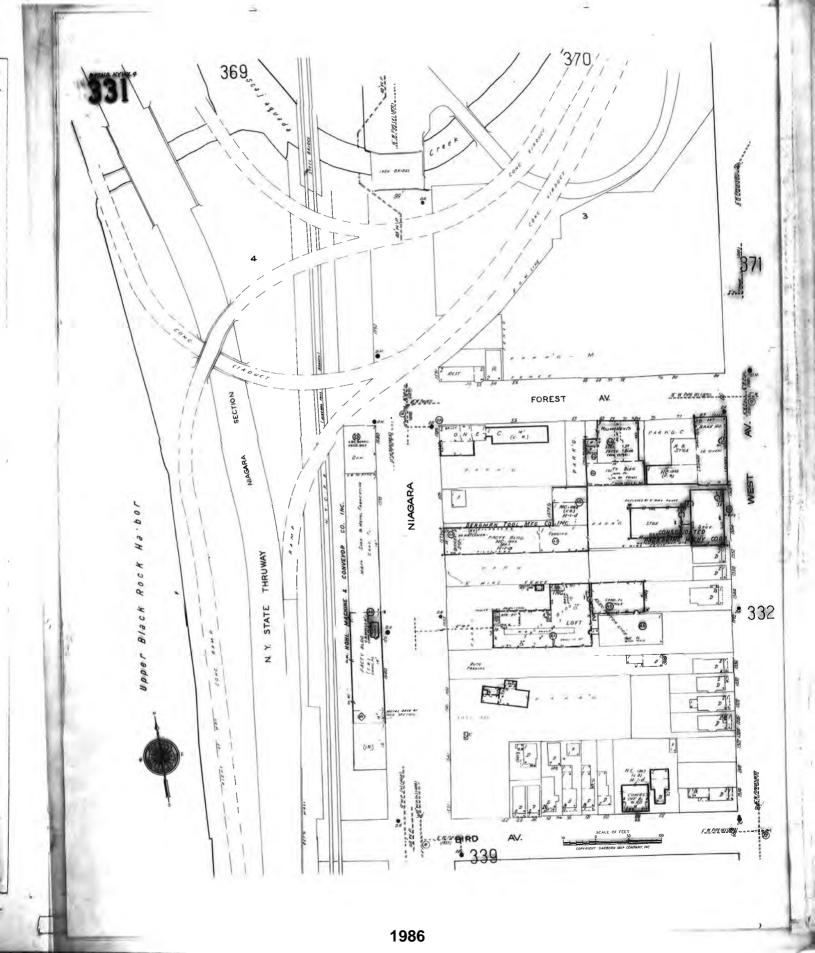


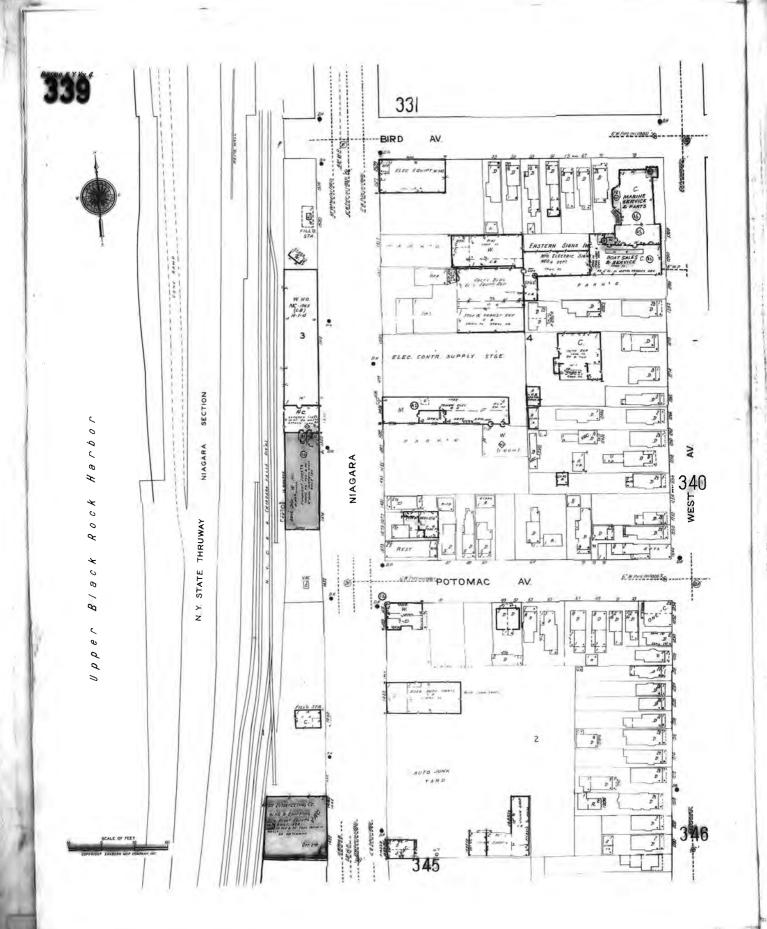


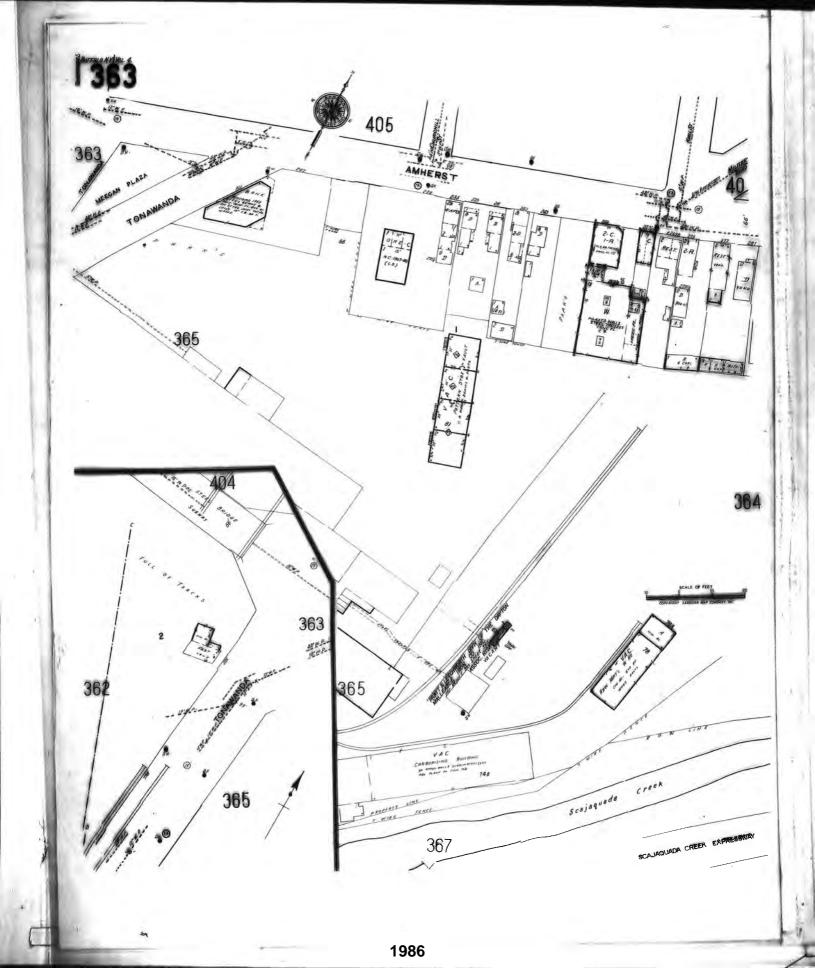


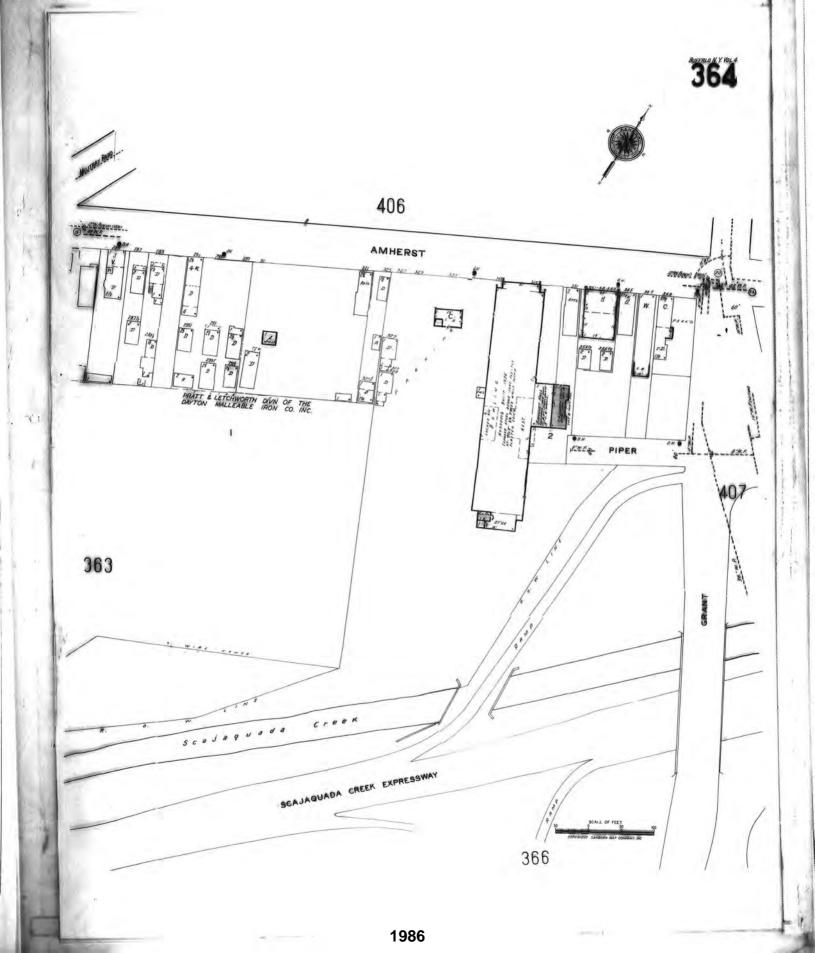


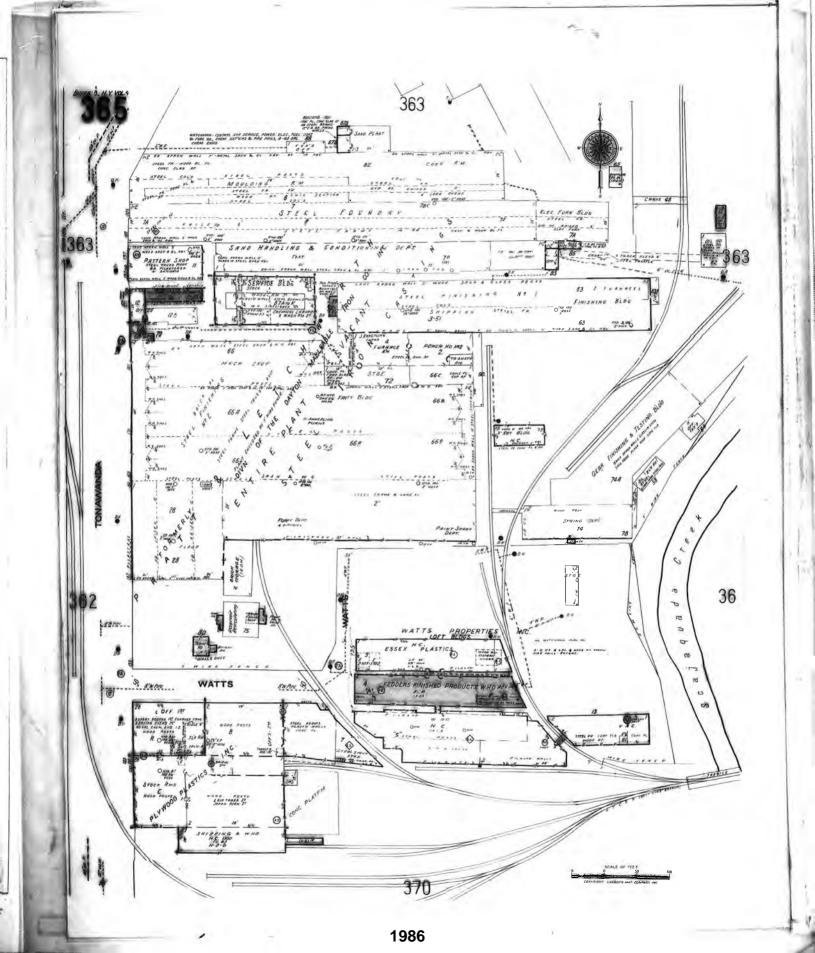


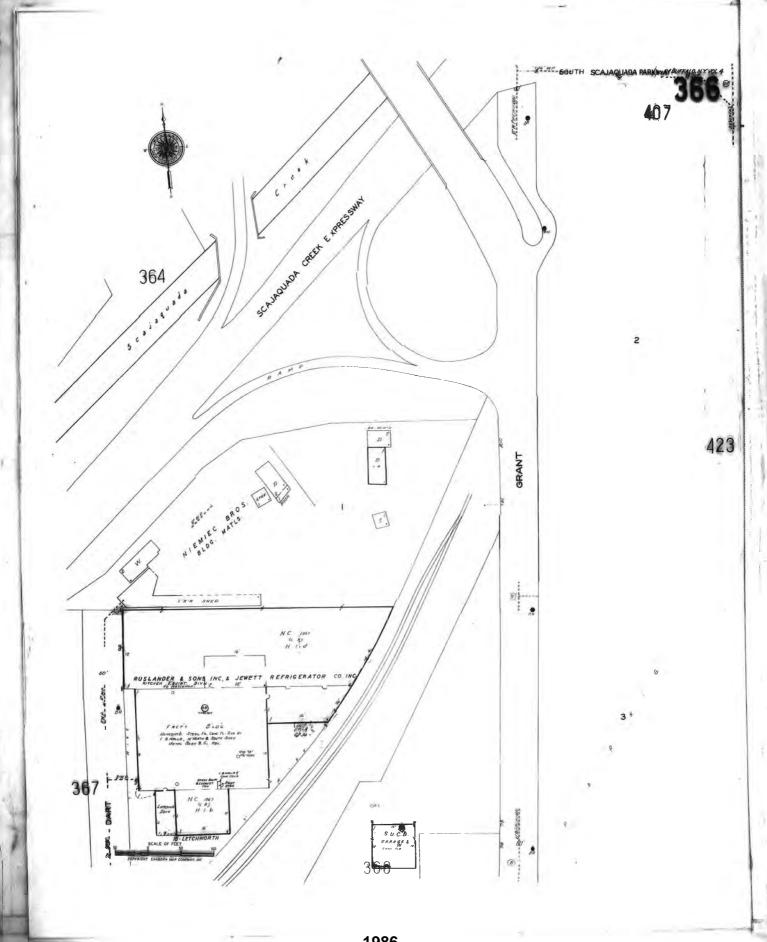


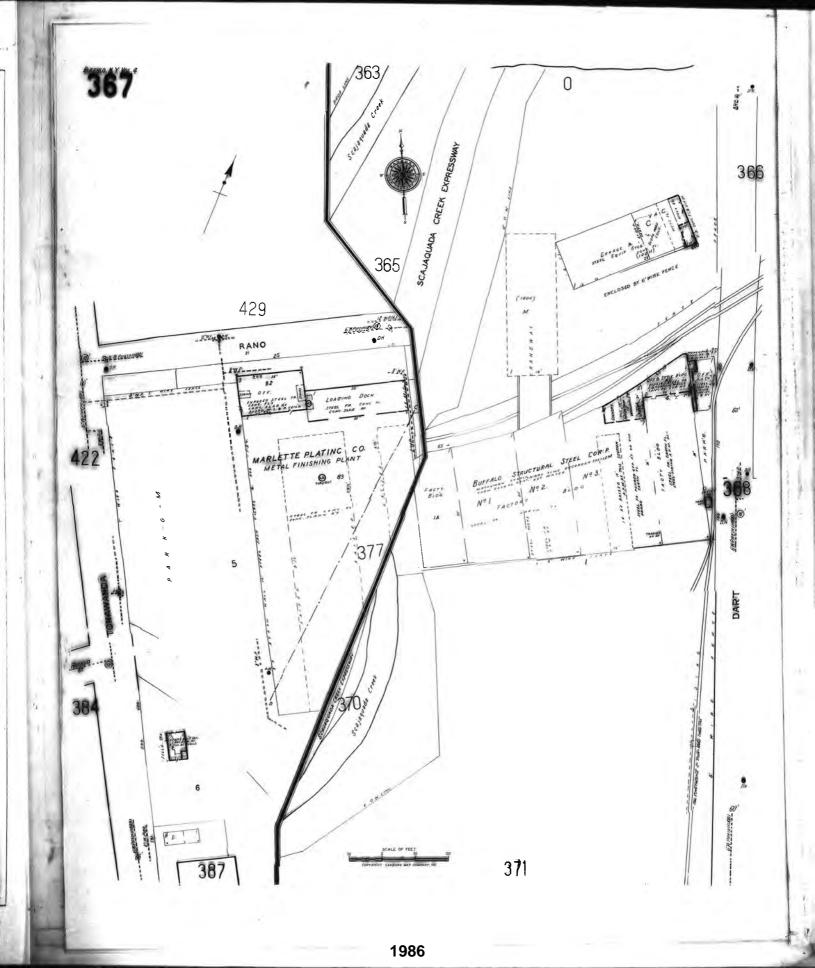


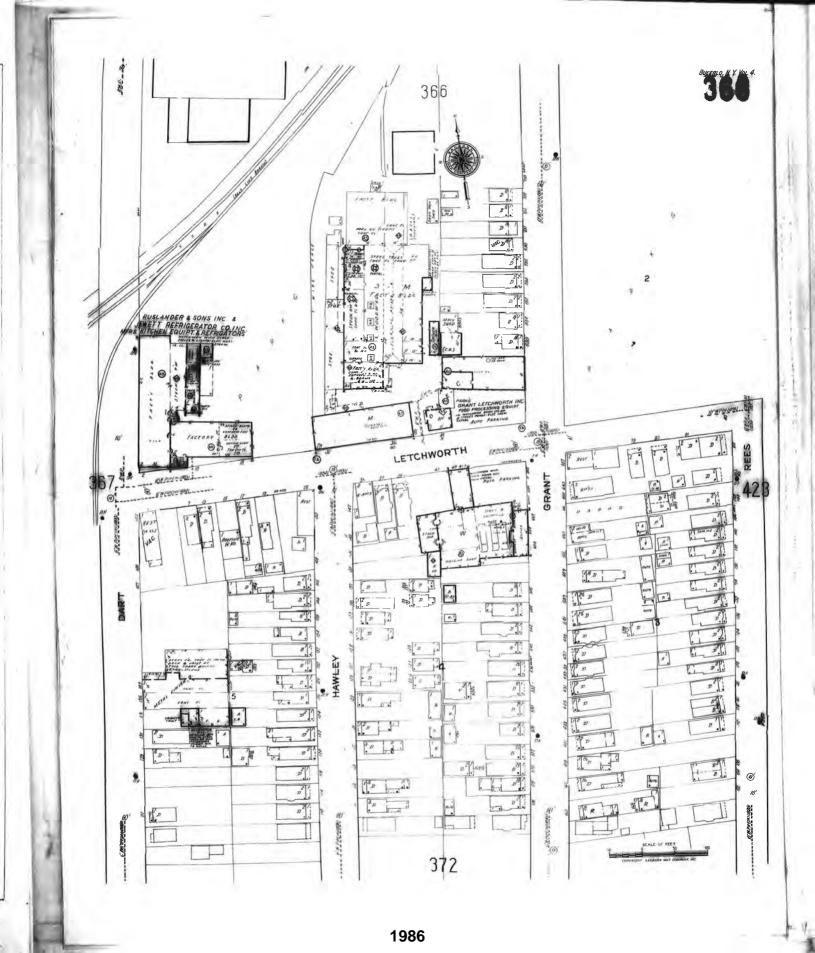


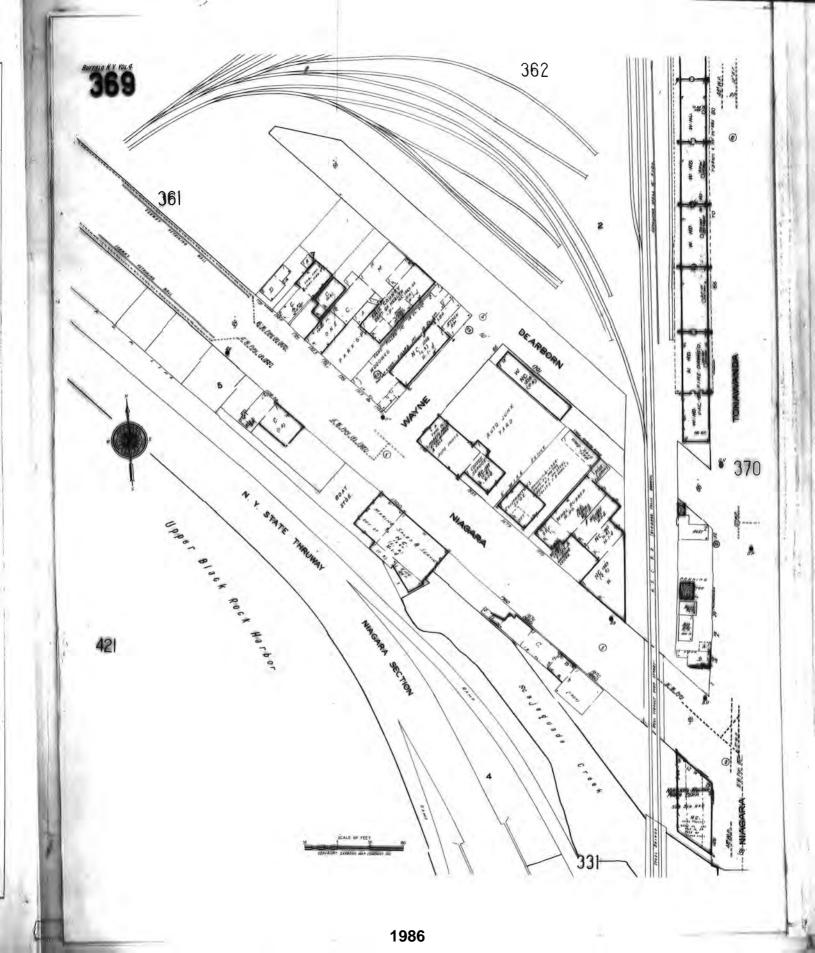


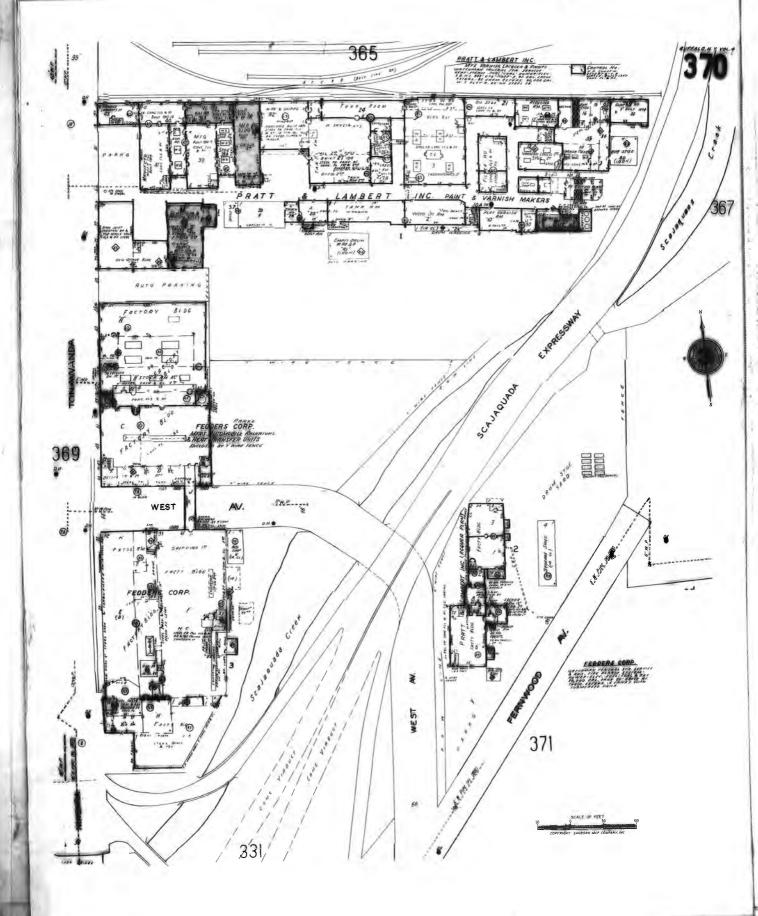


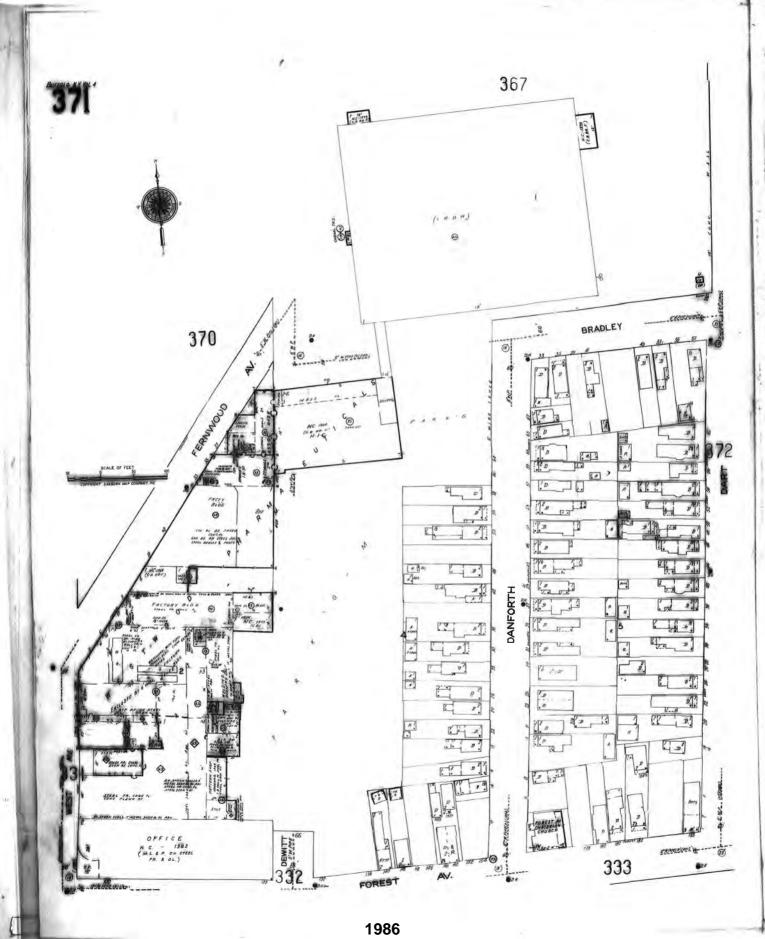

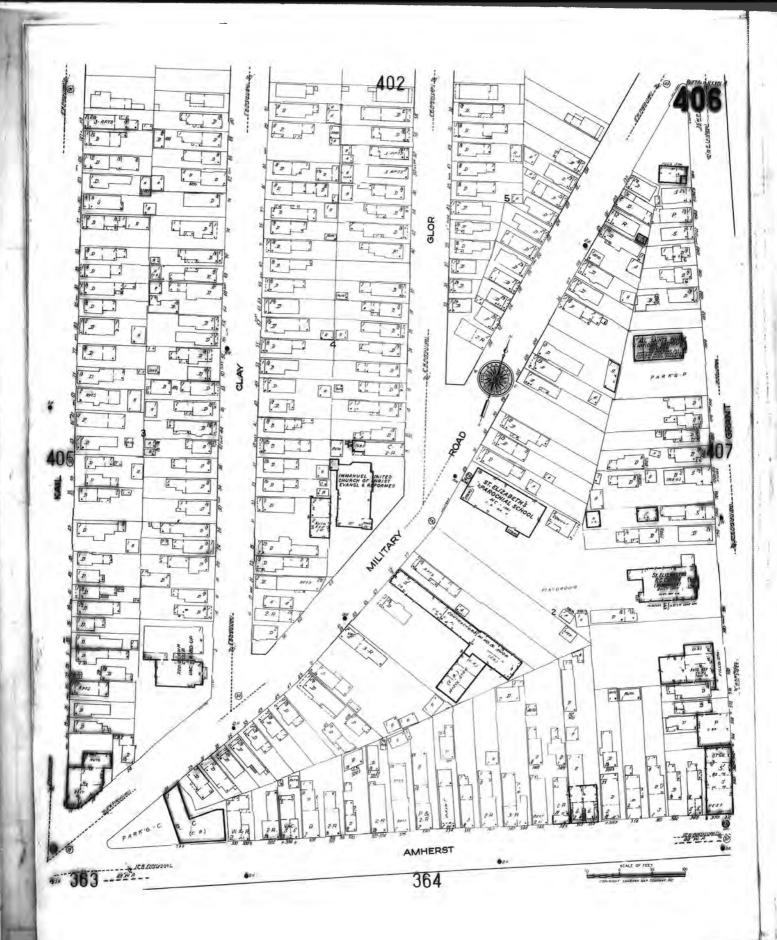

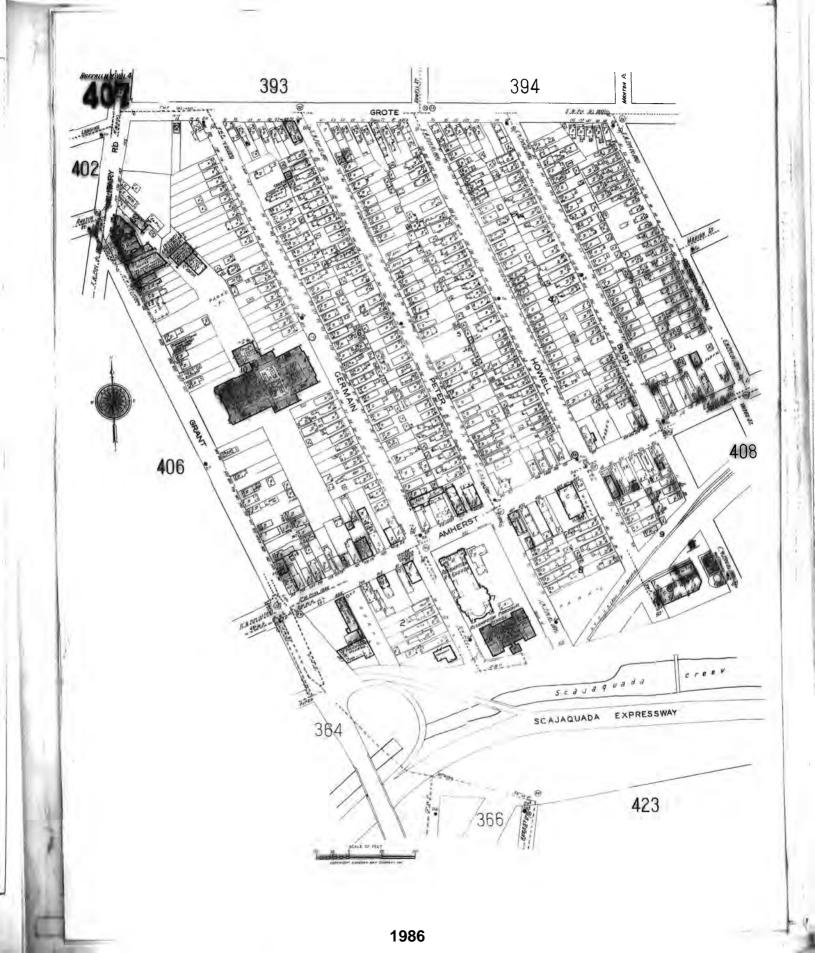

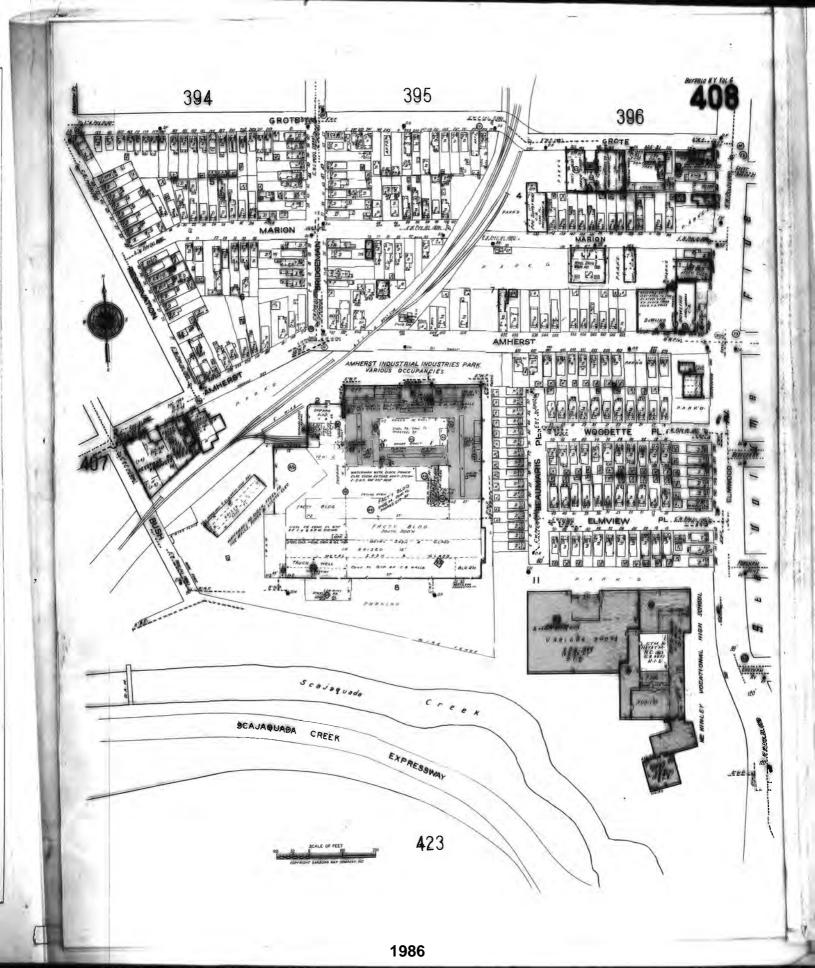


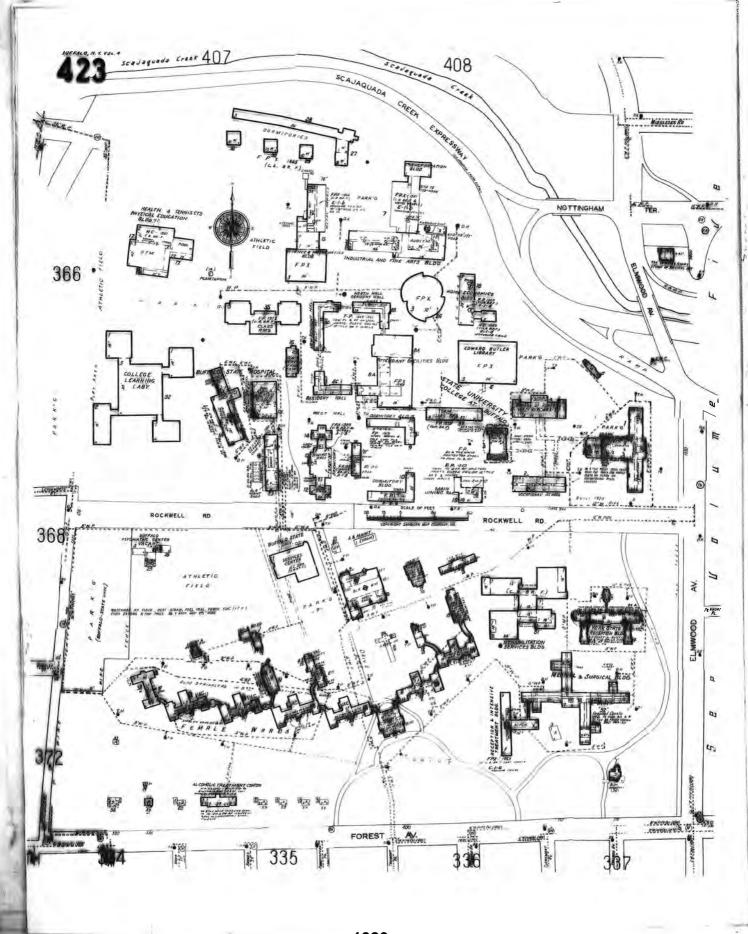

BUFFALO, IS Y.


NOTE
INDEX SERVICE FOR THIS
VOLUME IS MAINTAINED
IN THE LOOSE-LEAF GENERAL
INDEX BOOK


REVISED JUNE 1986

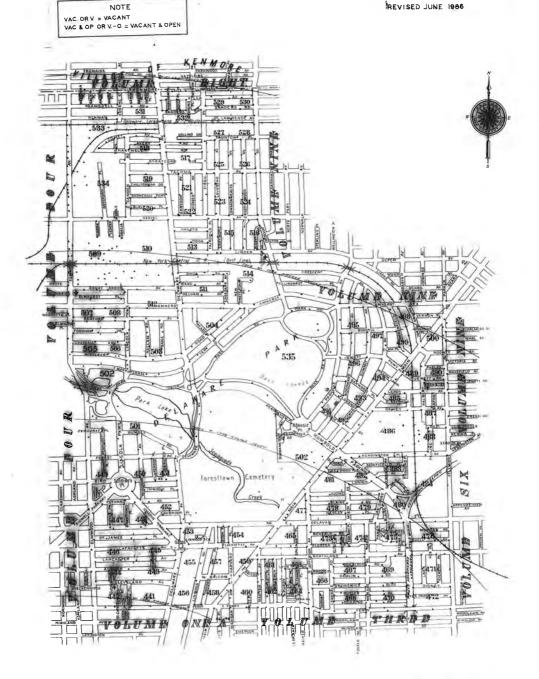



SEQUENCE OF NUMBERS


TITLE- / INDEX- 0 KEY- /

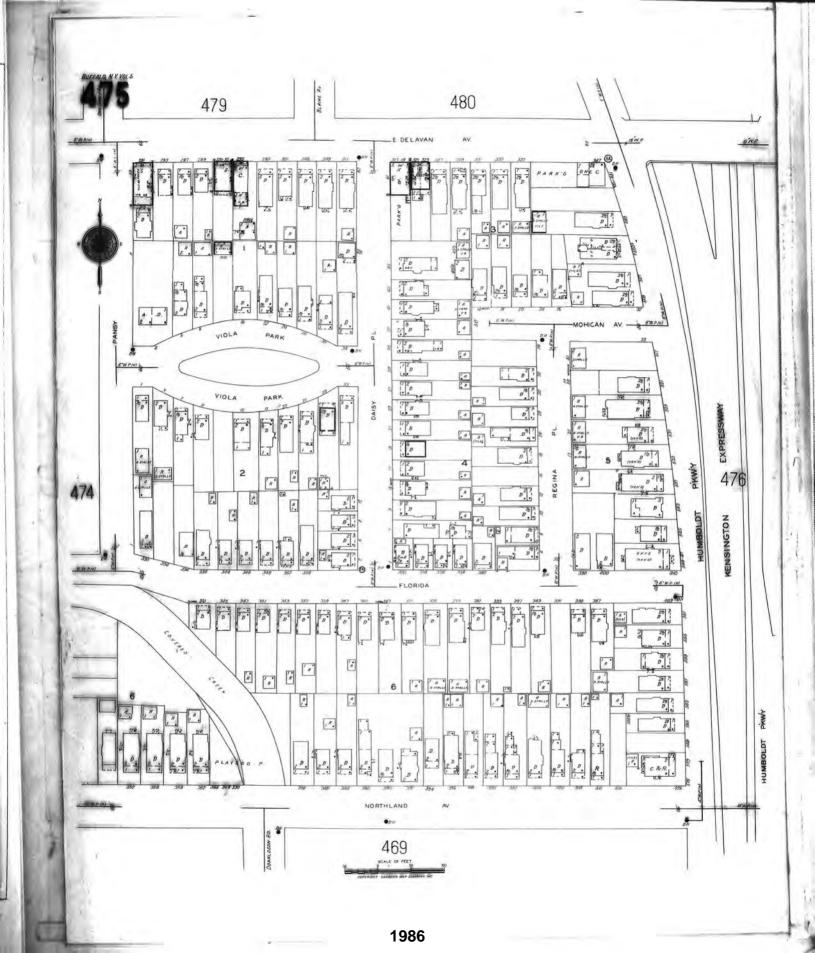


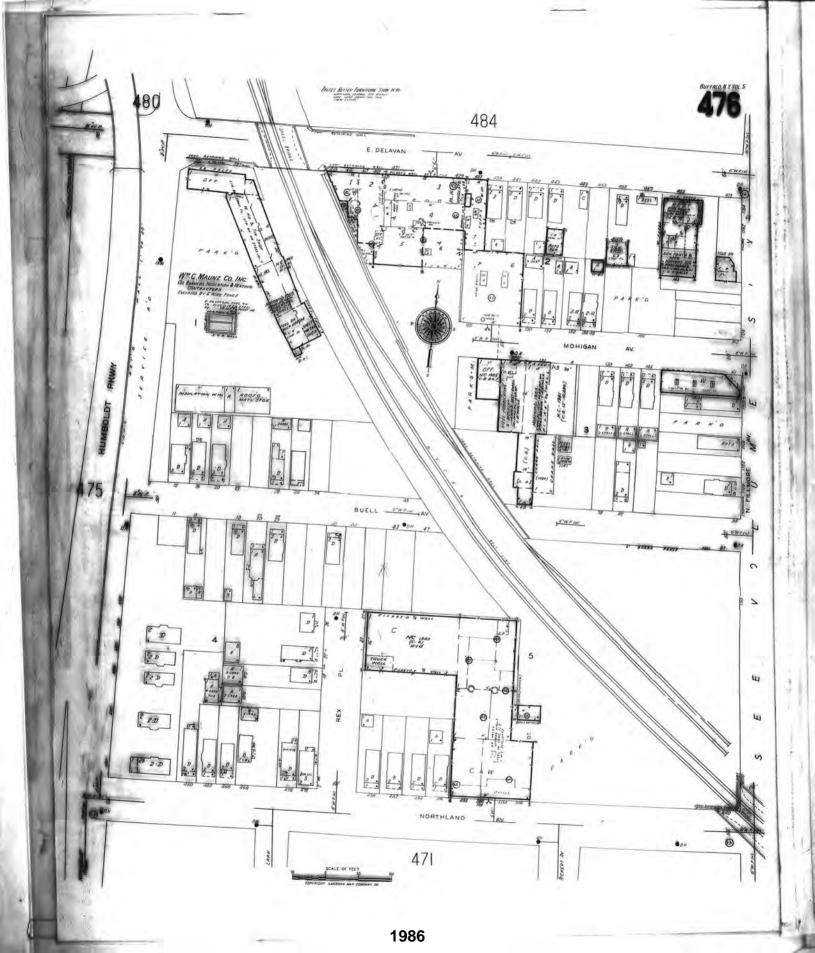


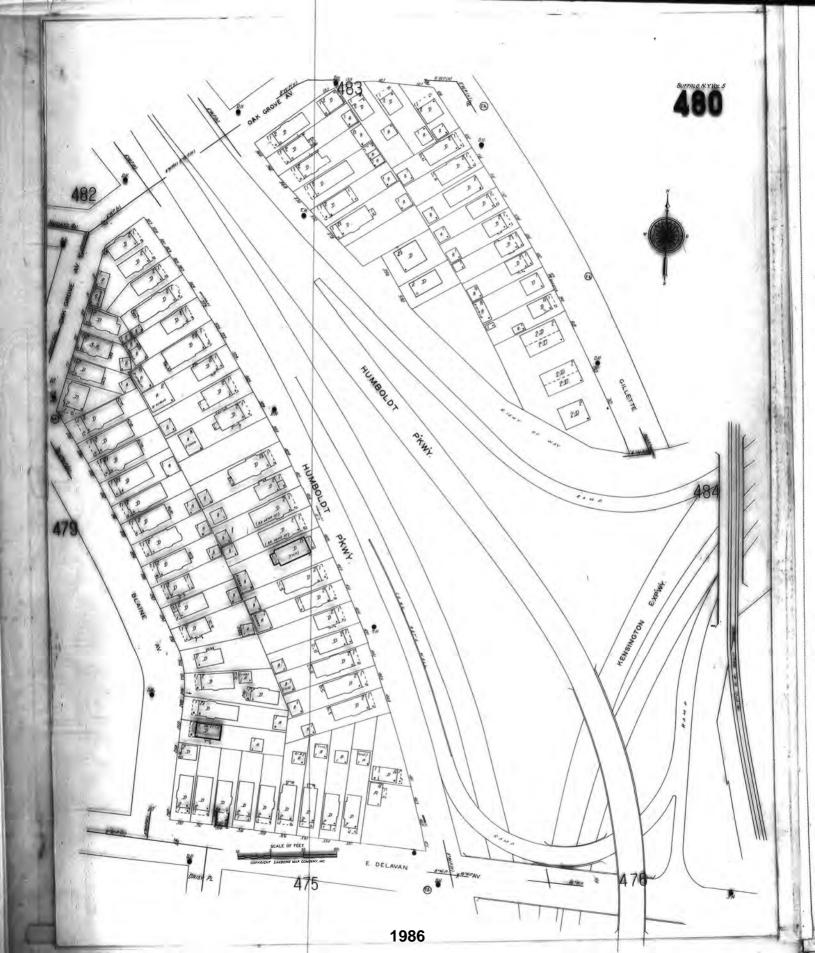


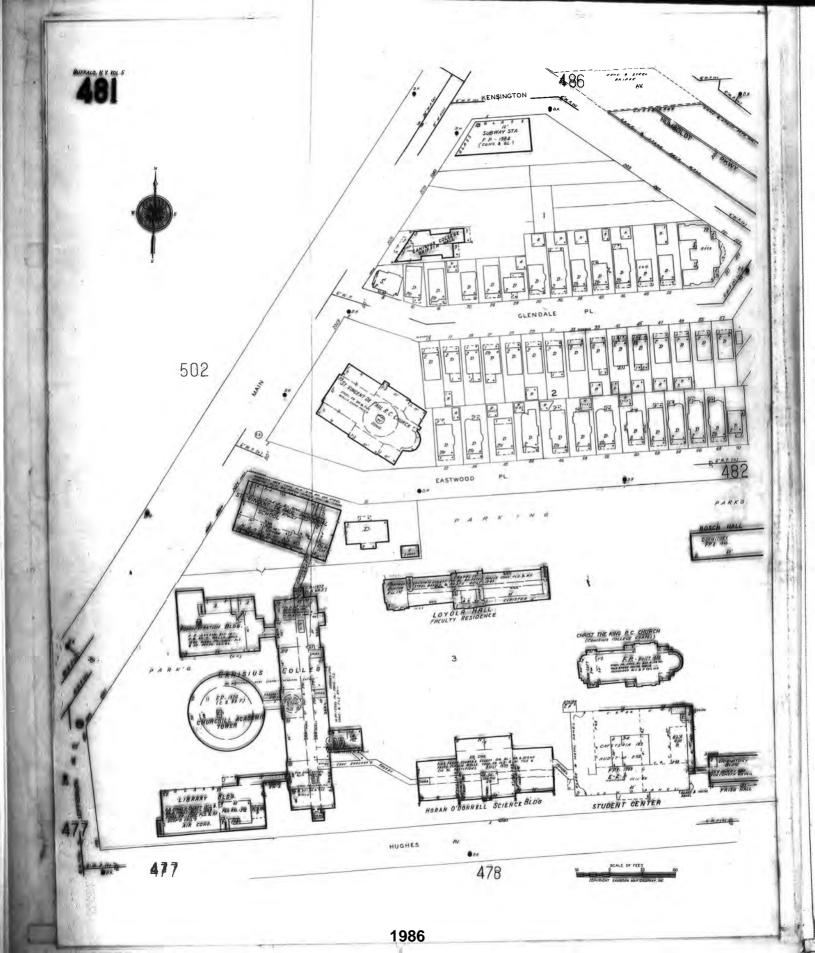


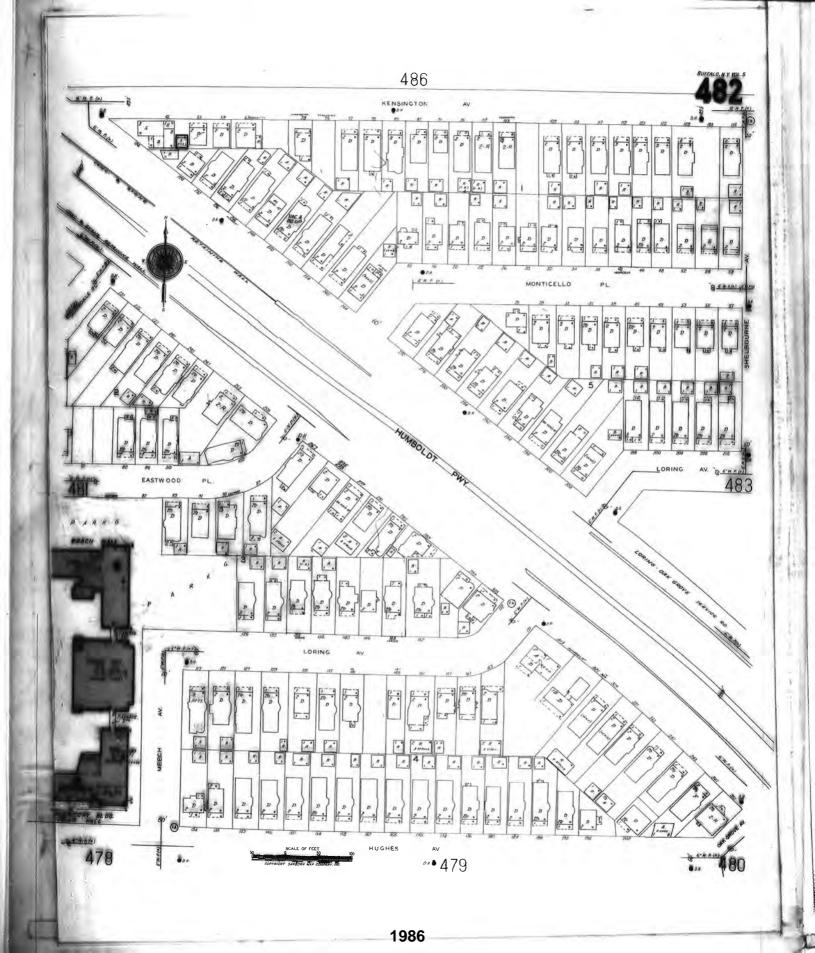


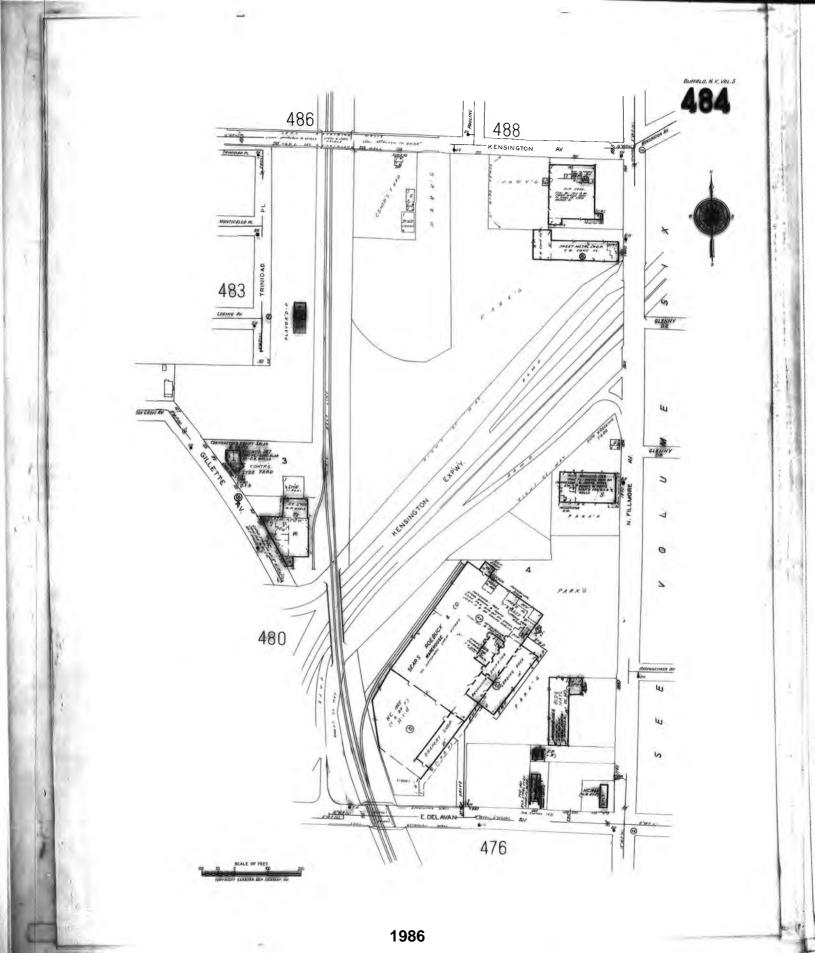


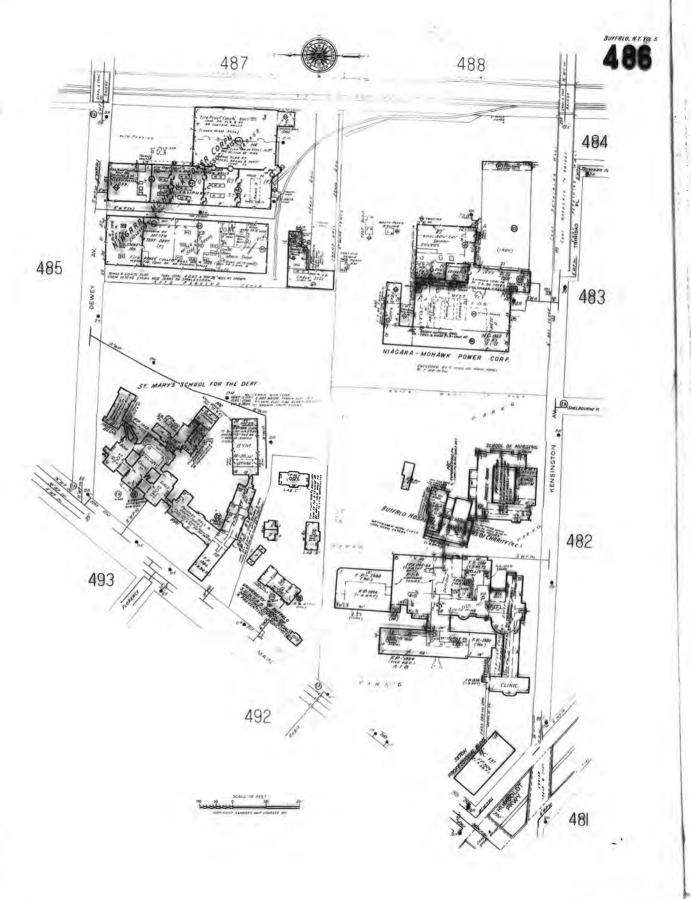


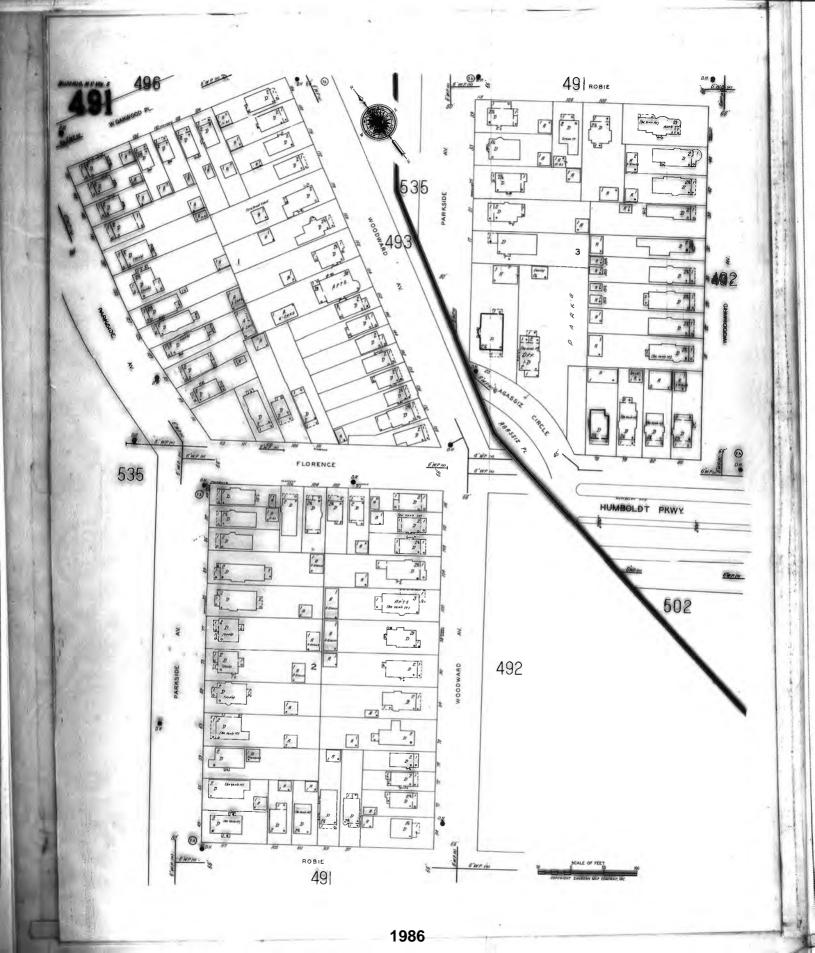

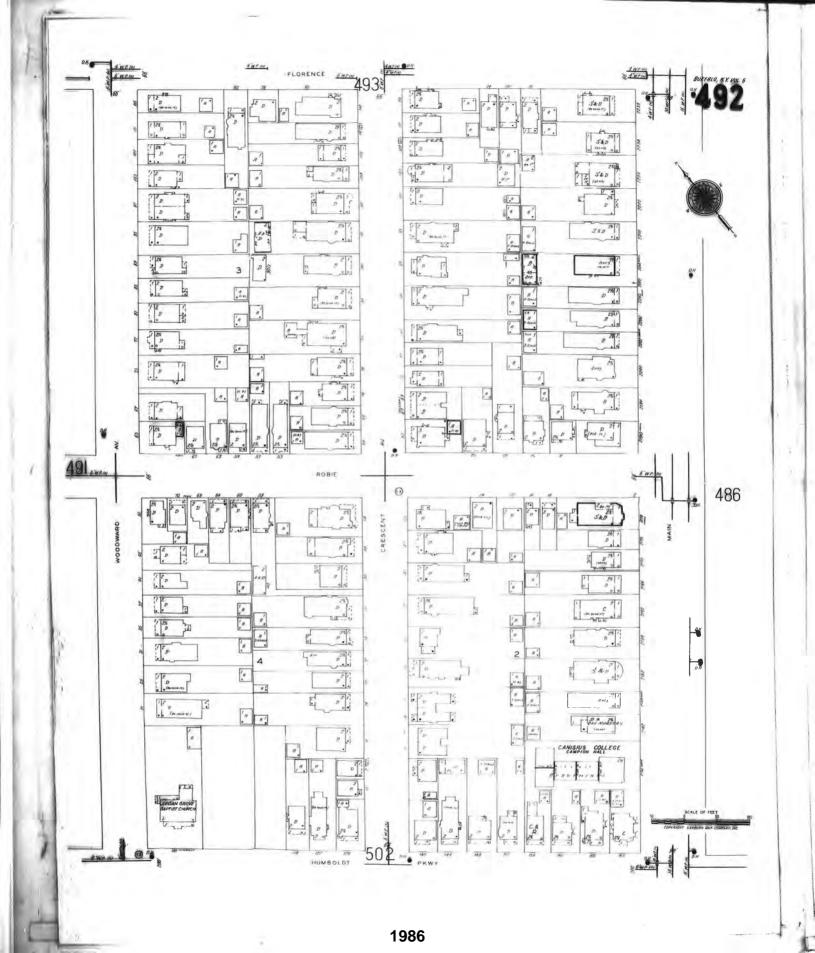


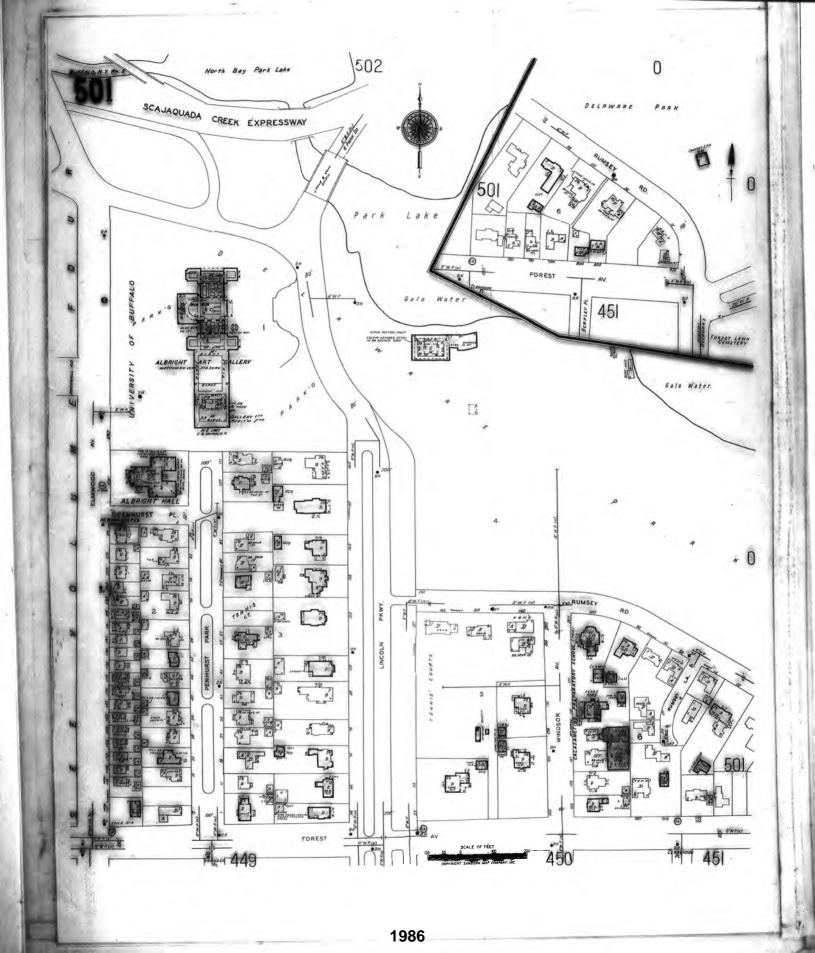


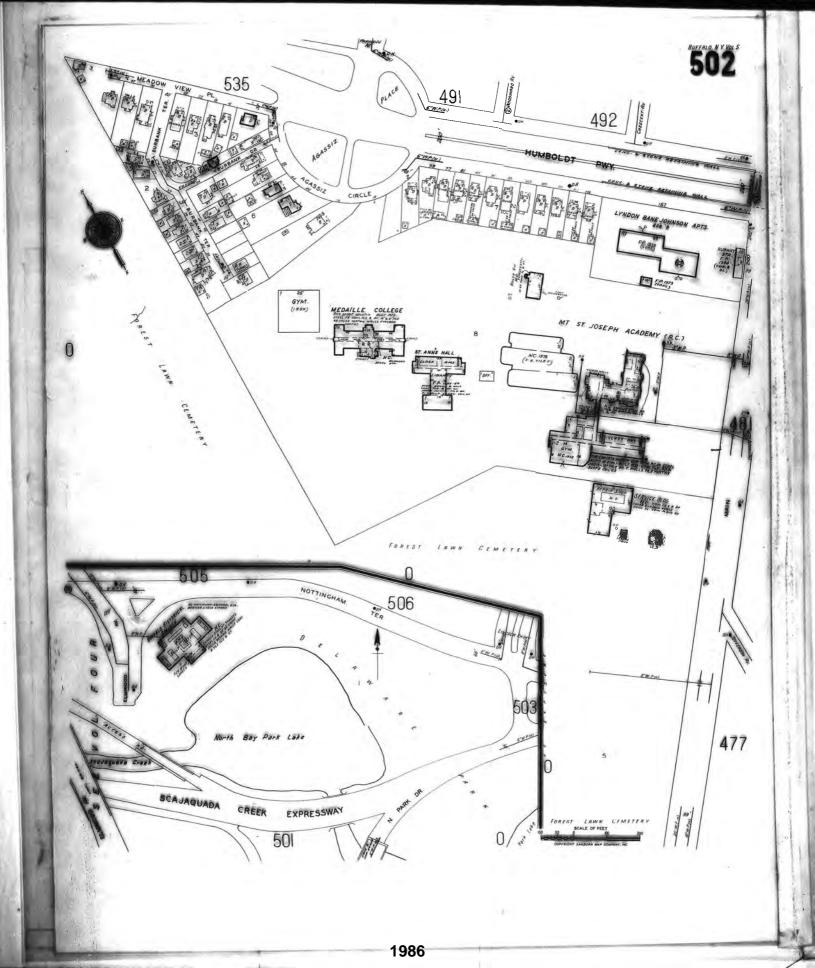


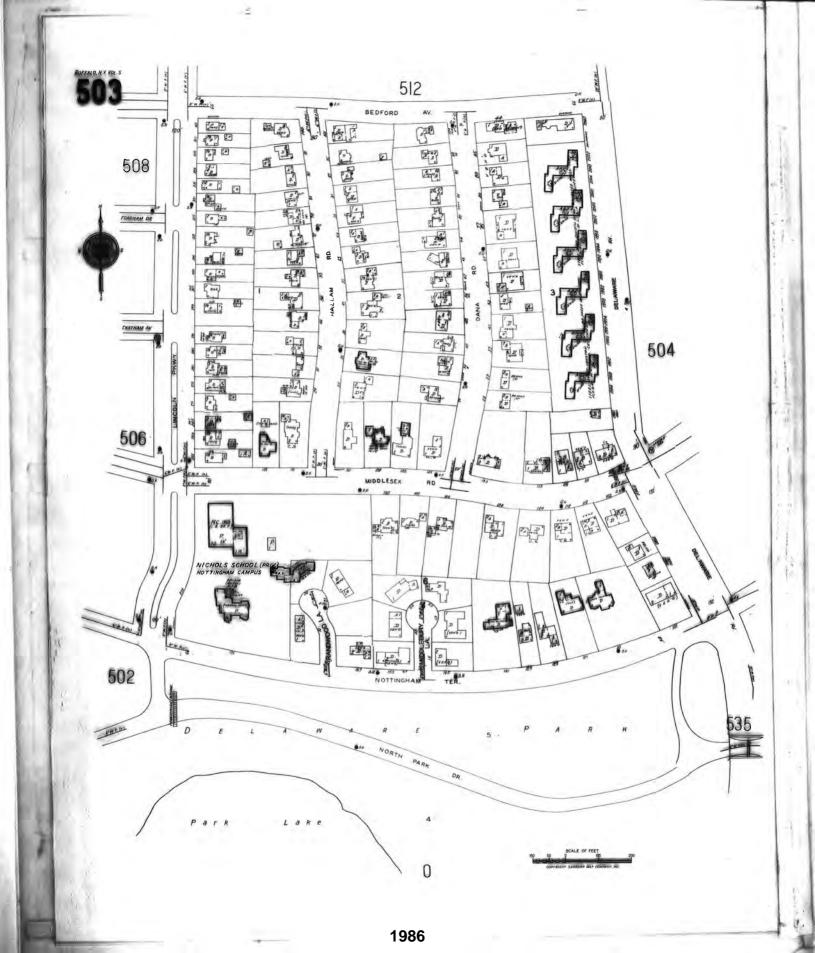





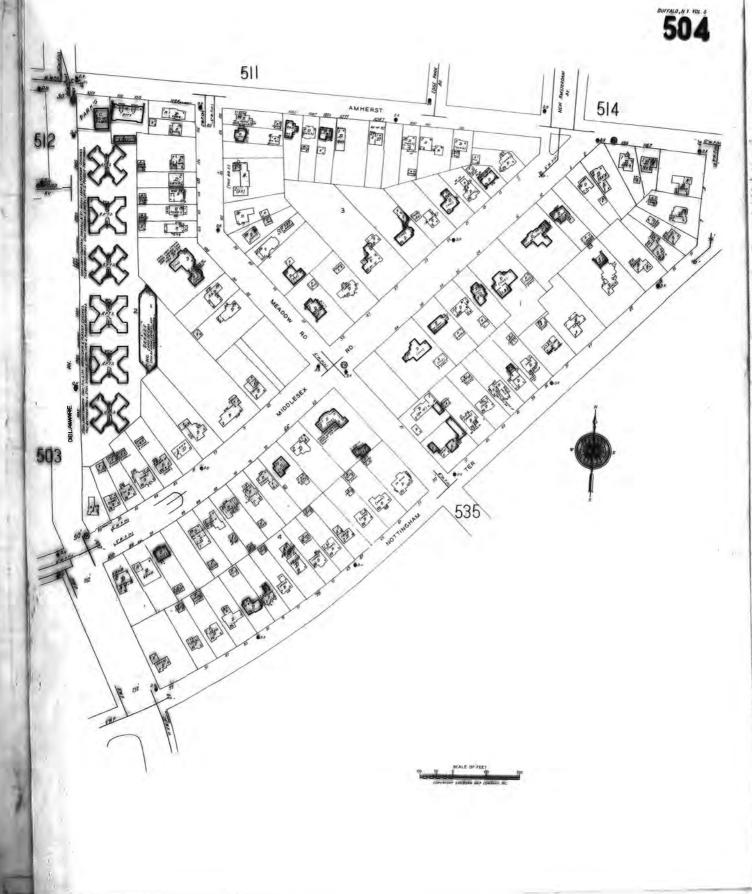


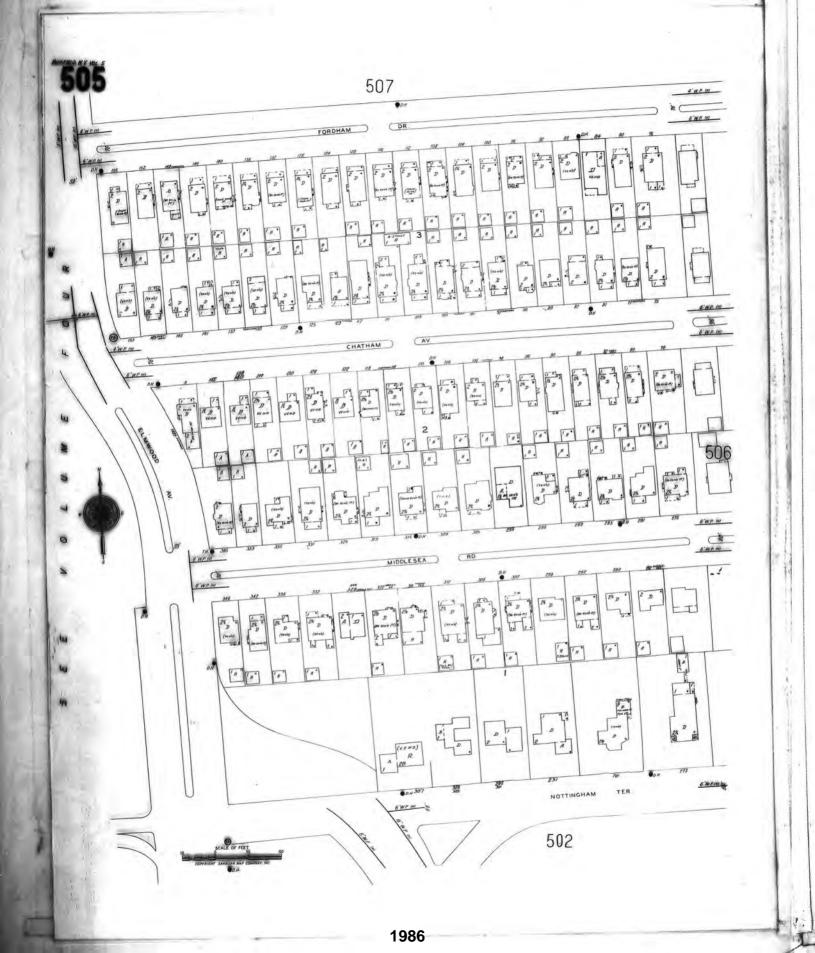


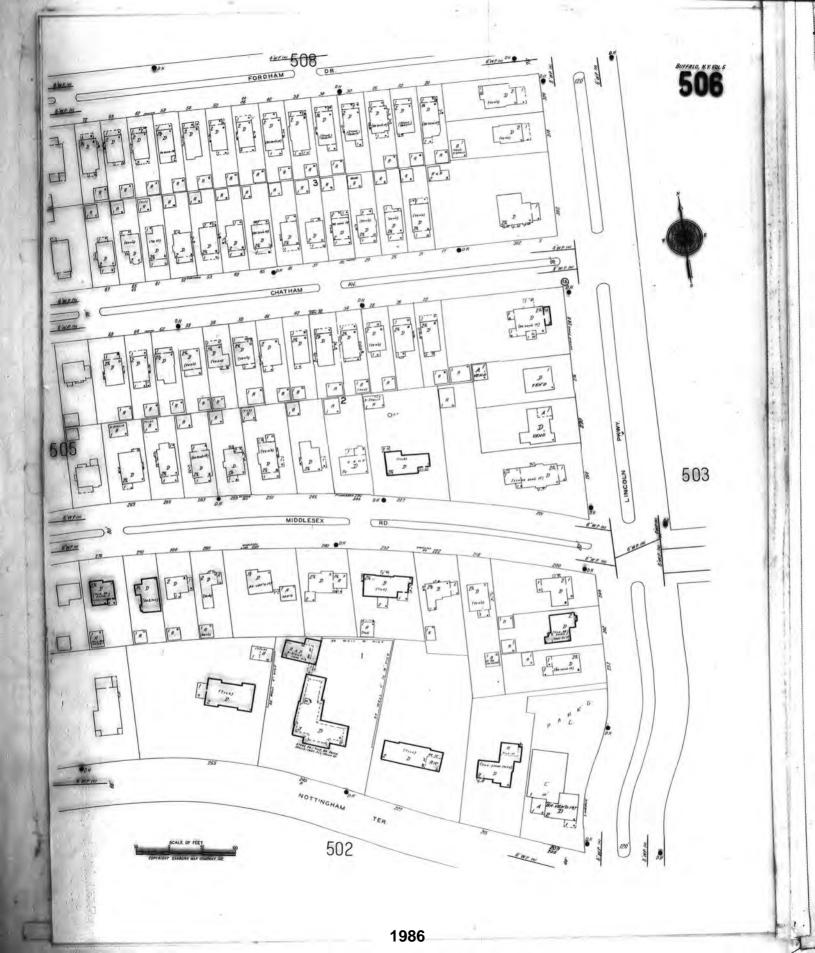


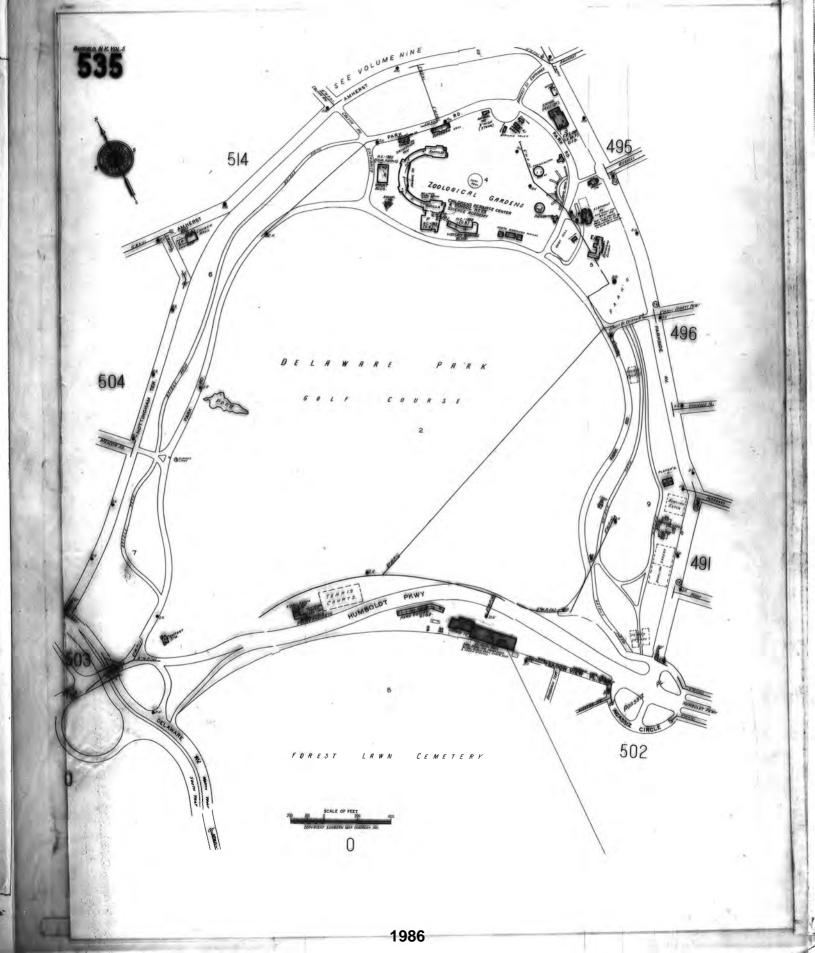


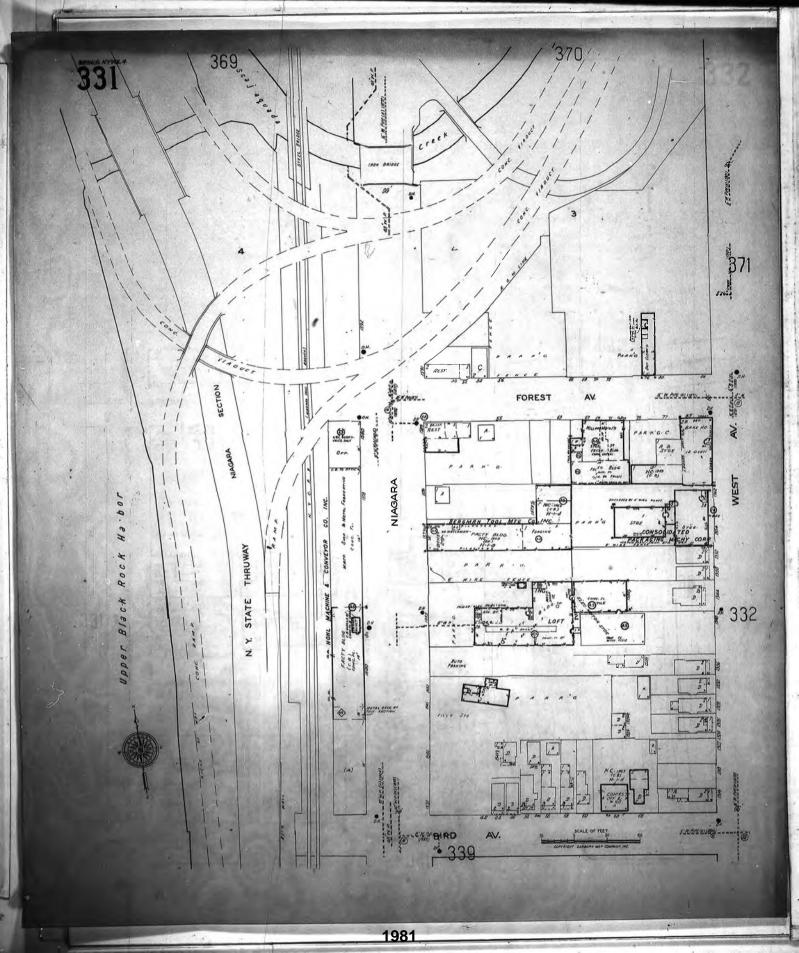


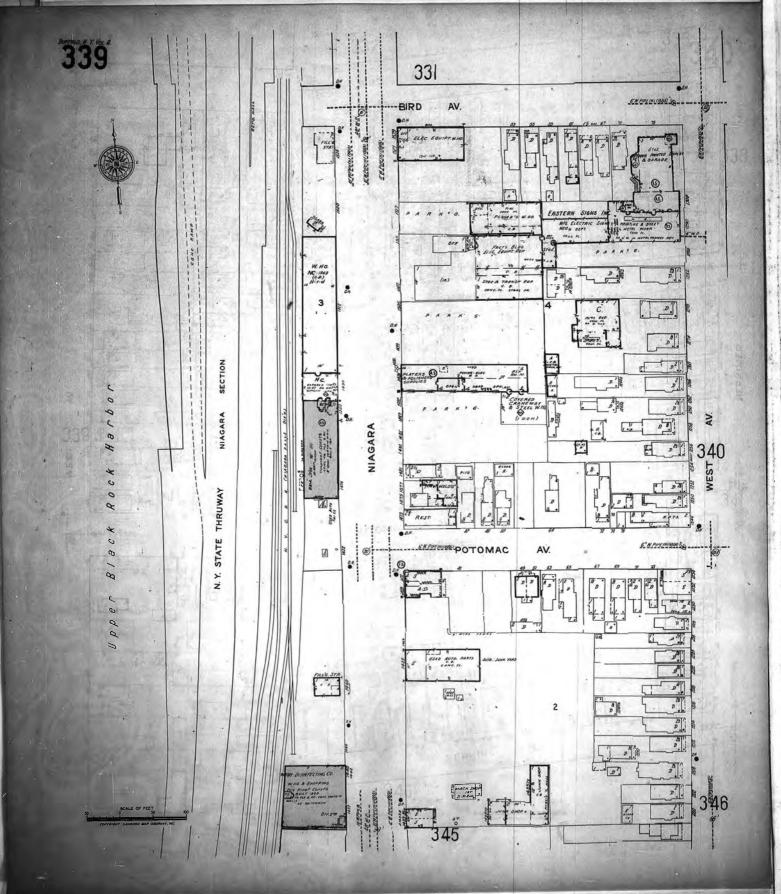


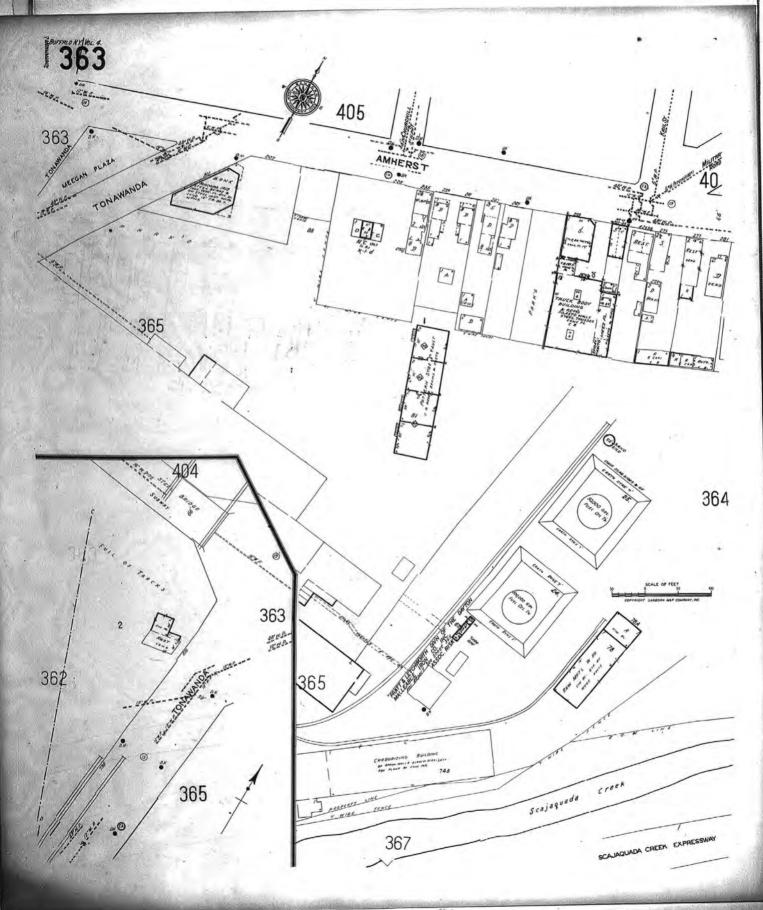


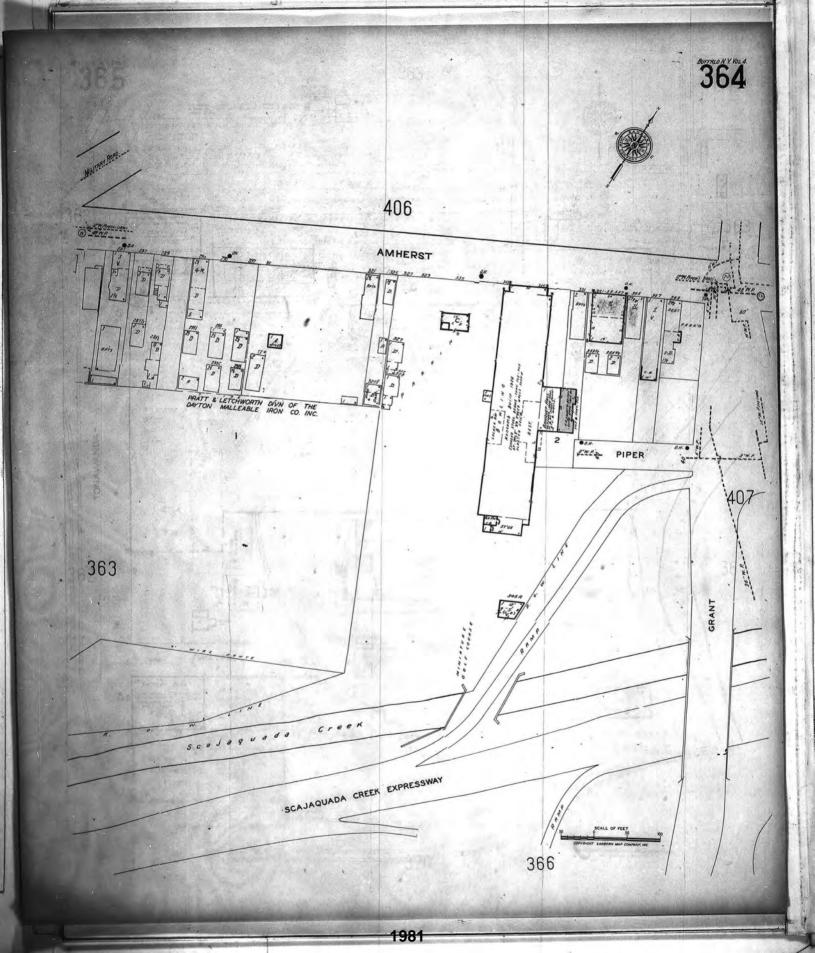


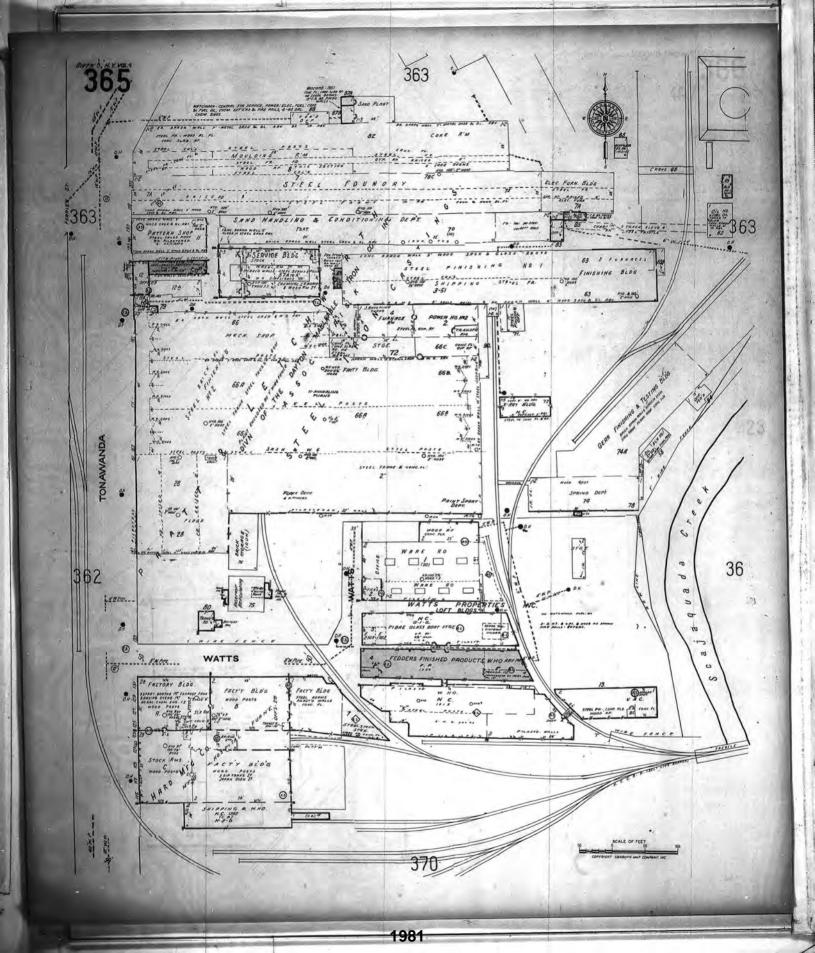


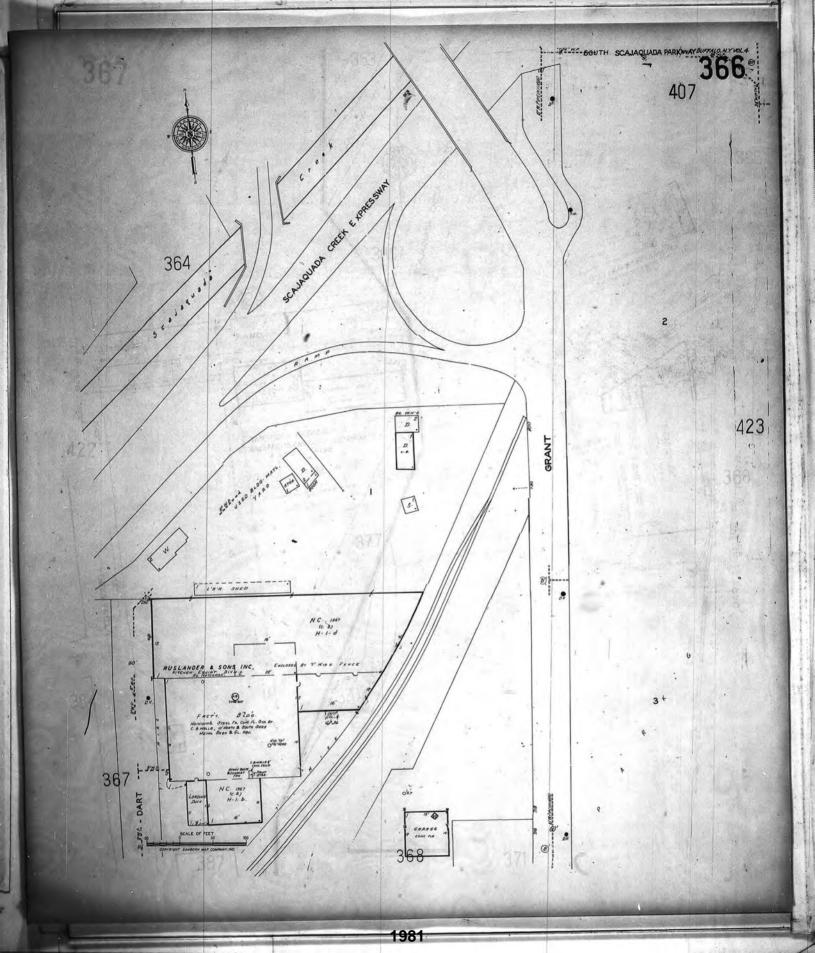


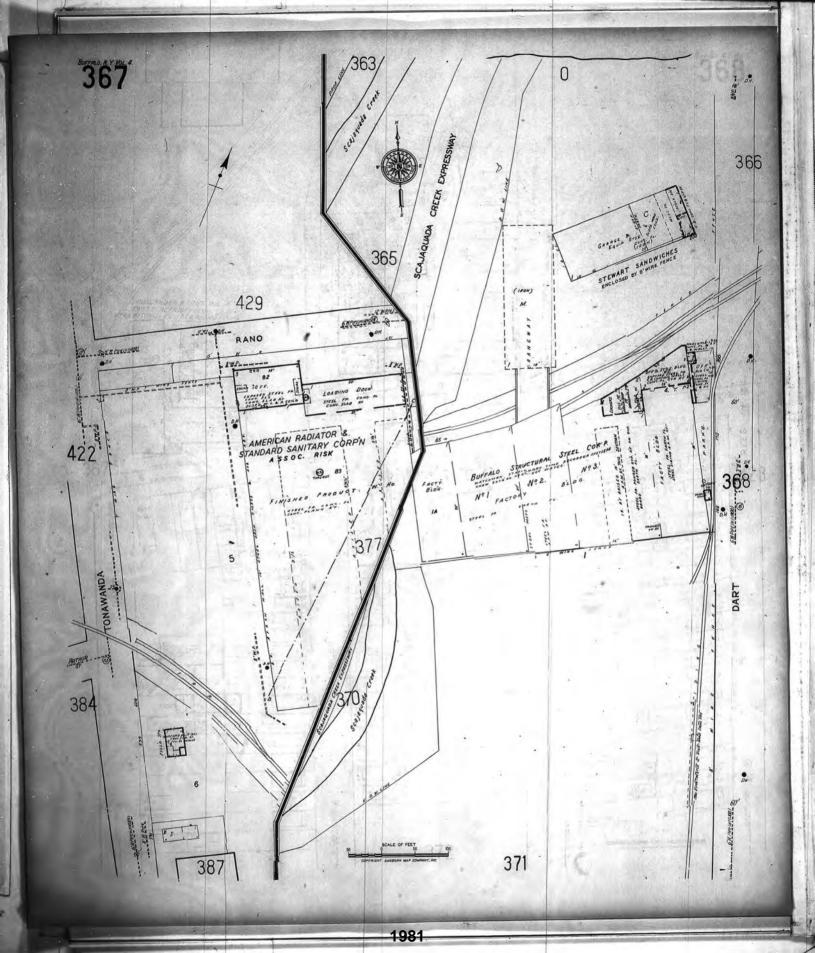


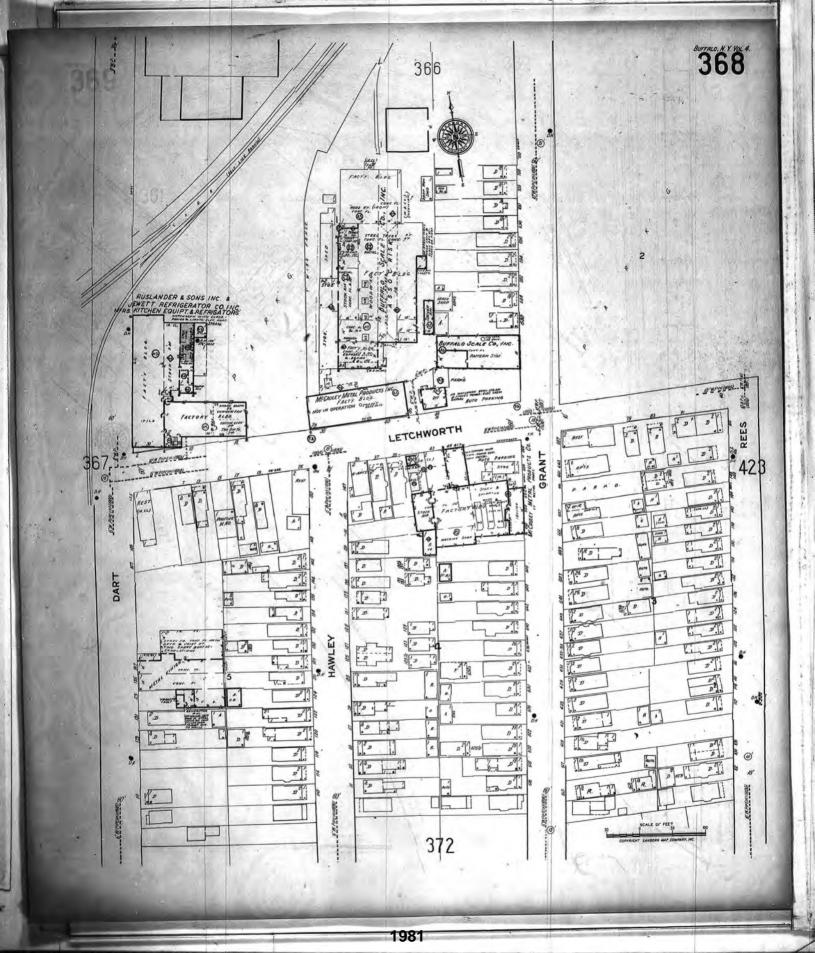

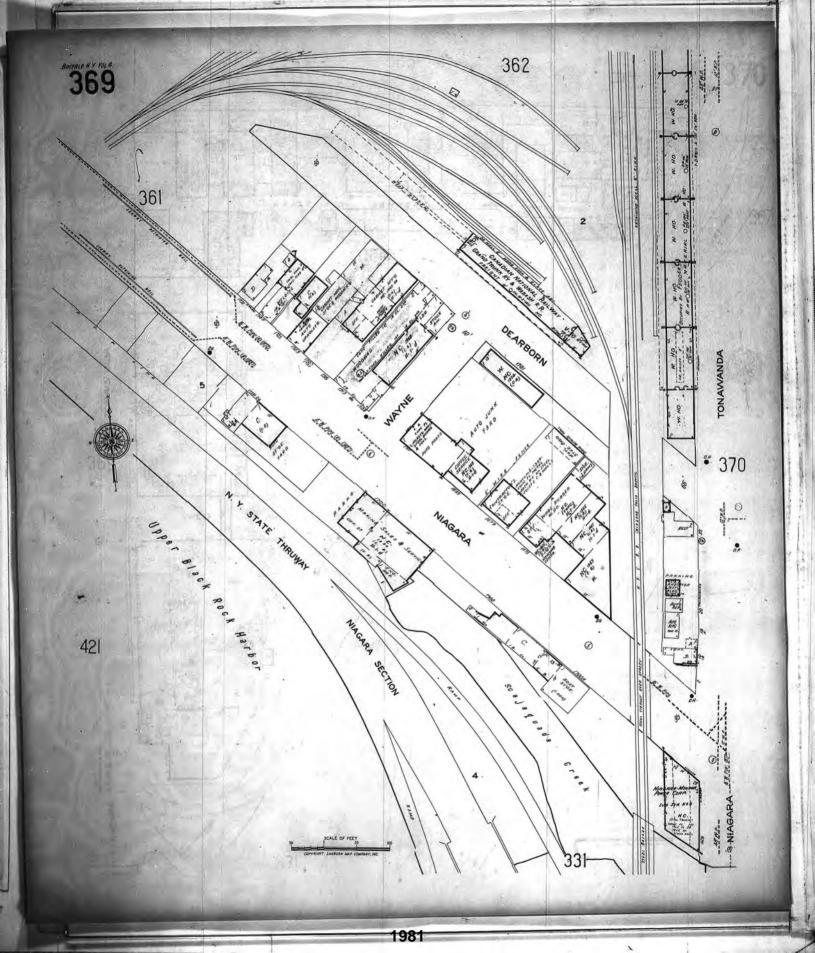


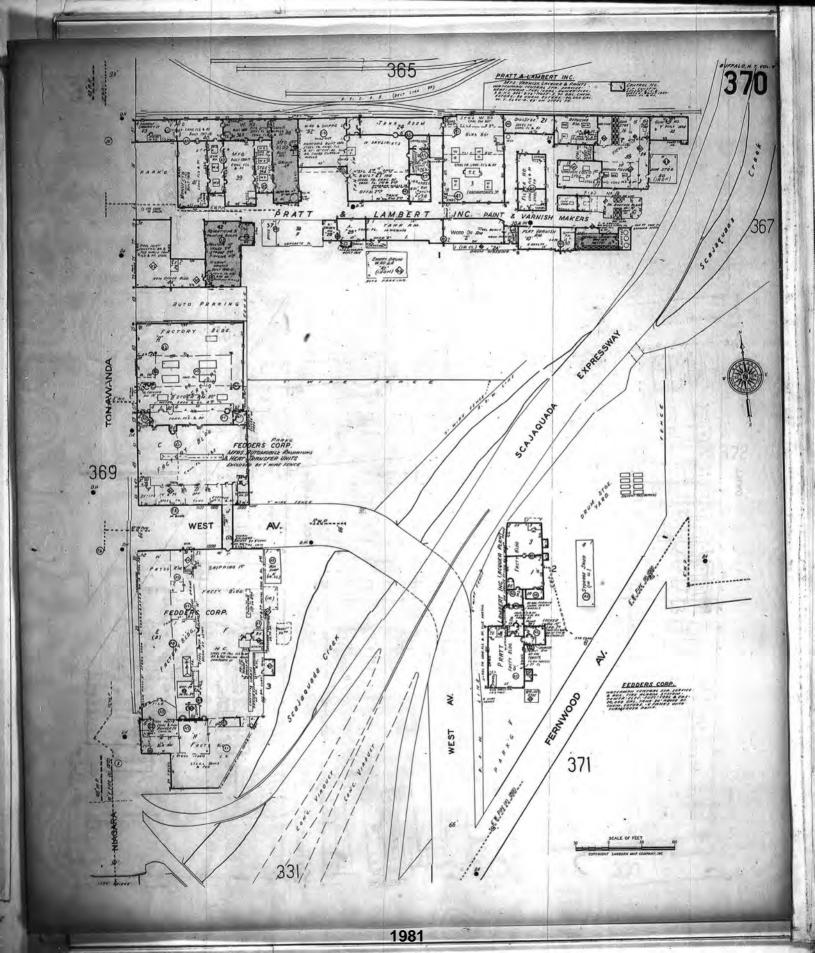


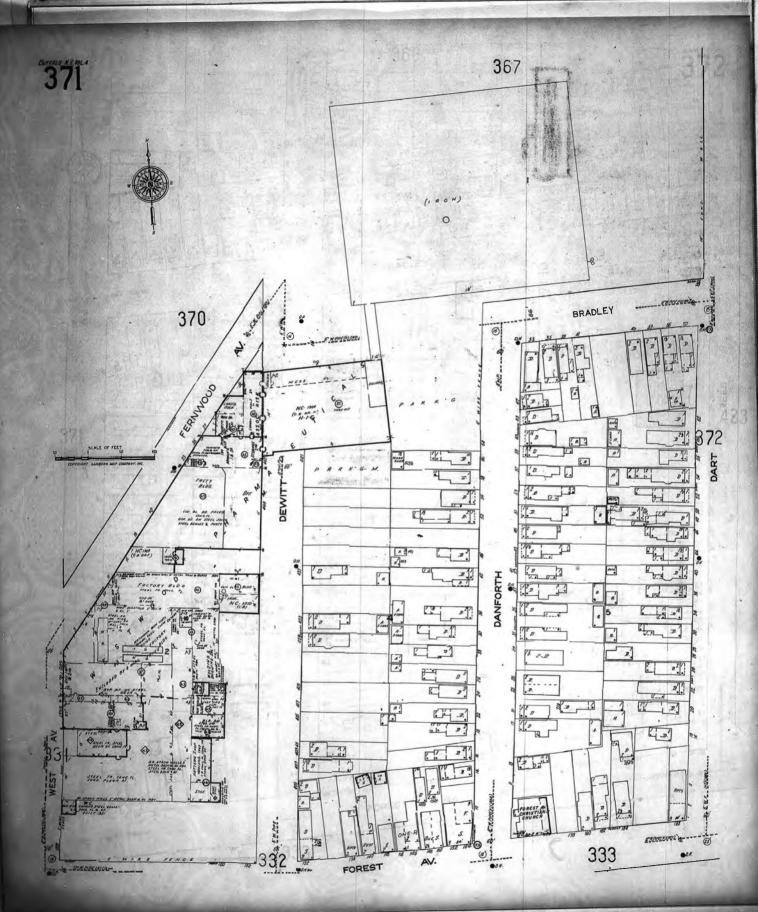


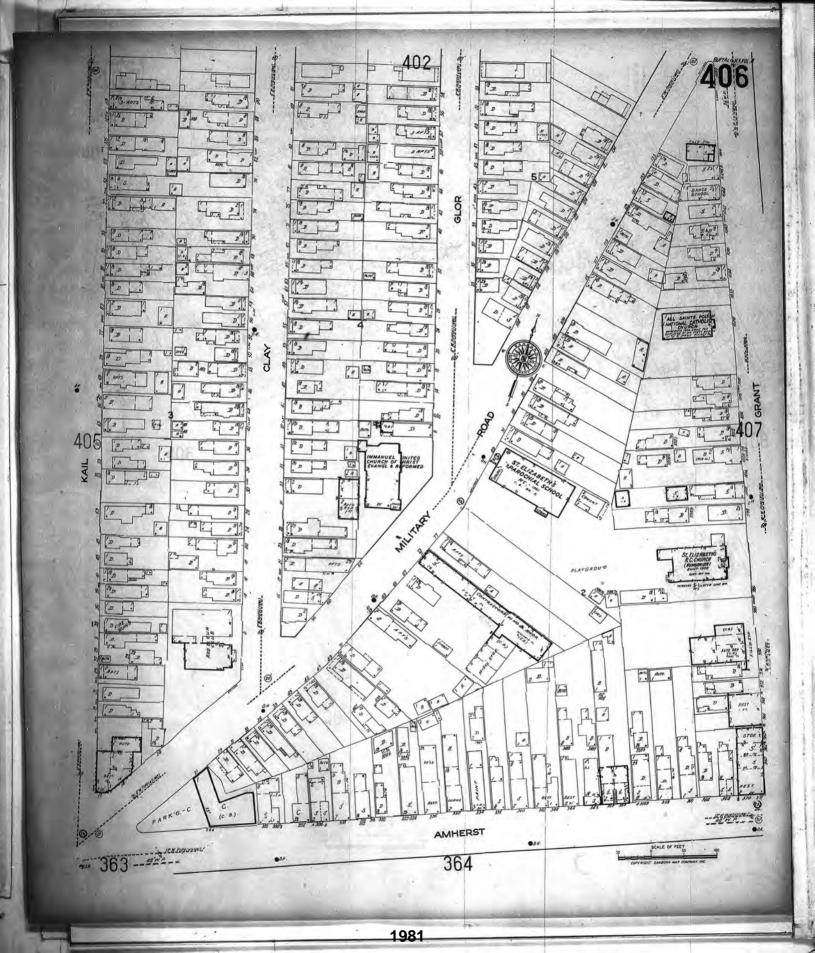





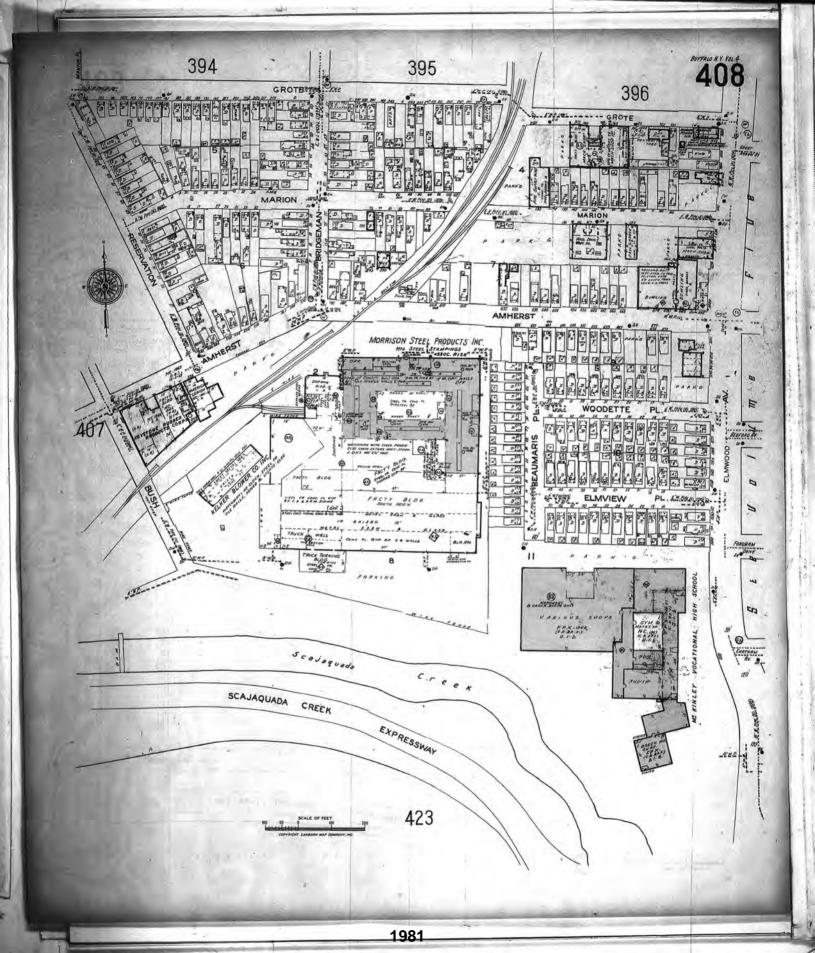


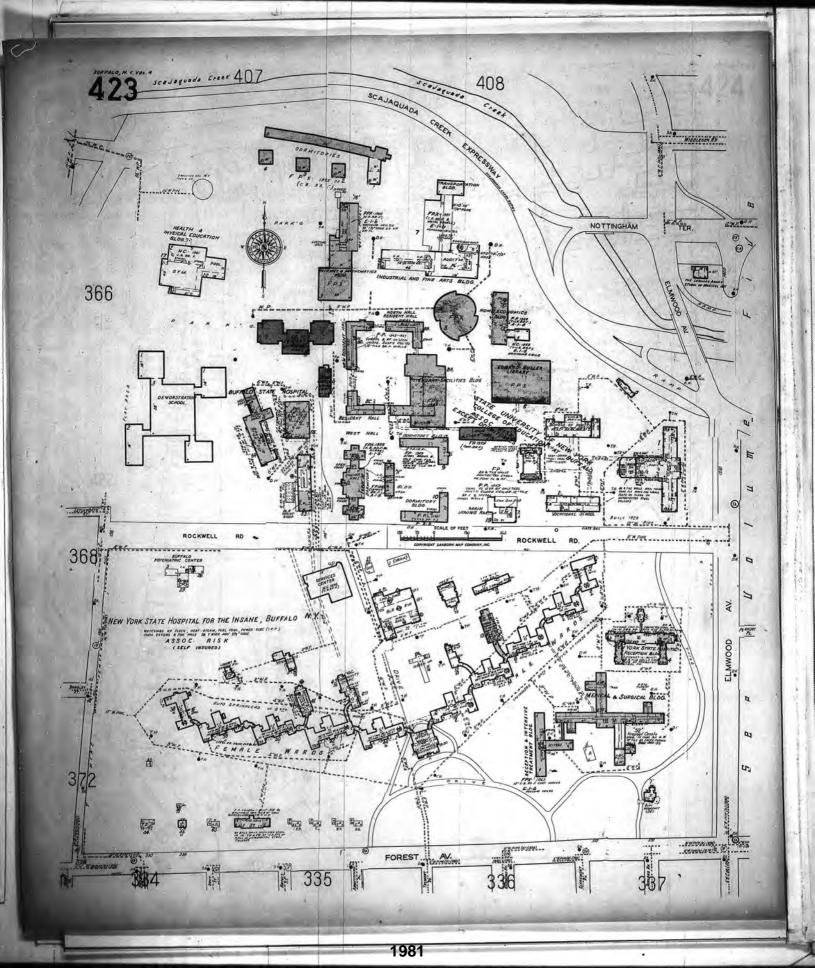


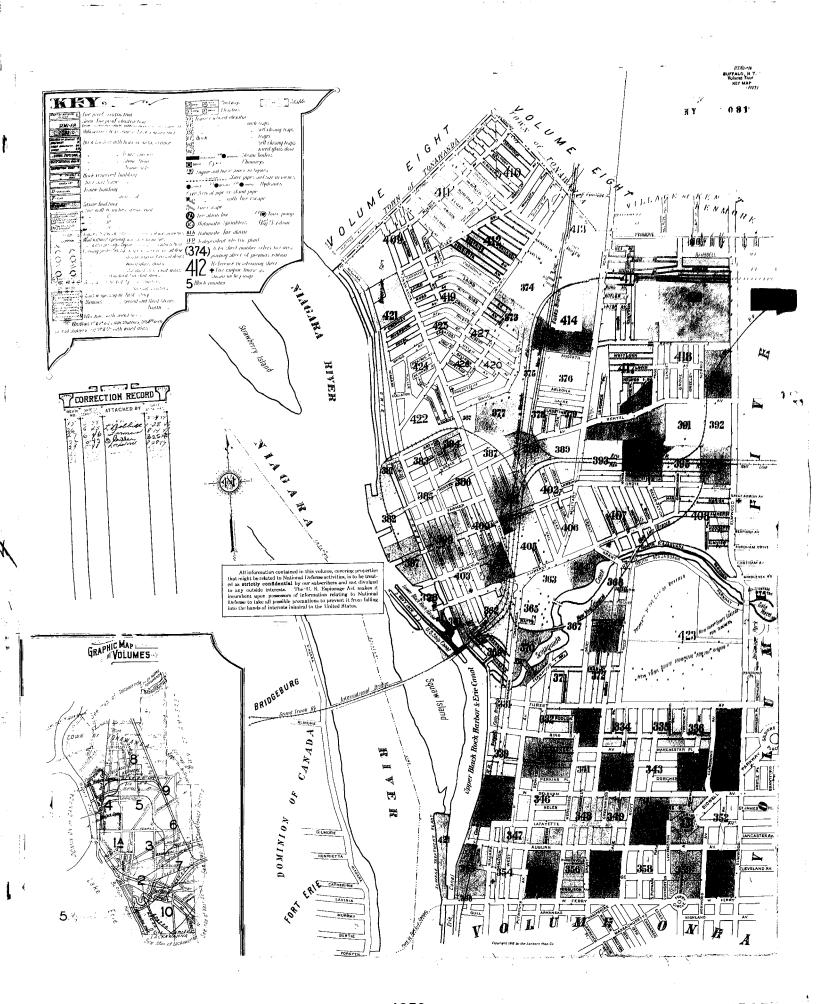


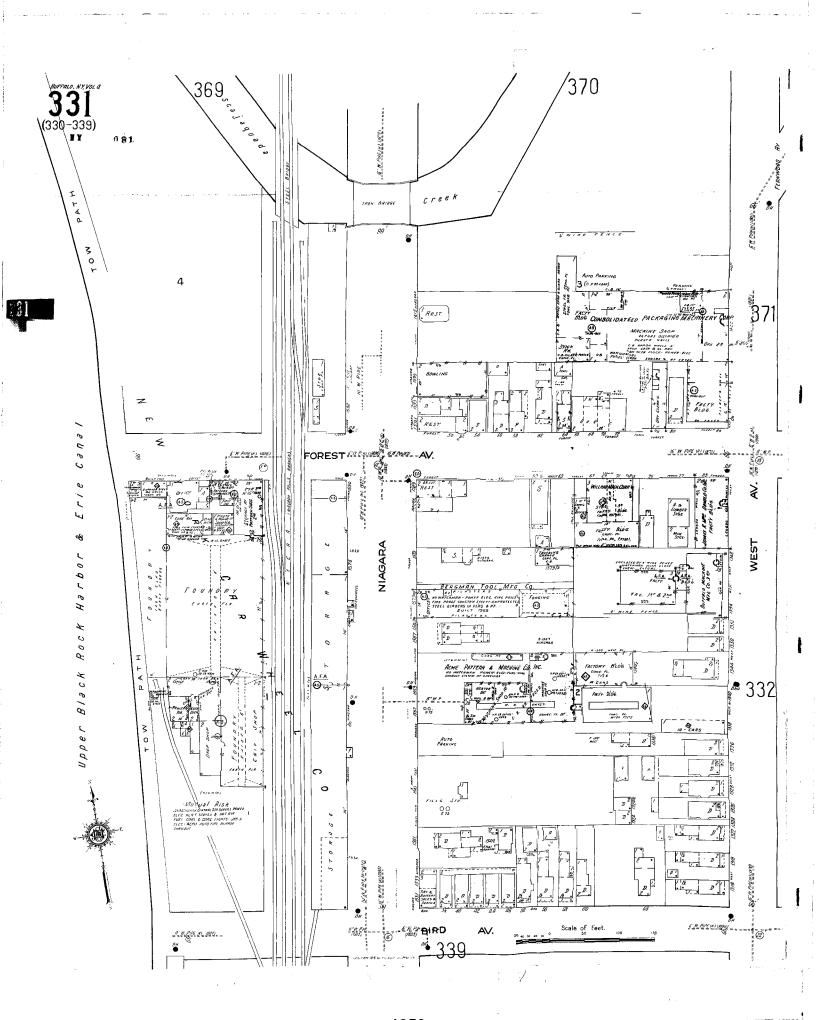


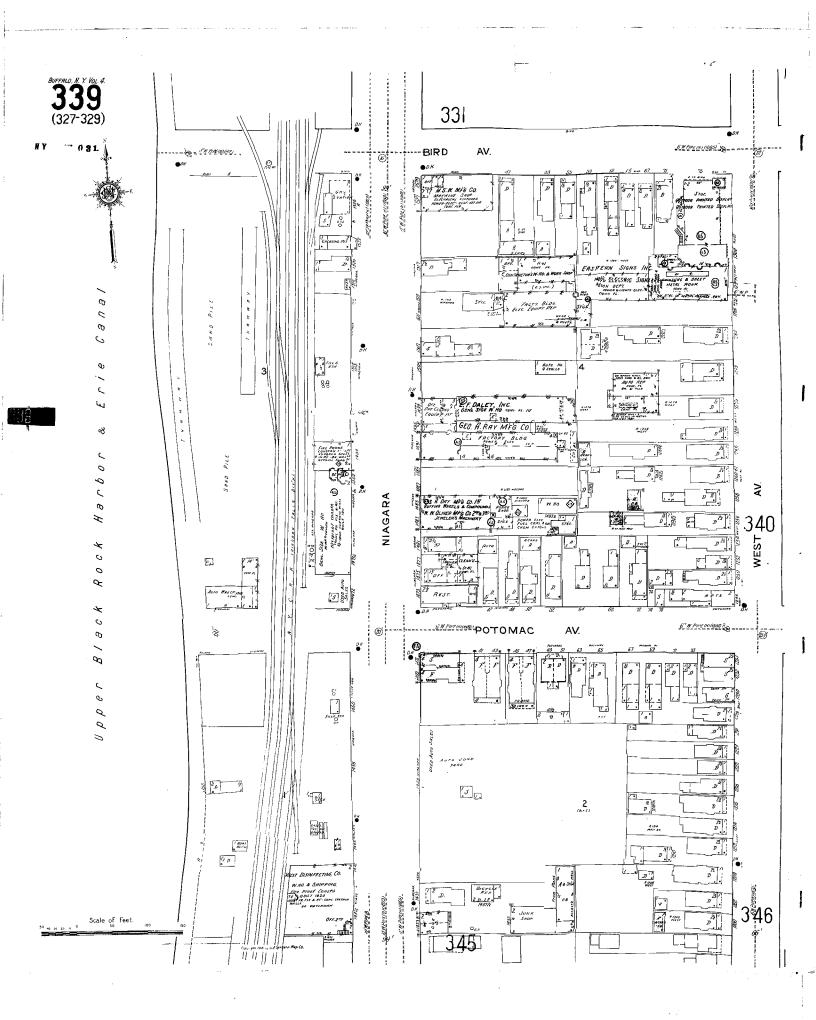


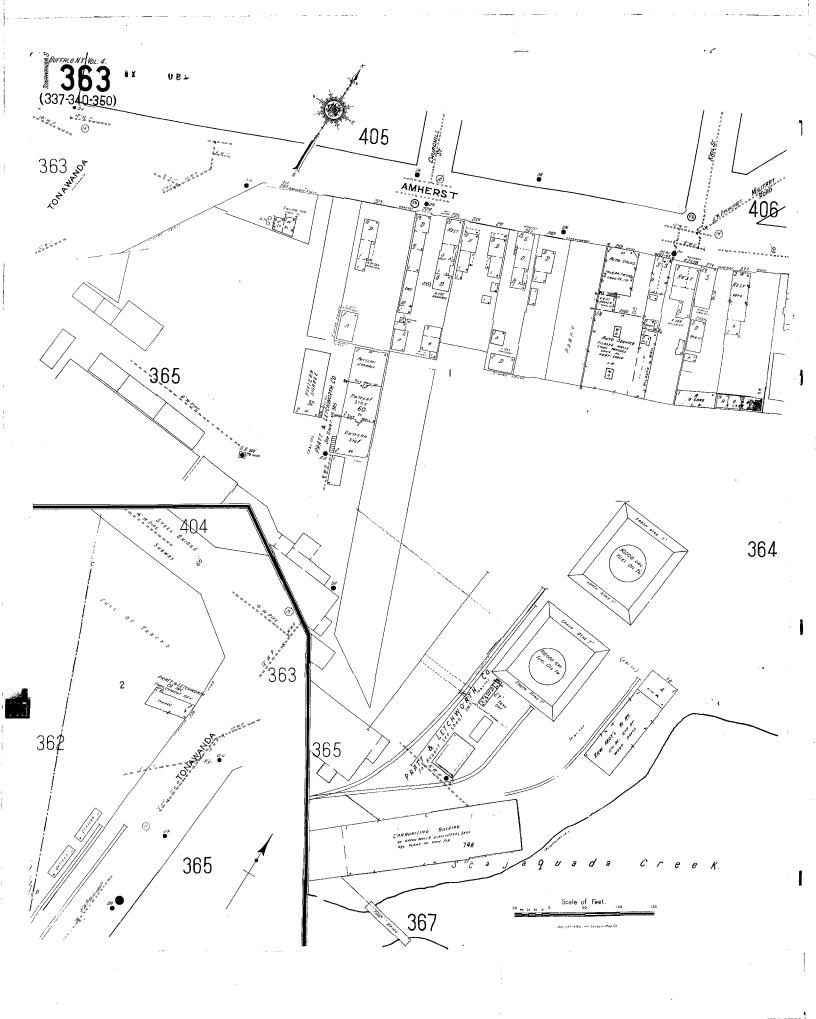


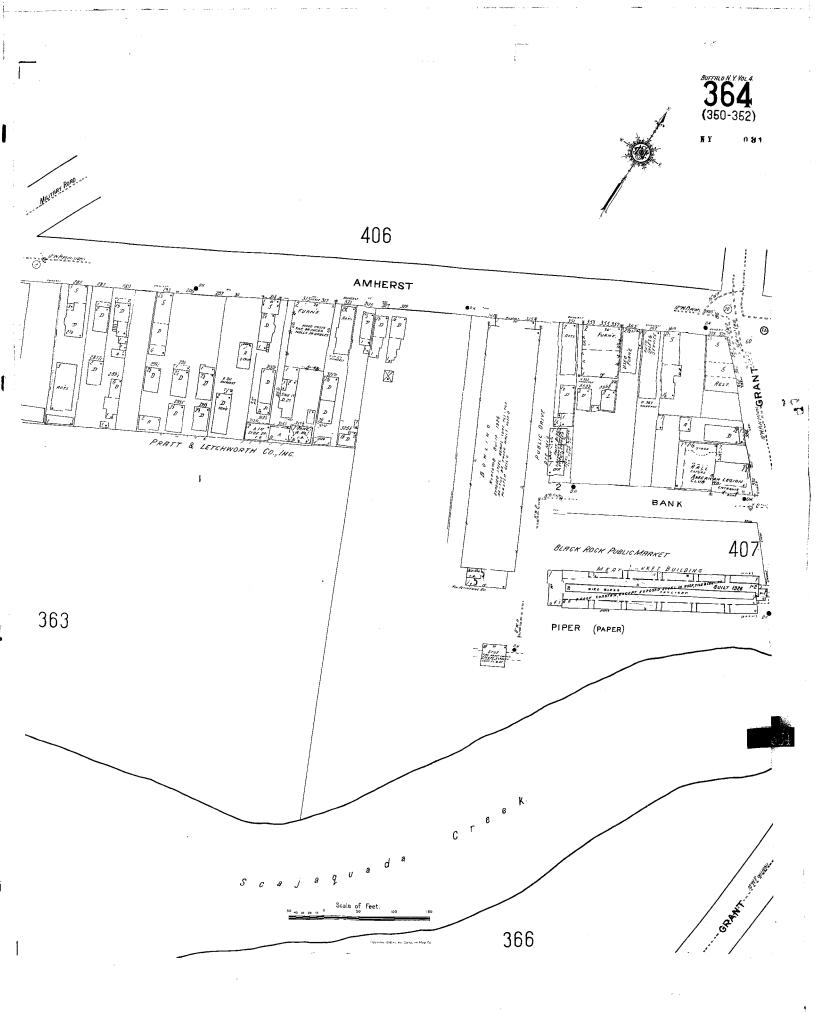


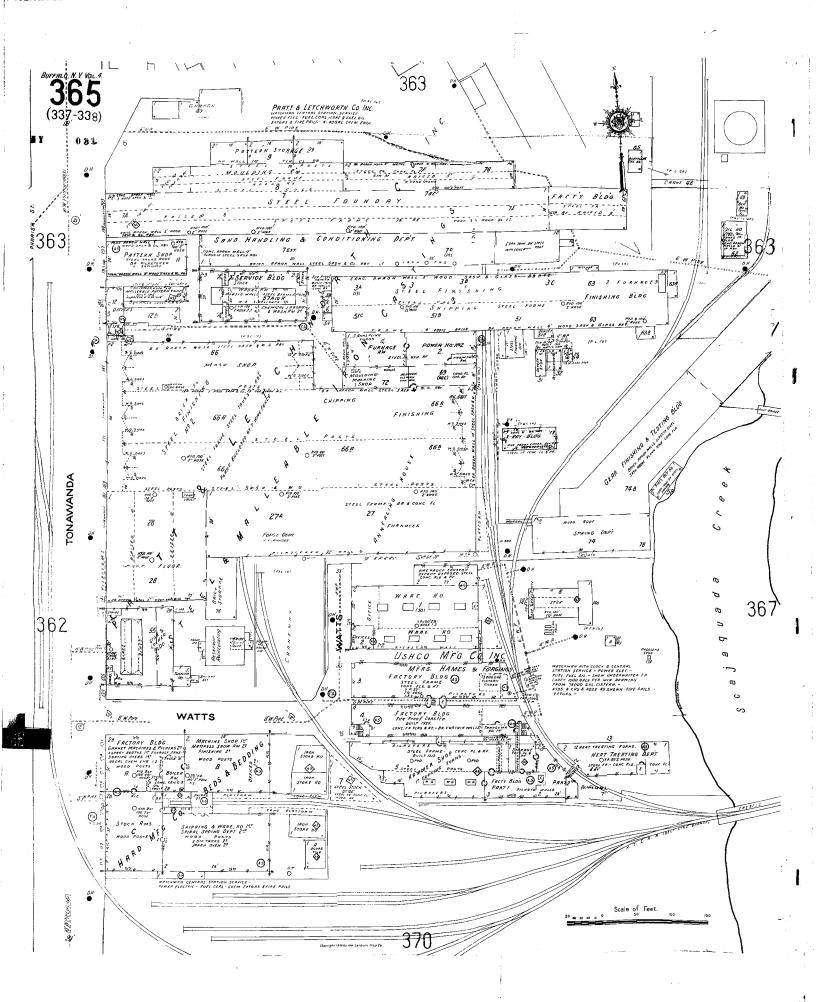


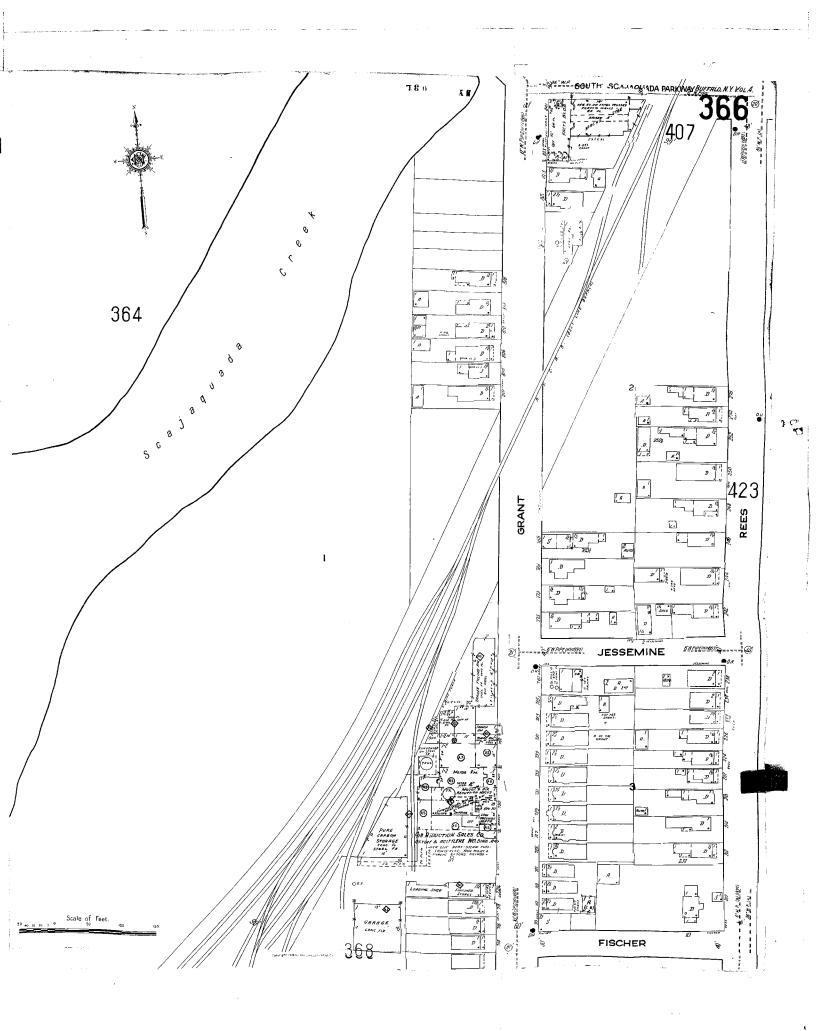


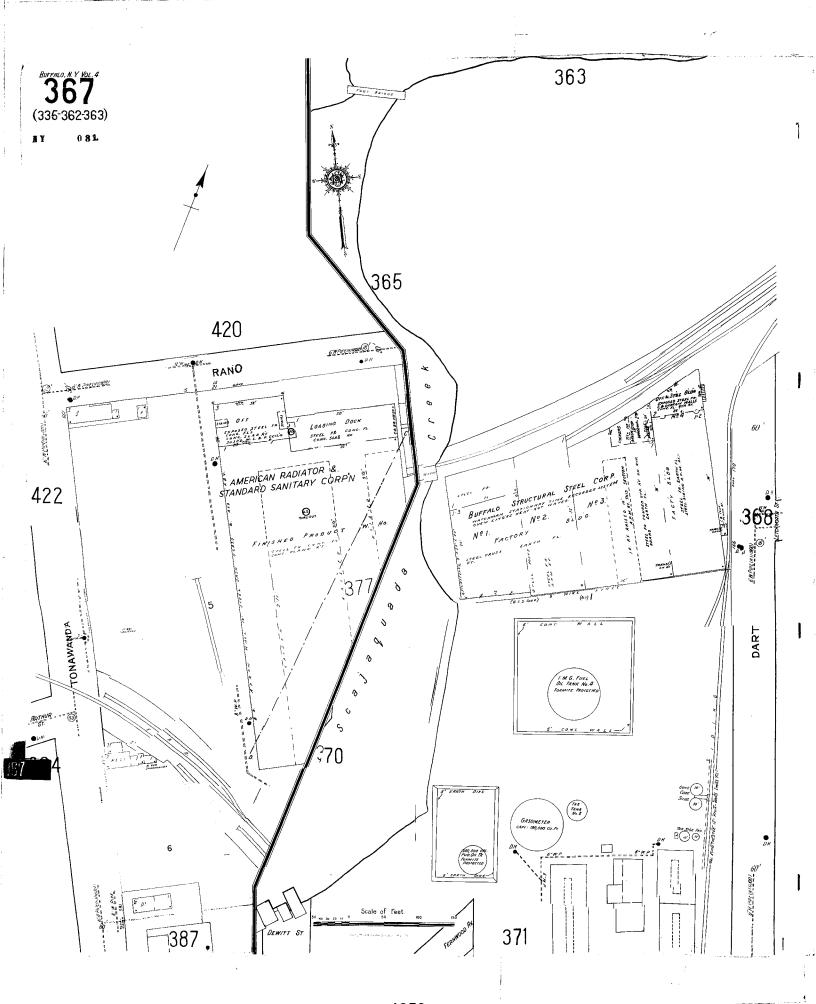


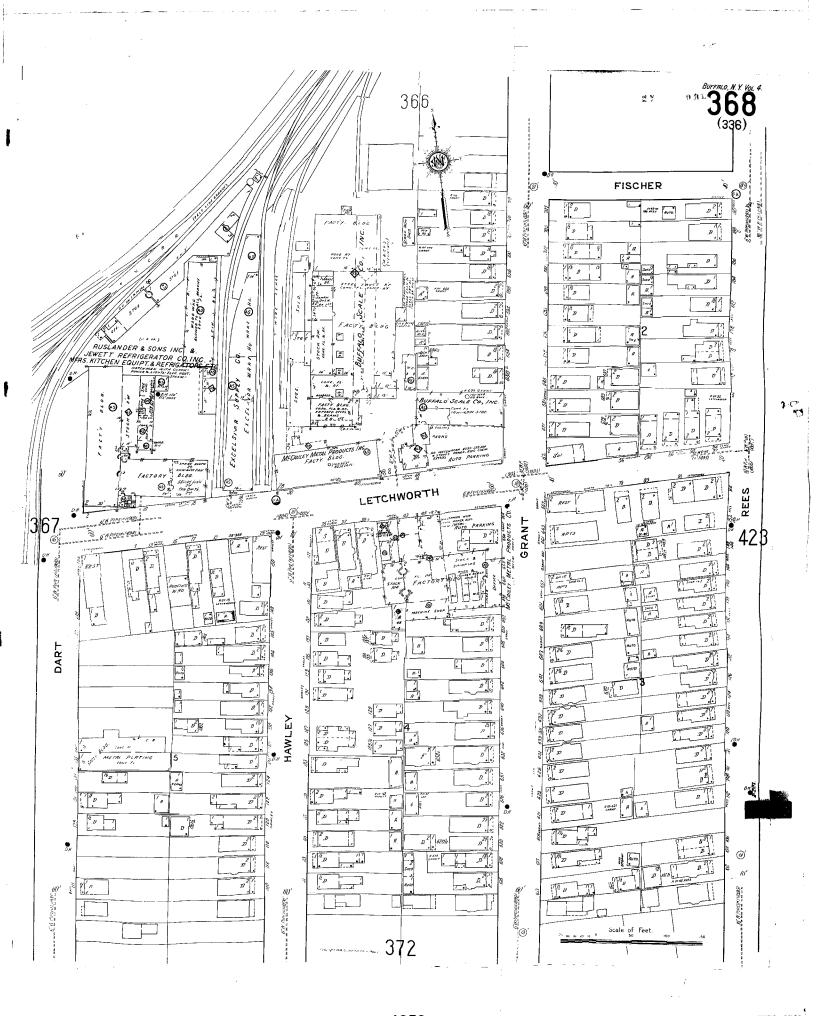


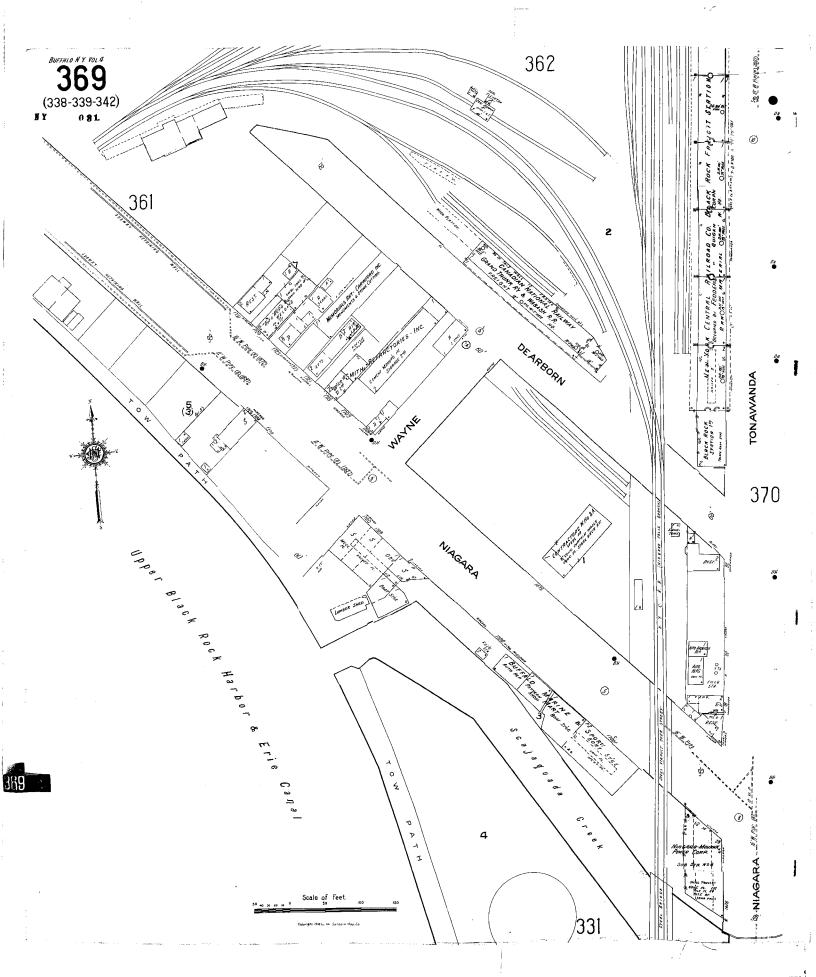

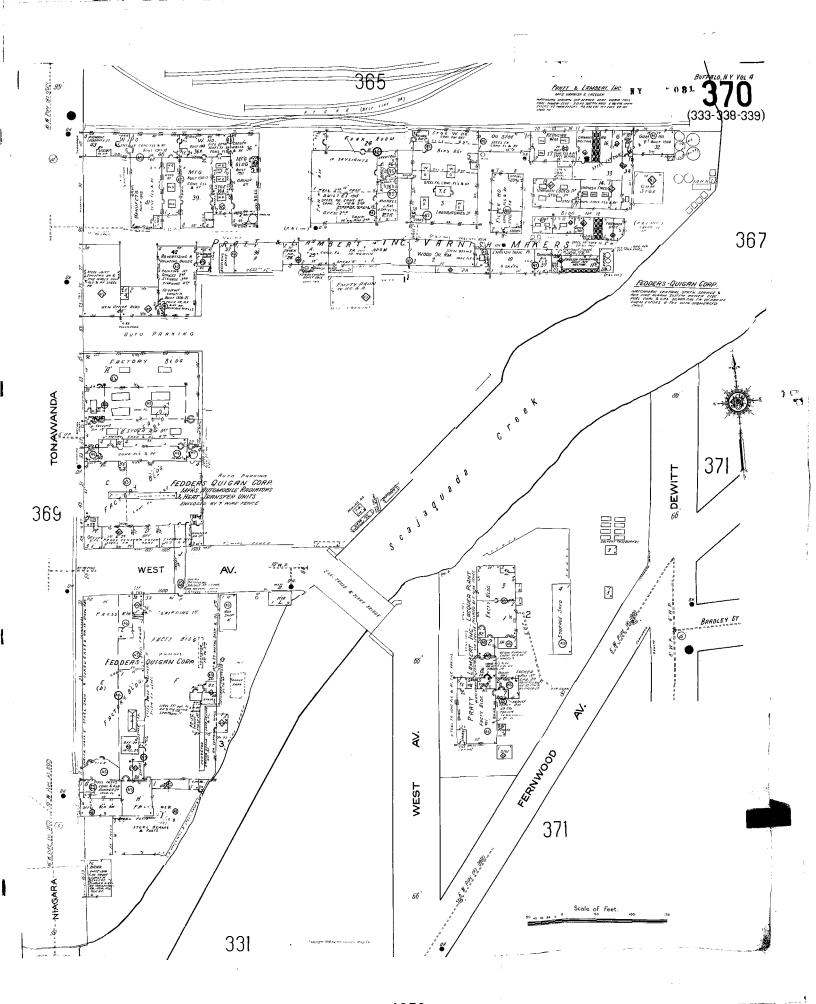


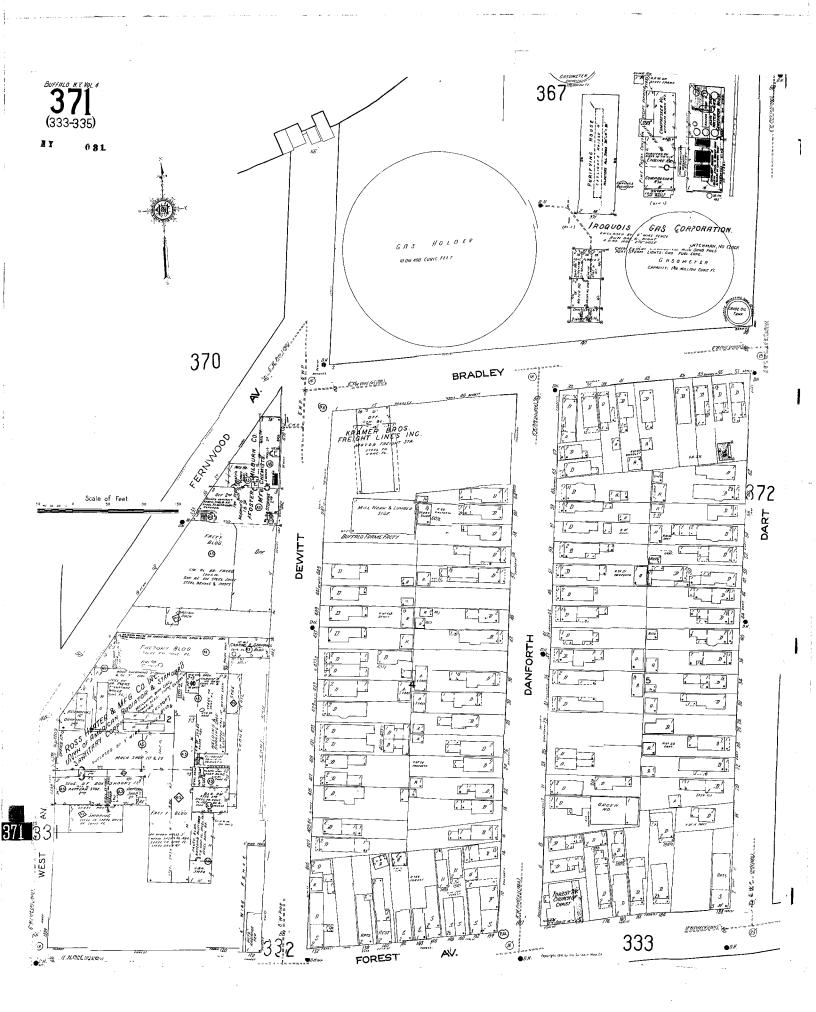


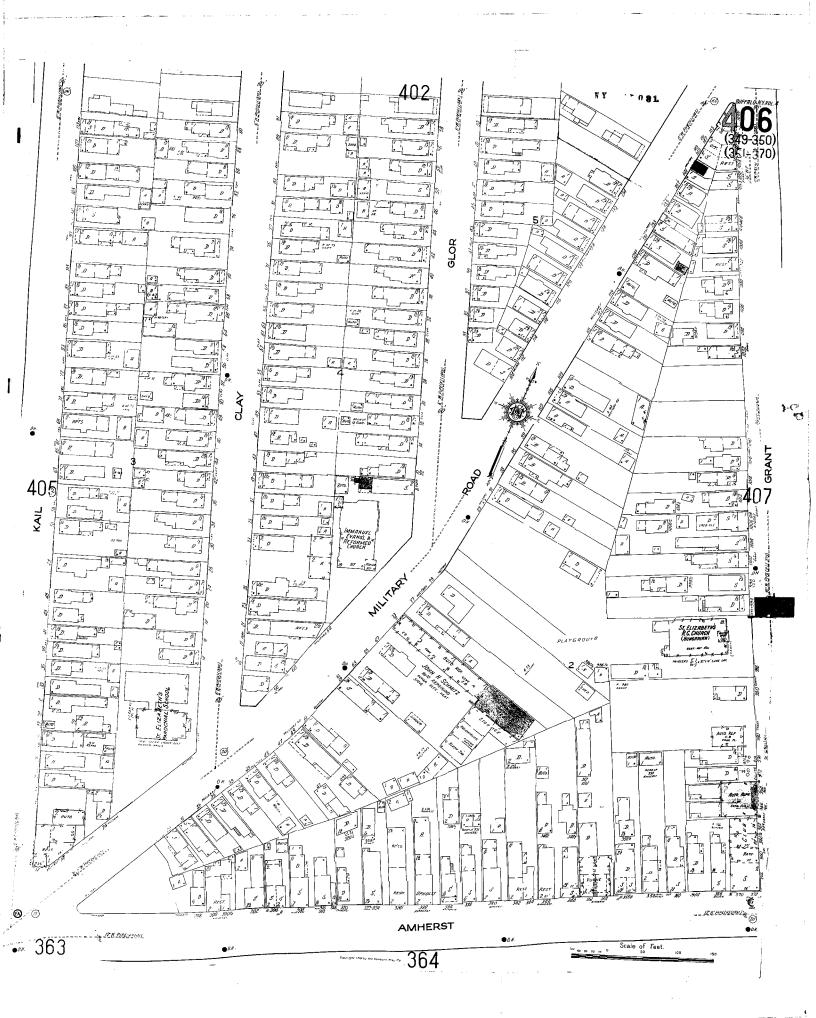


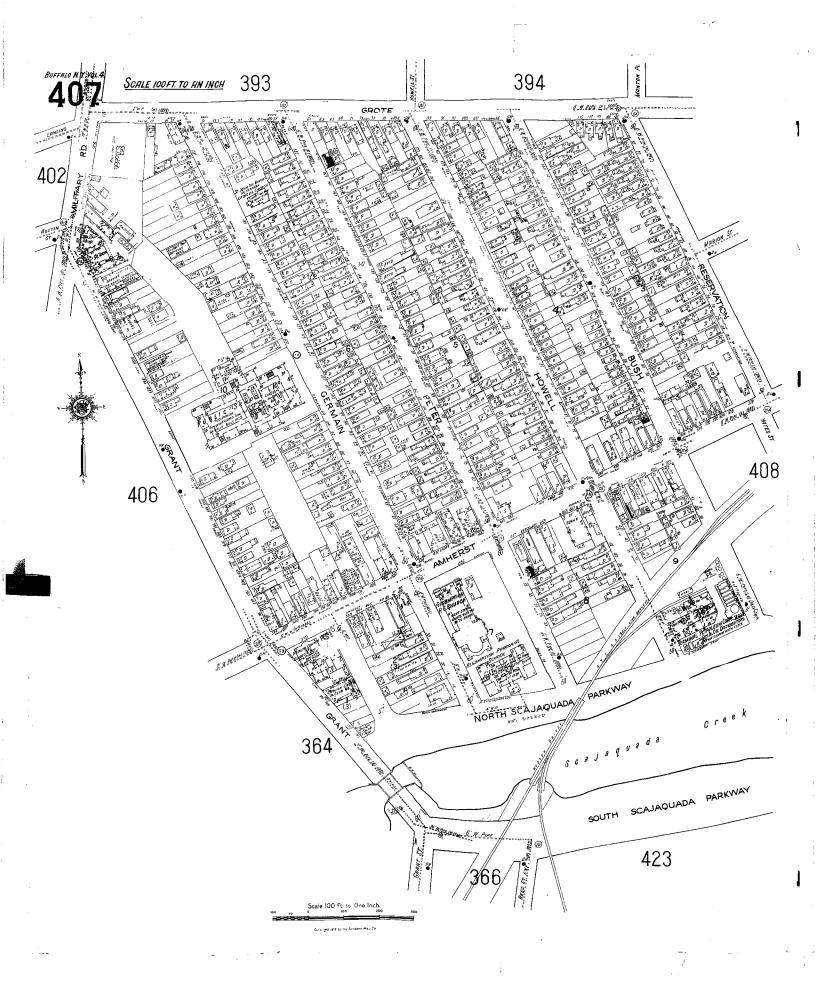





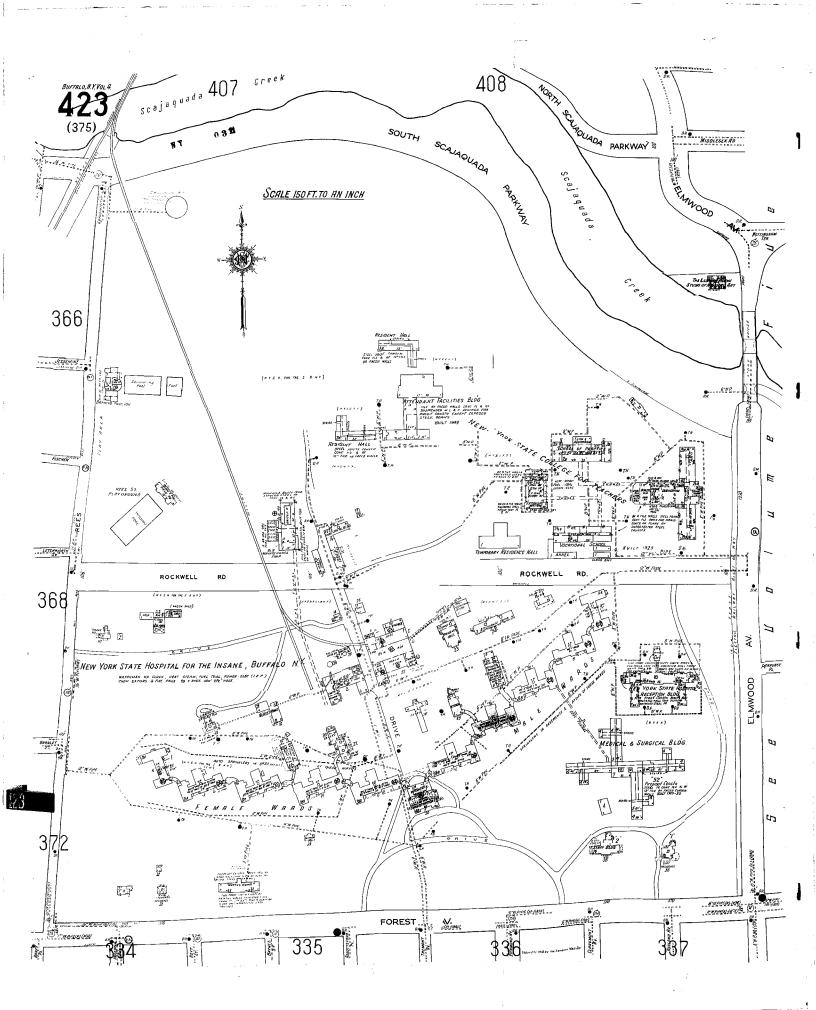


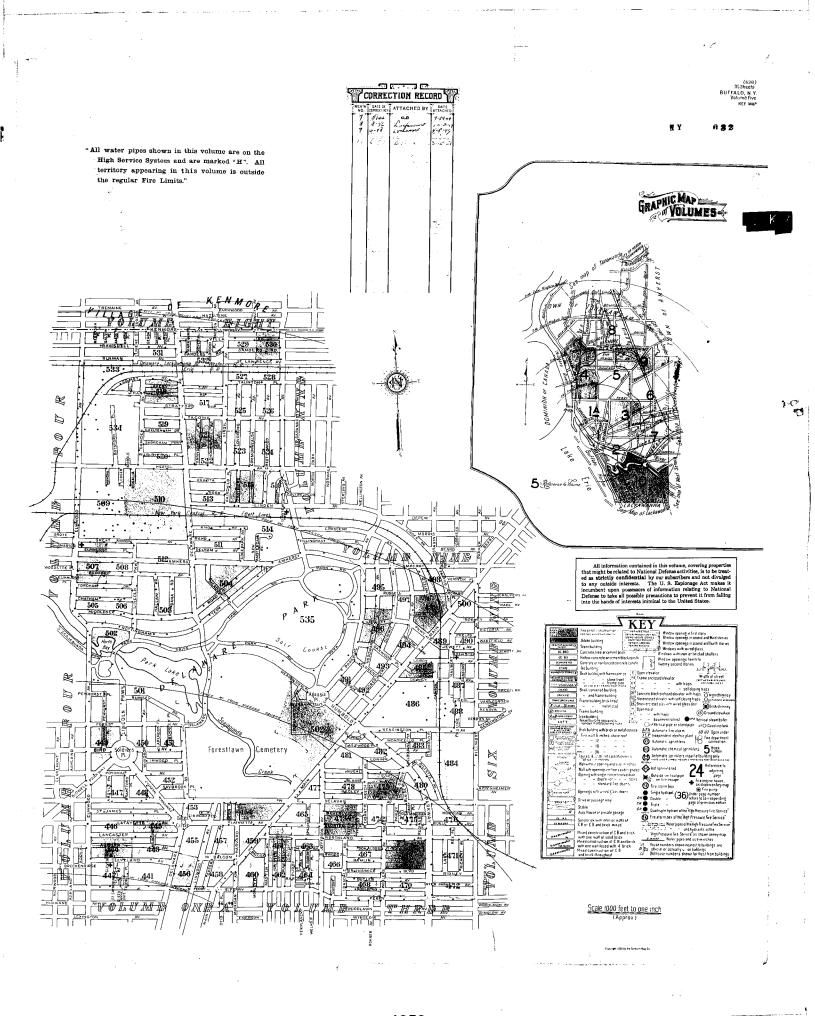


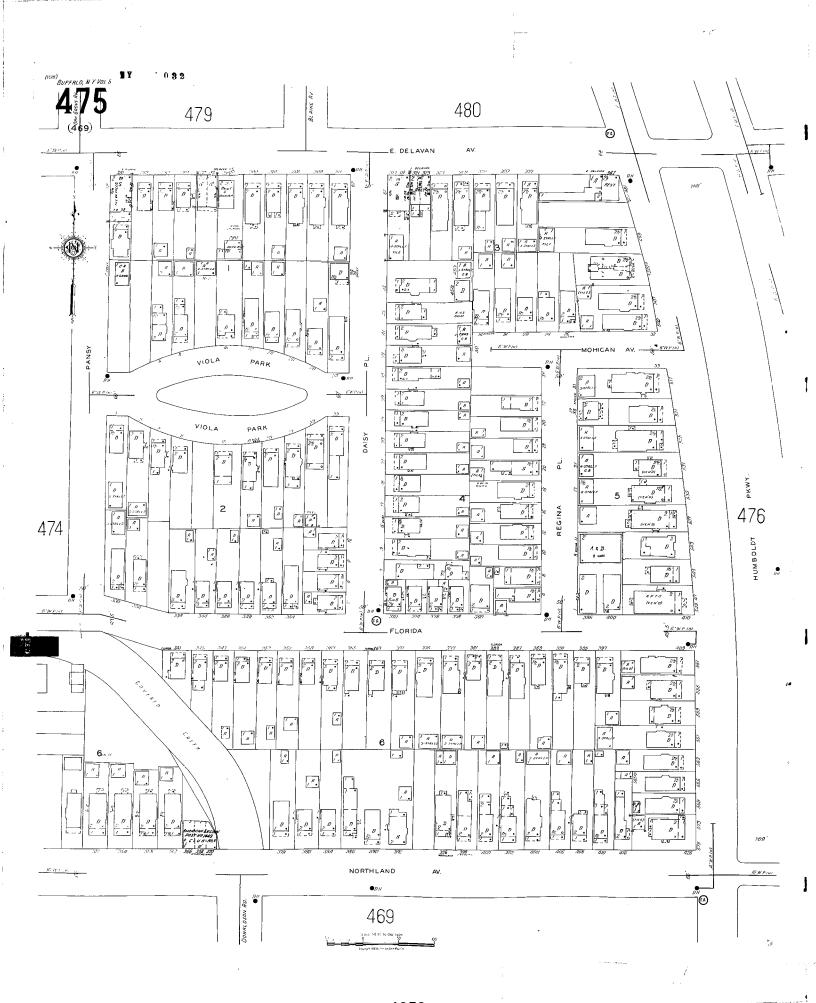


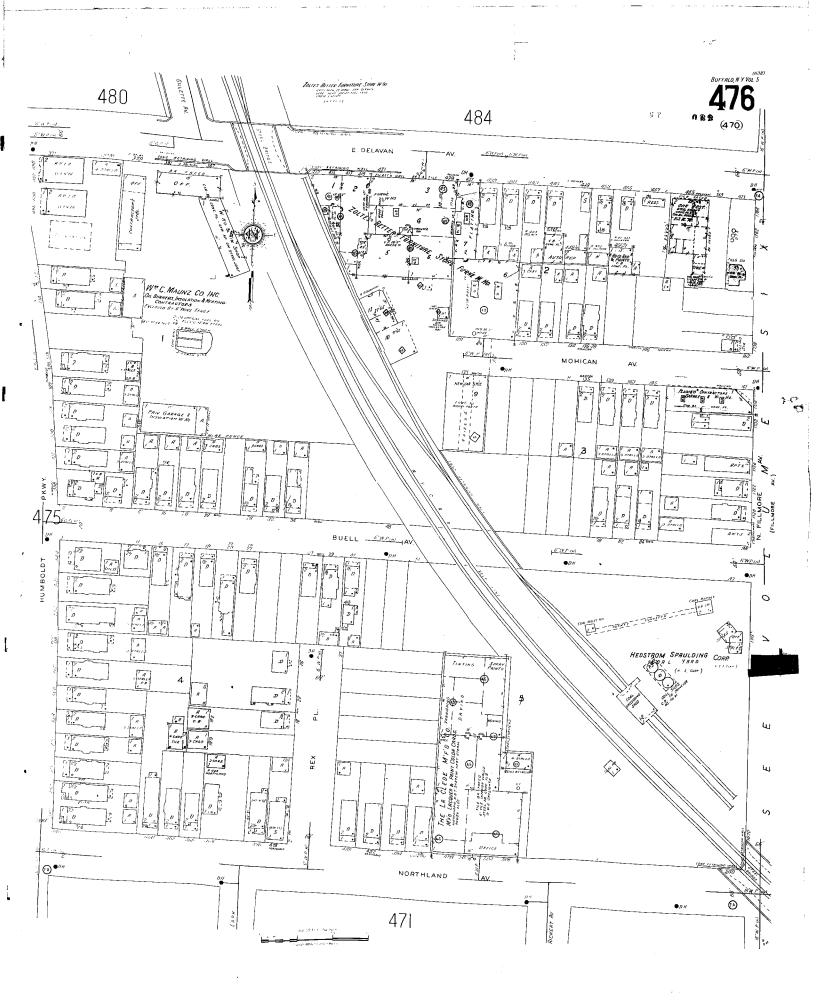


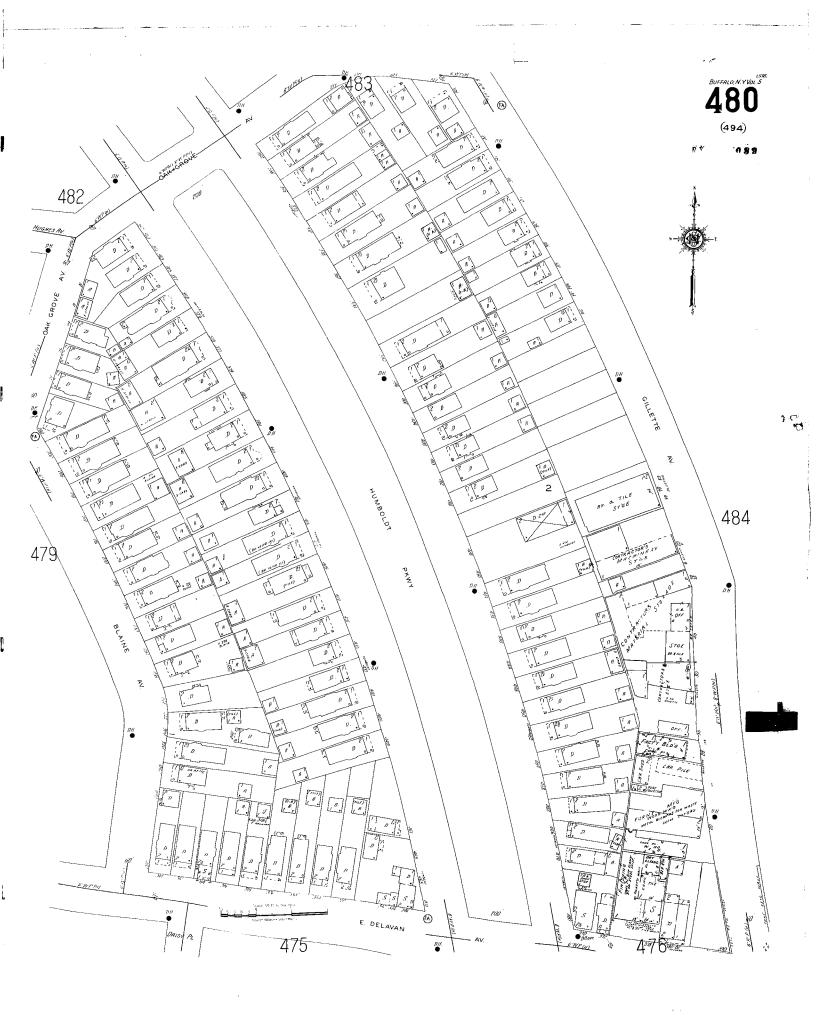


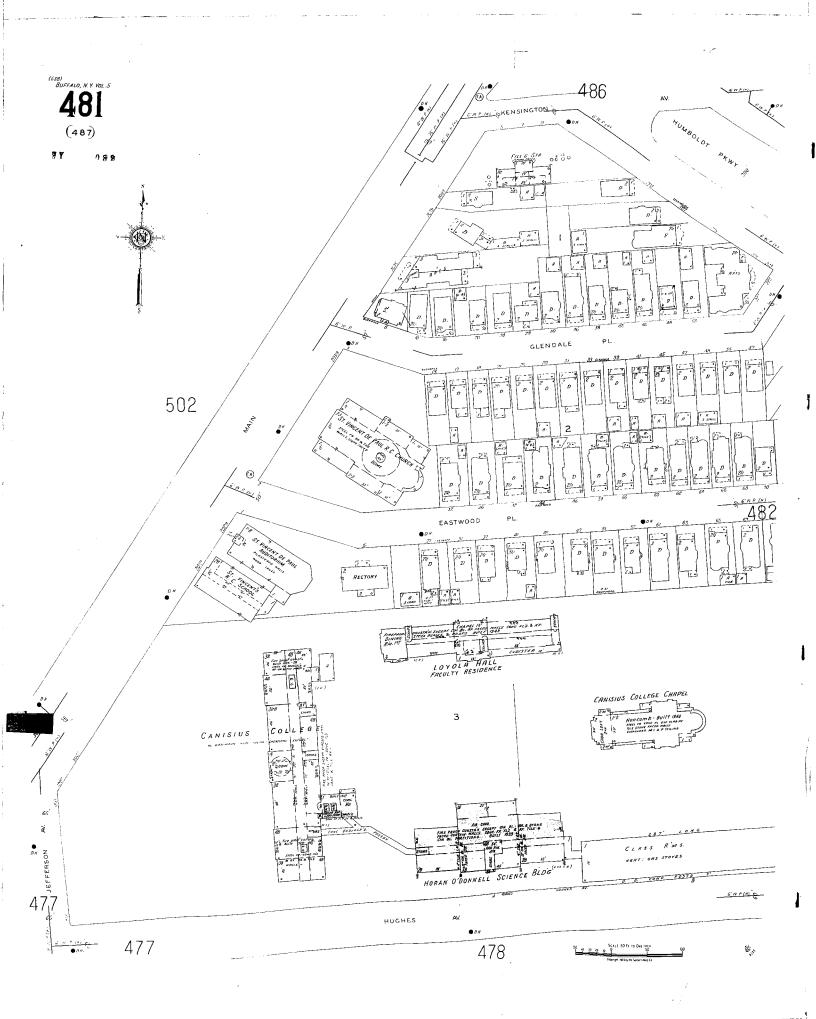


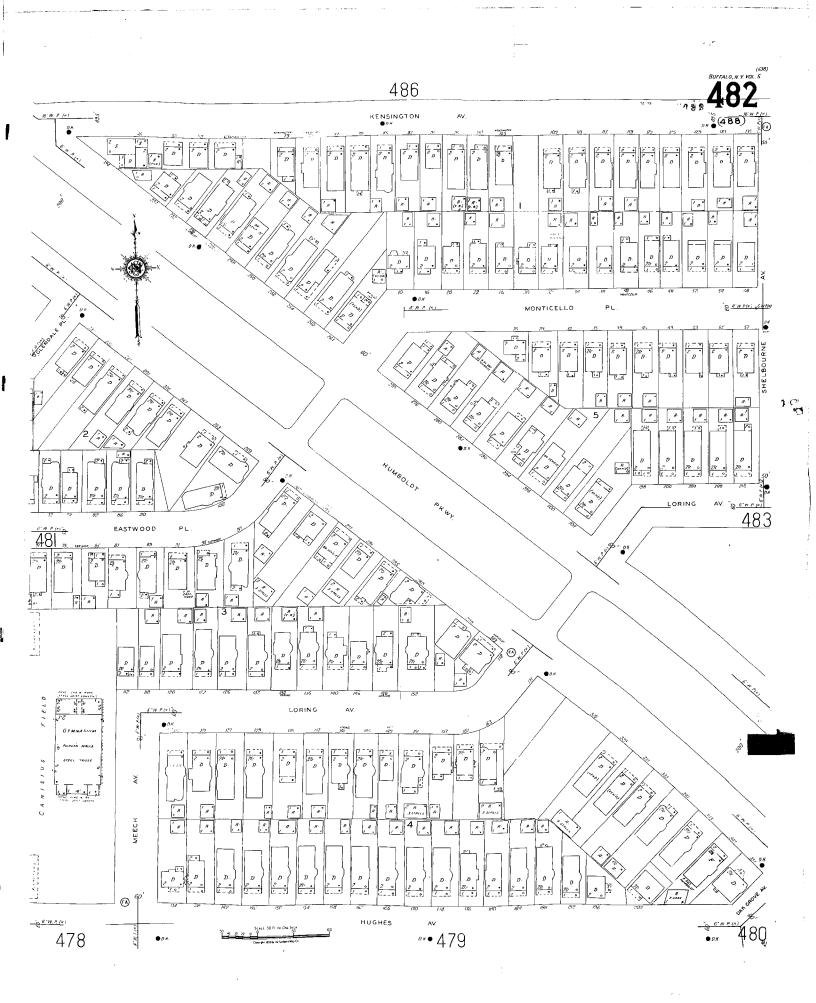


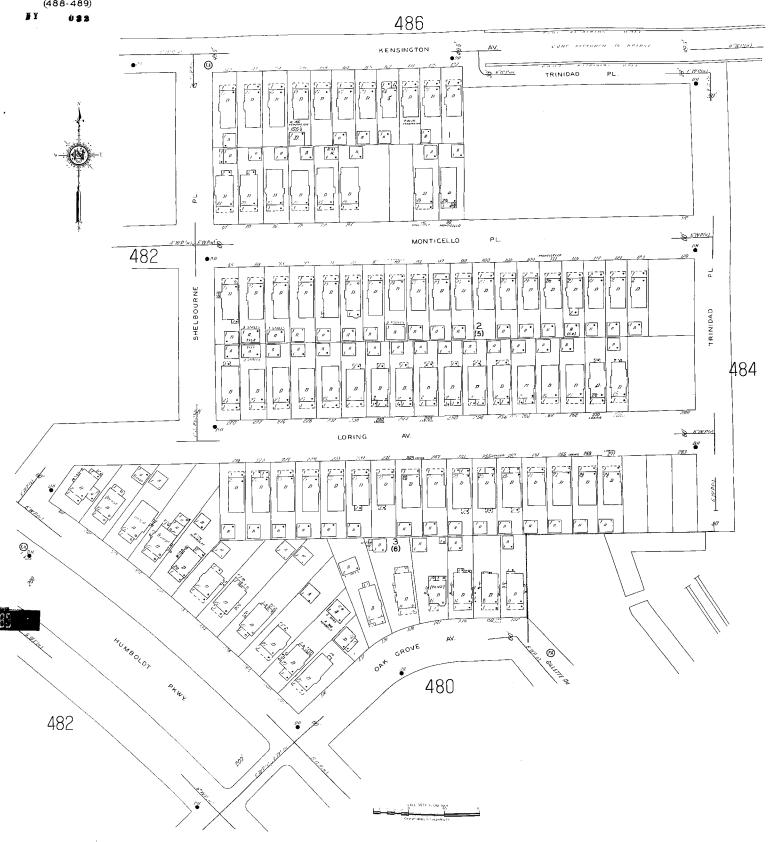


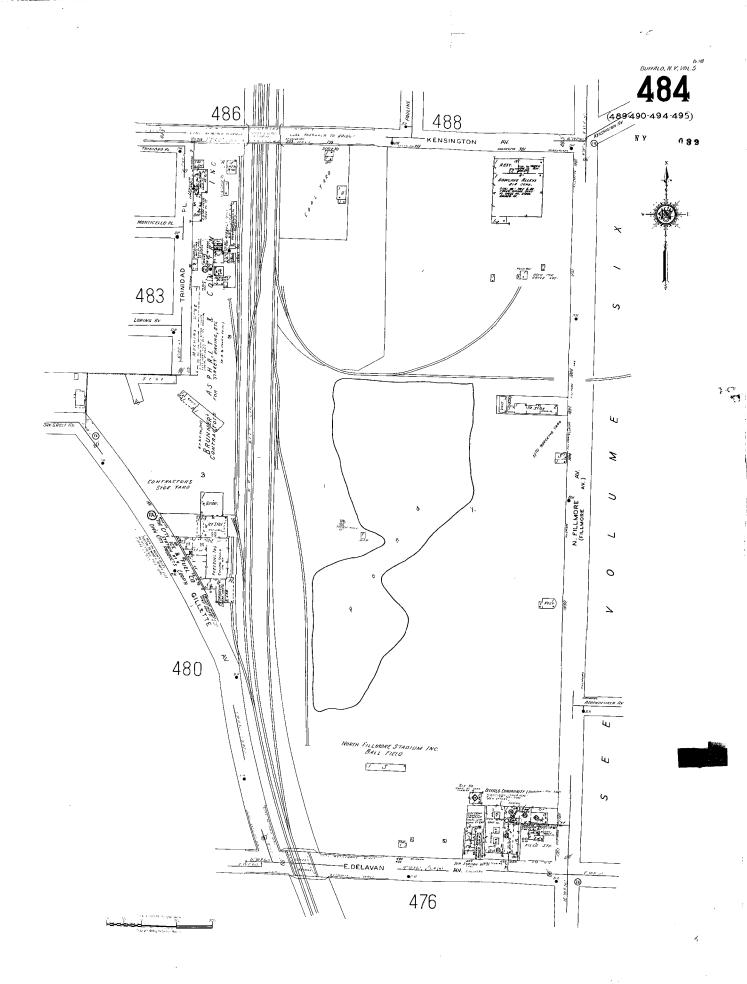


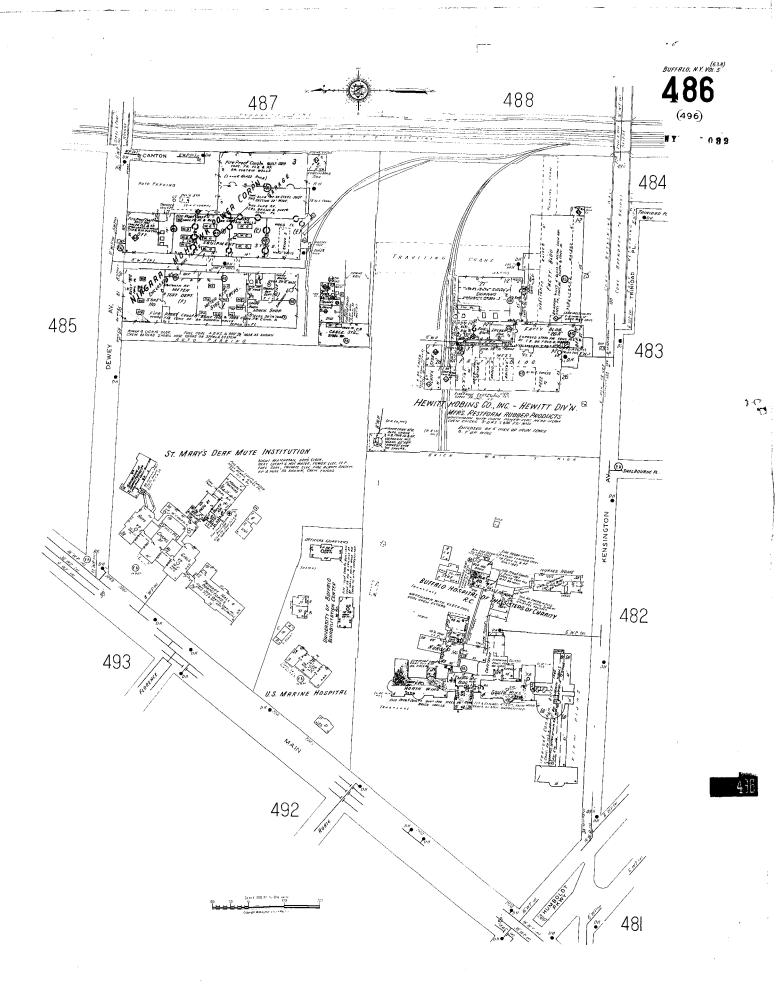


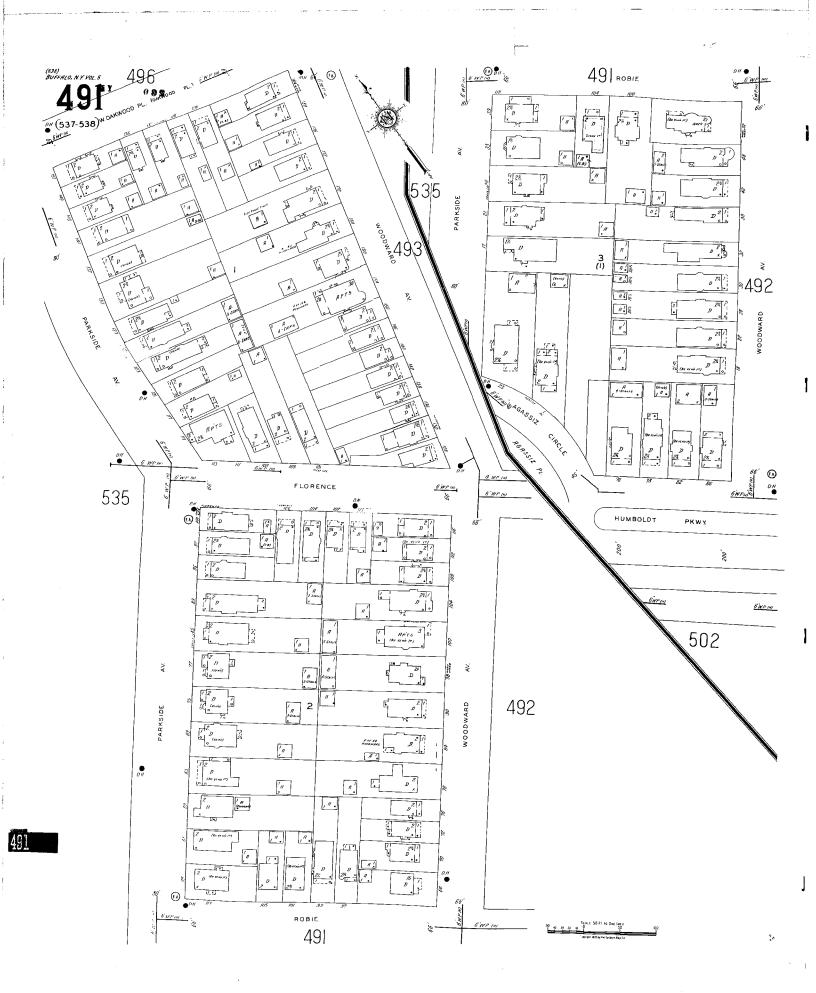


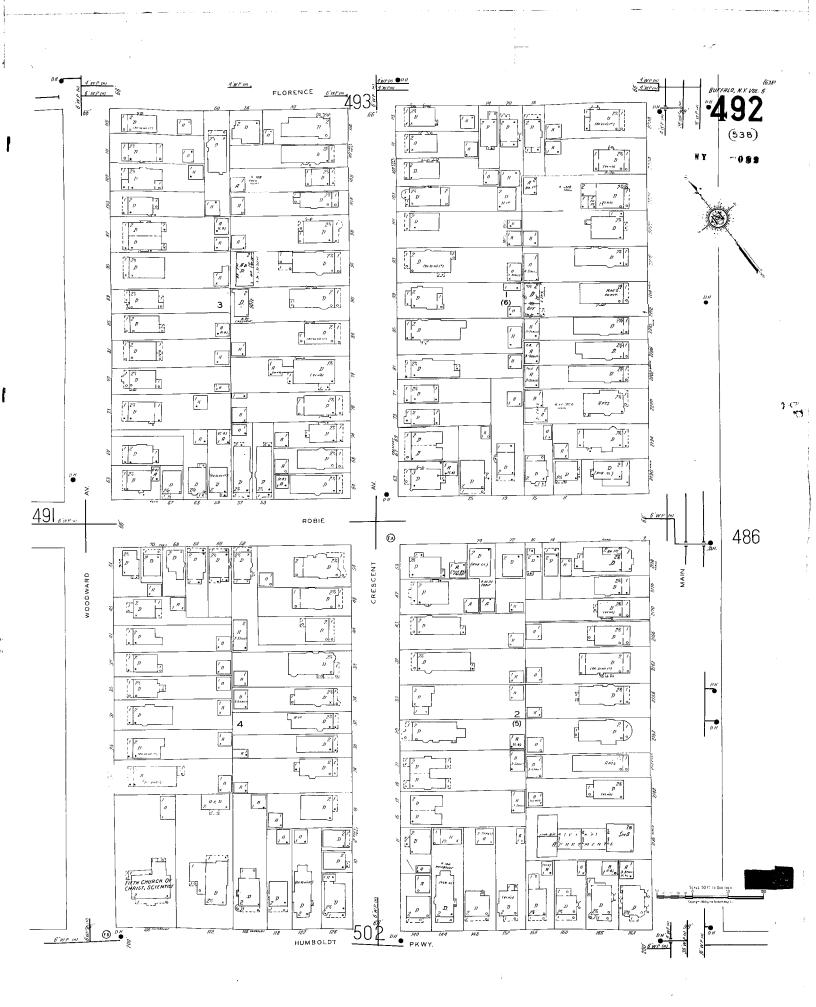

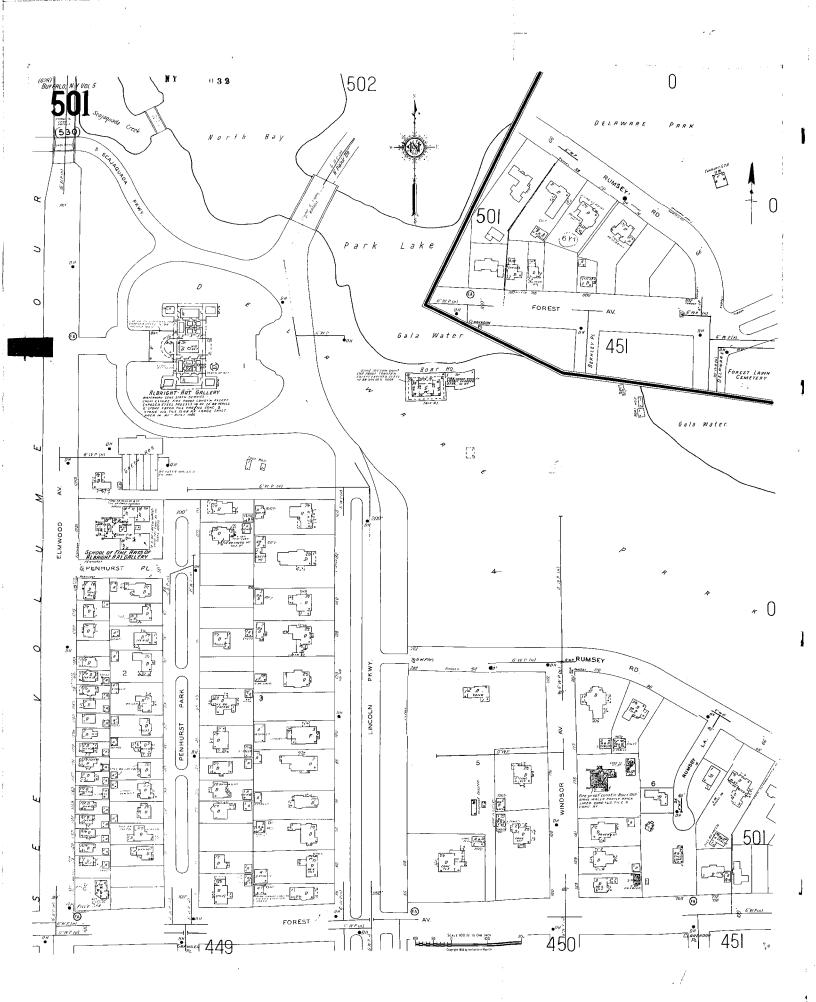


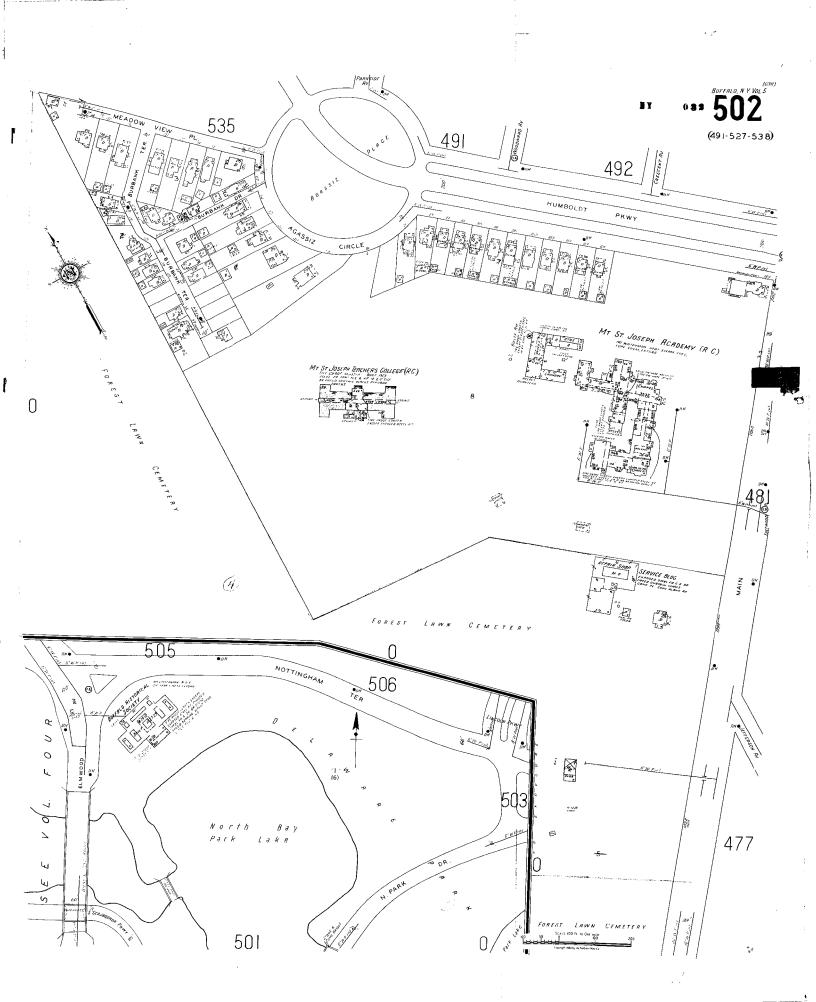


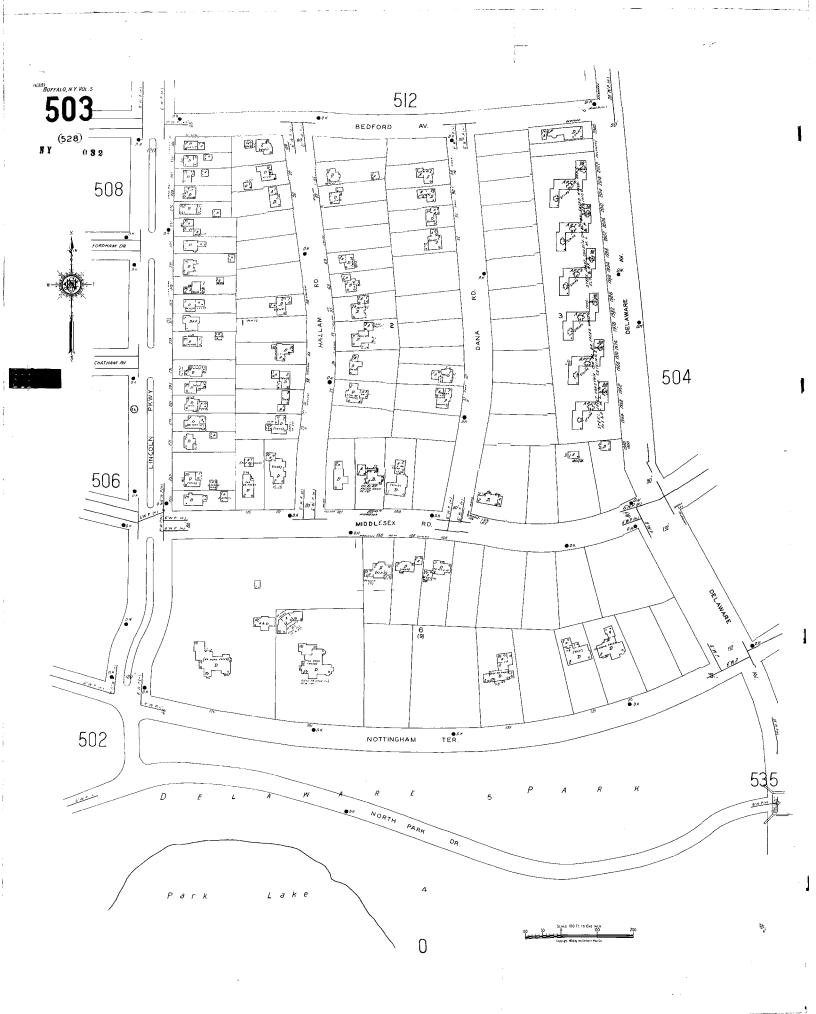


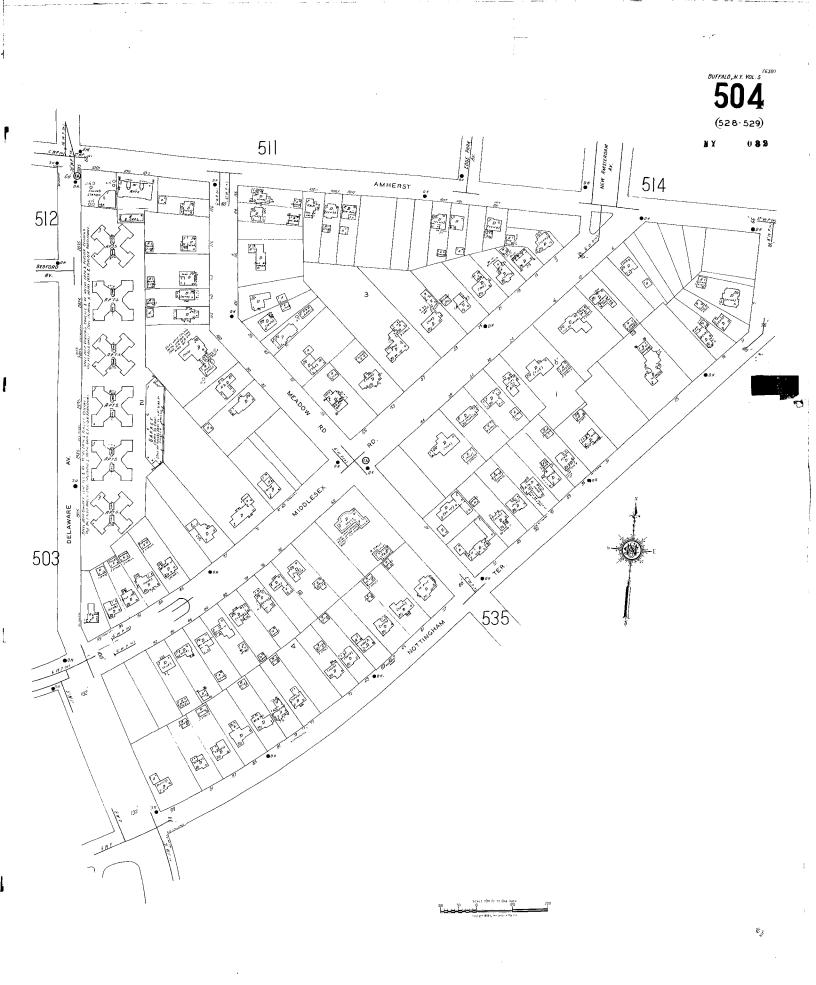





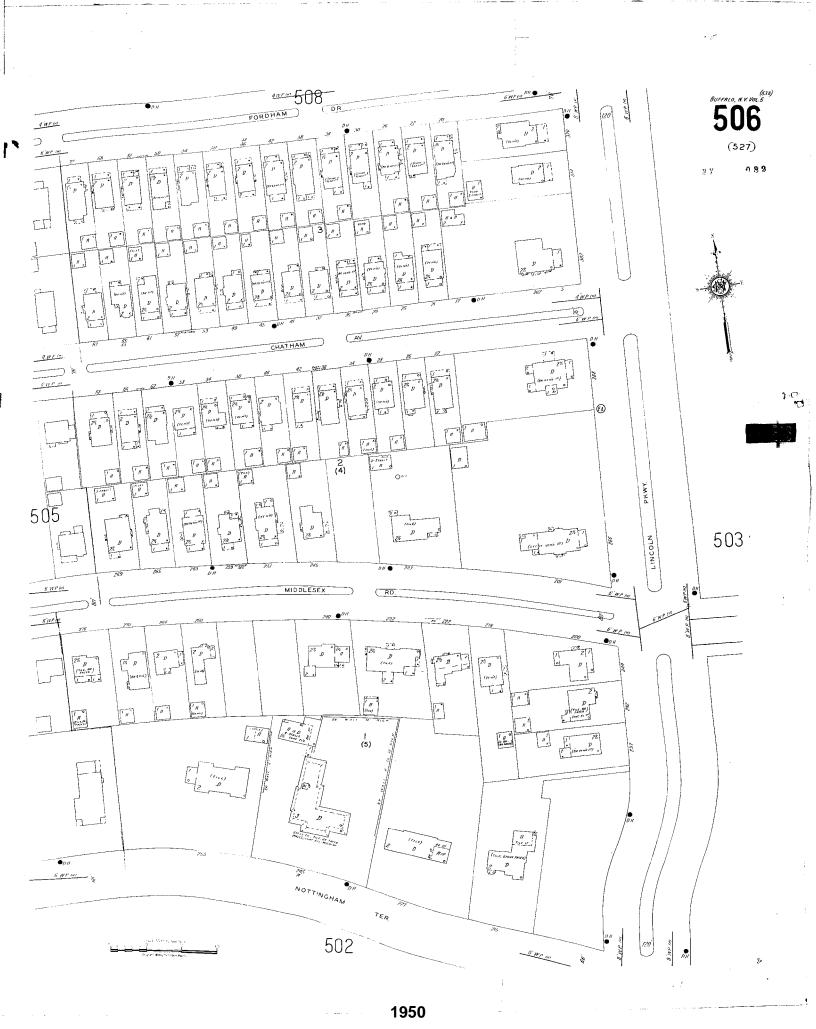


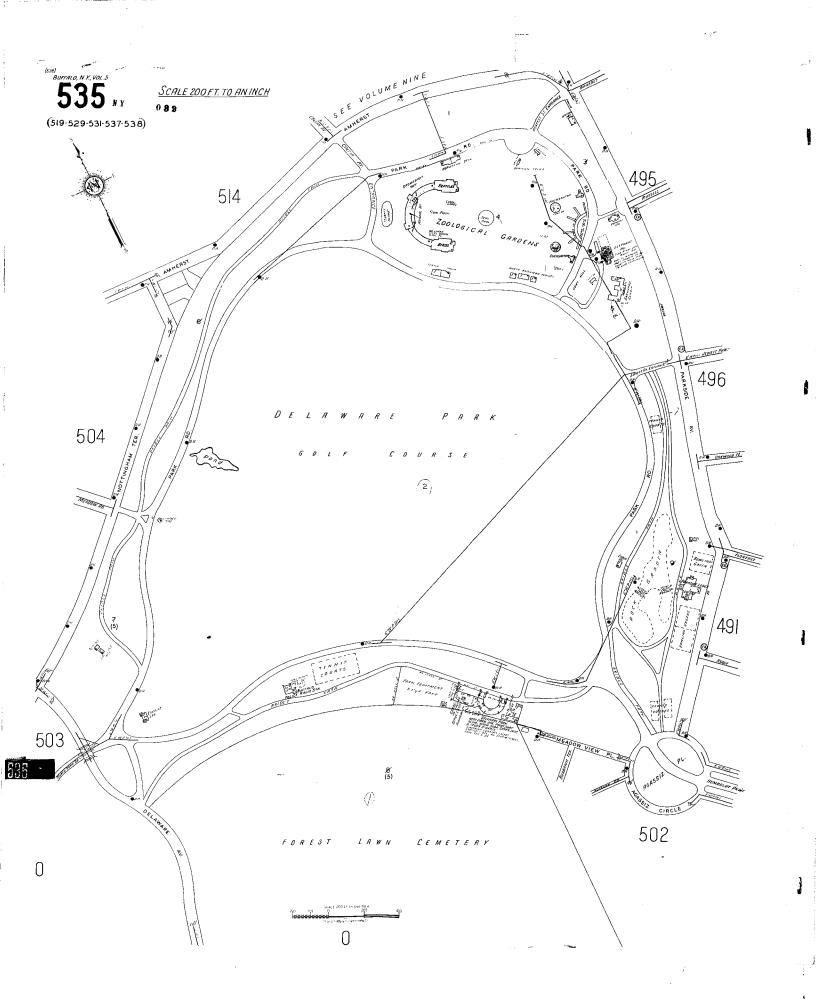


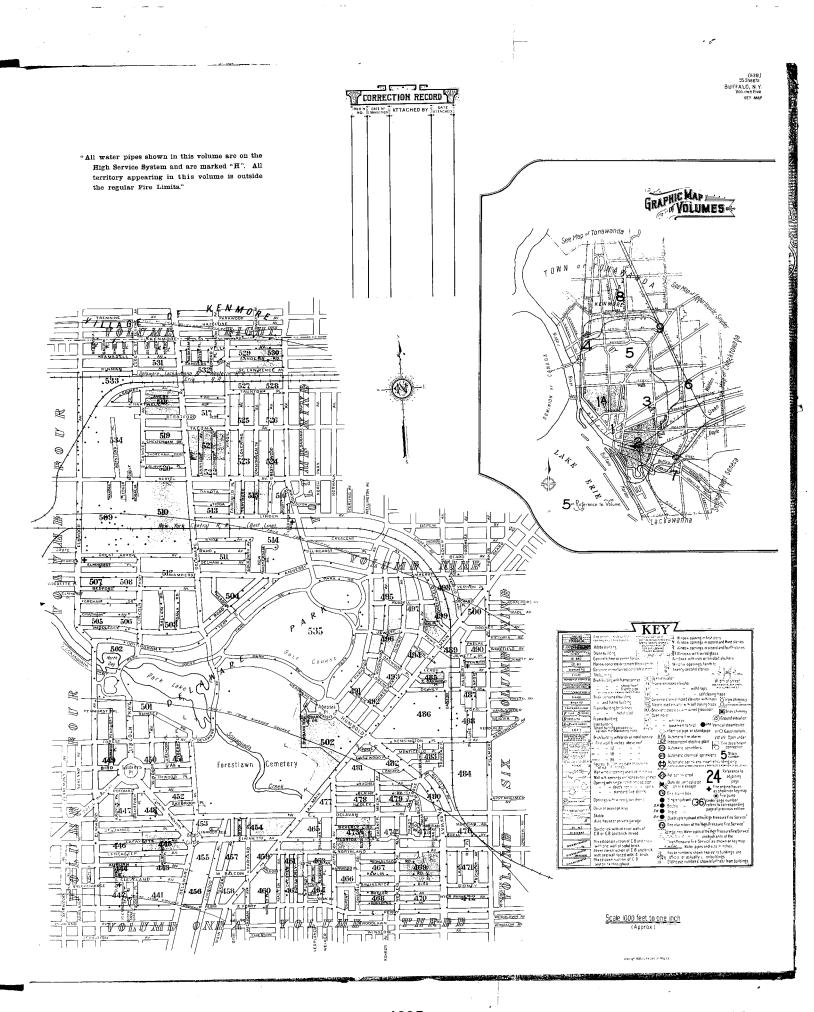


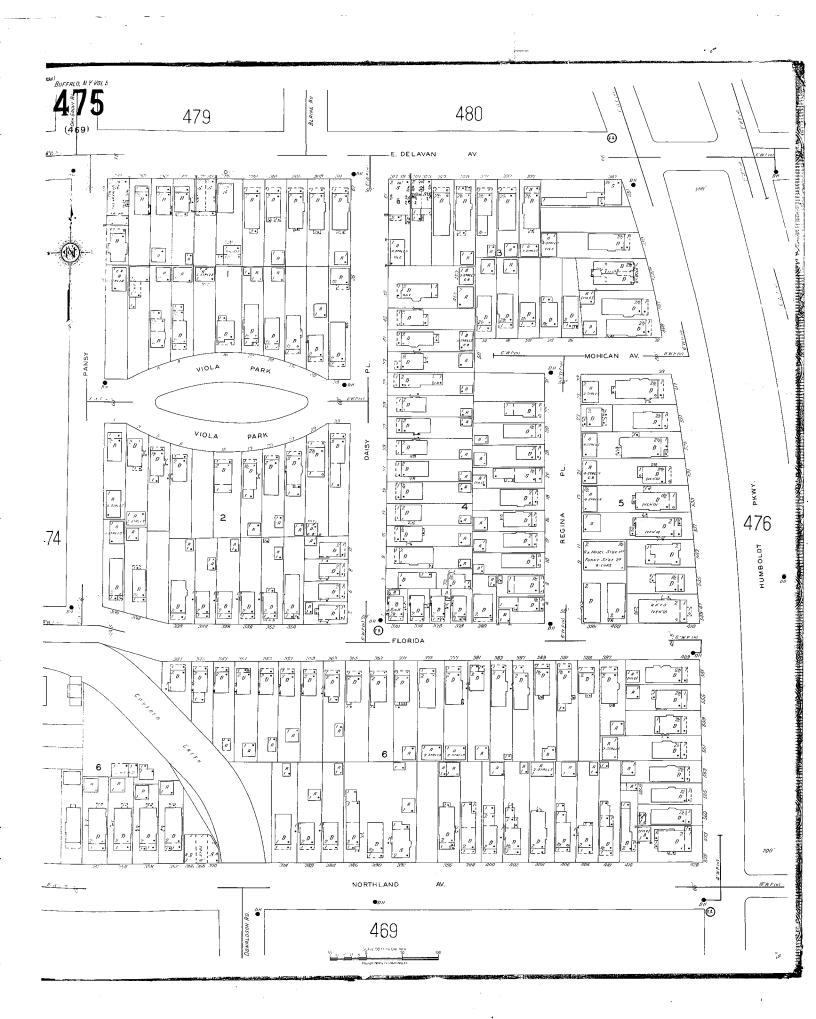


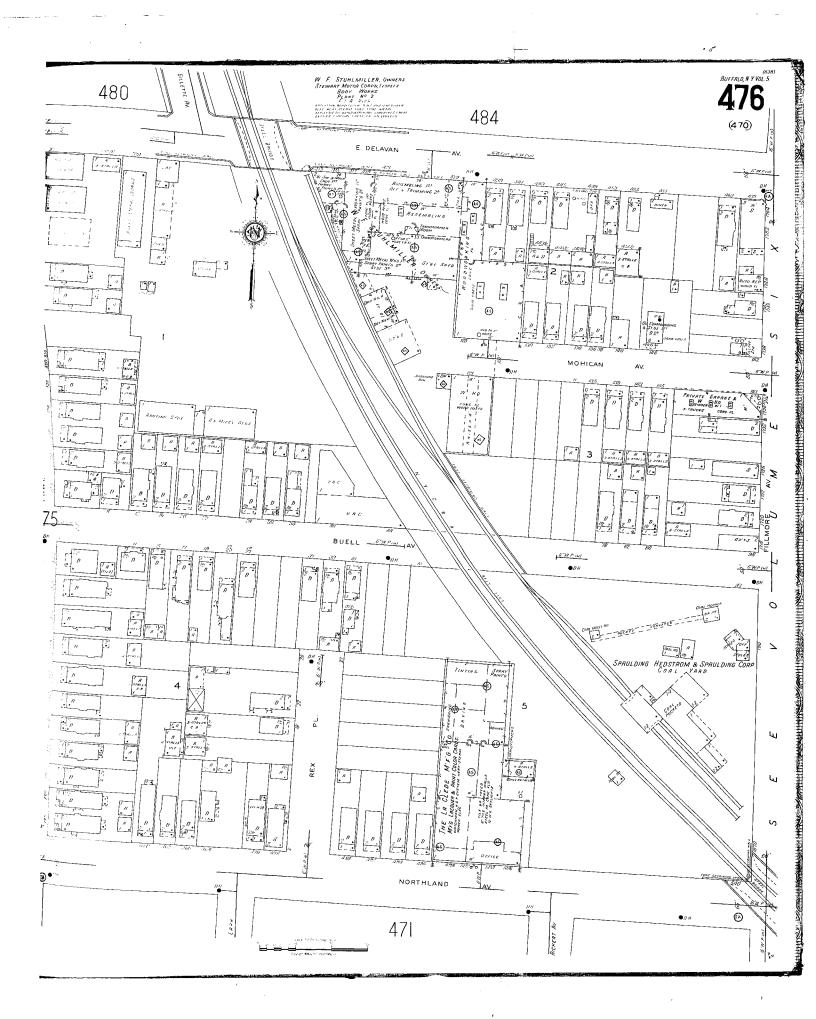


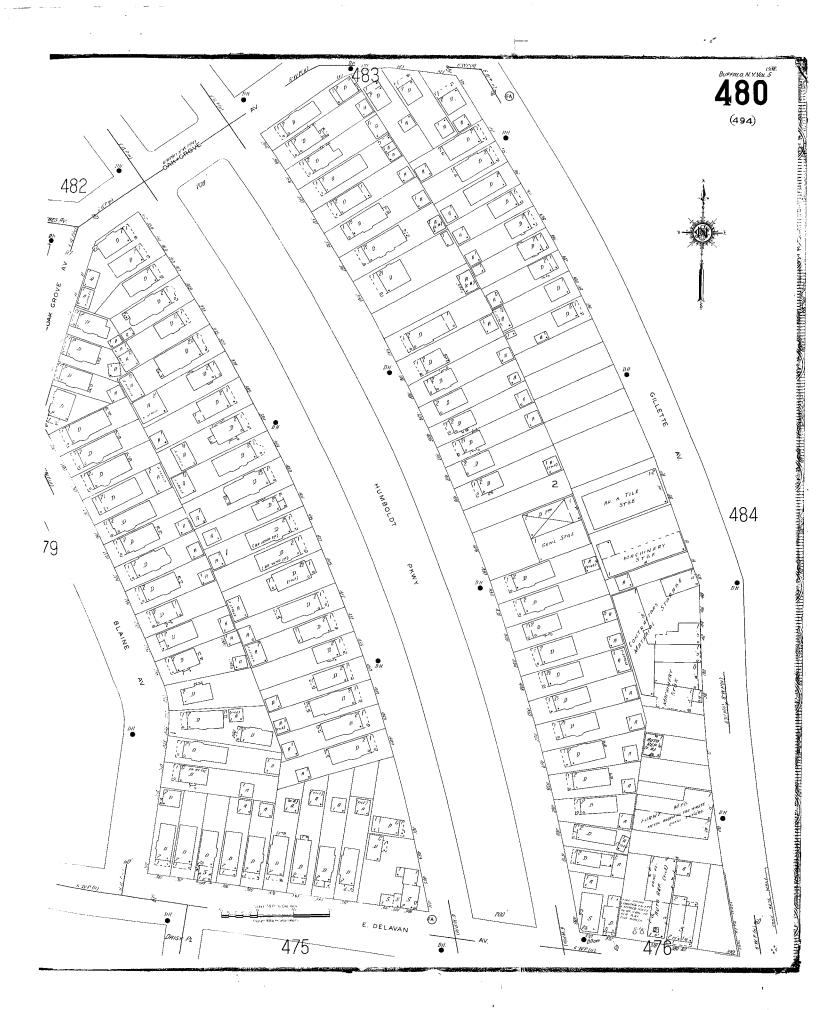


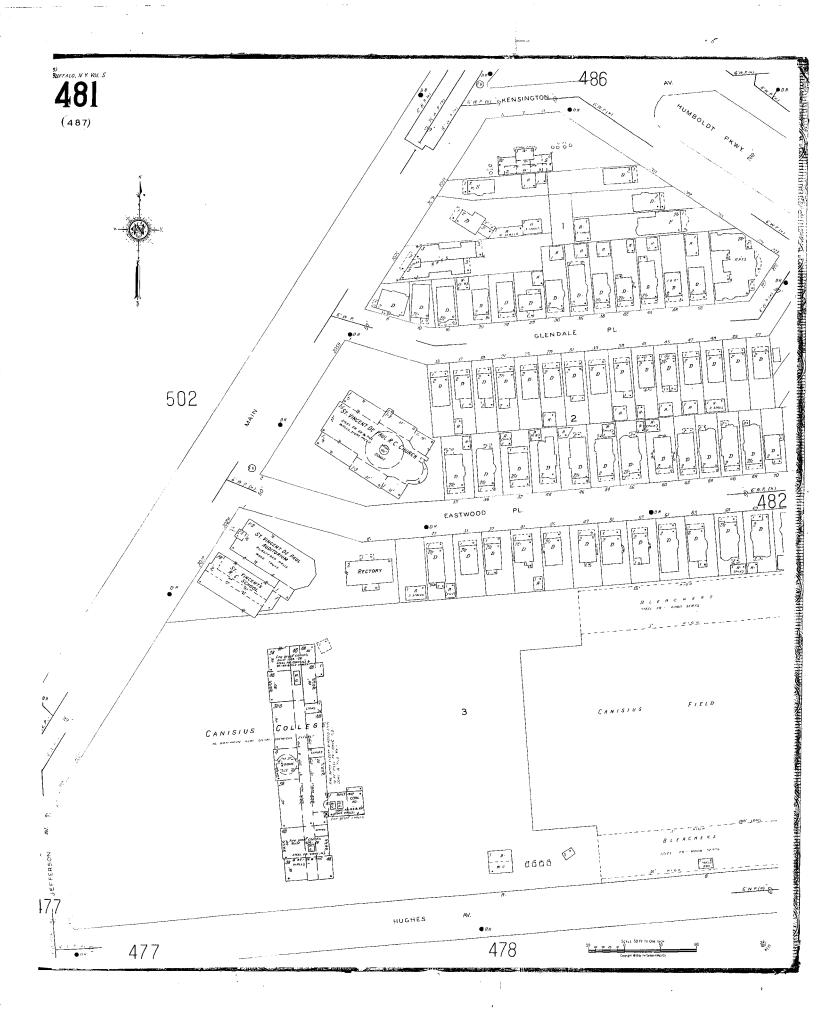


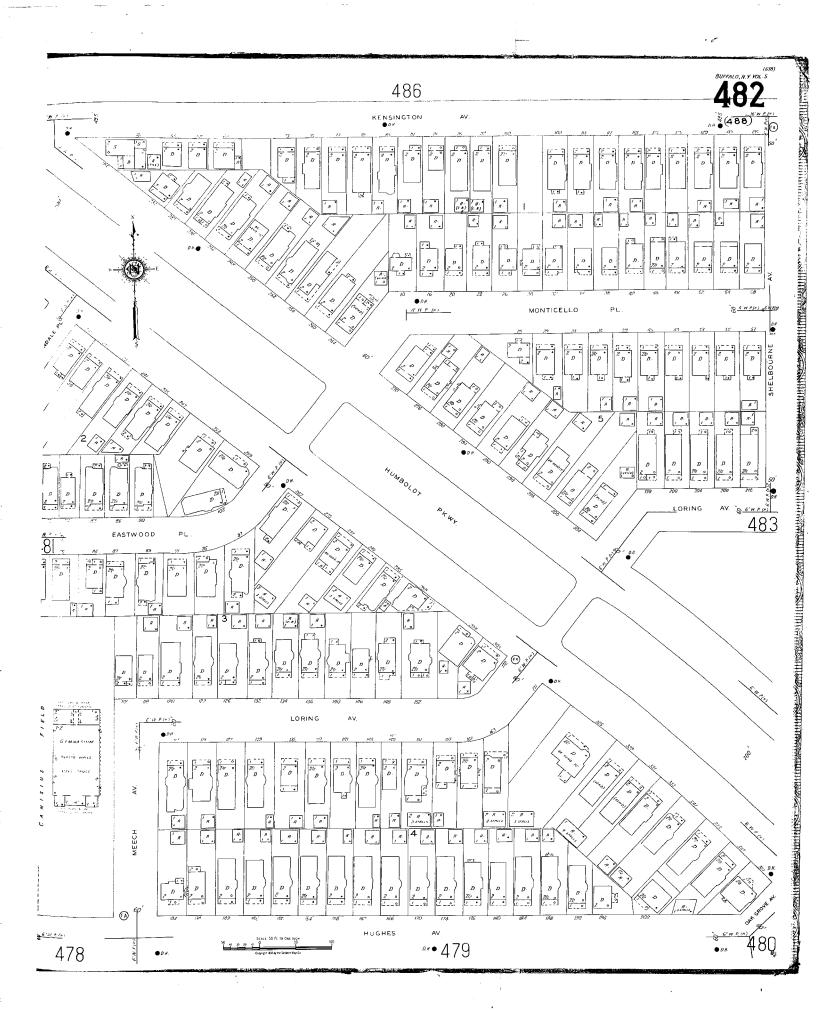


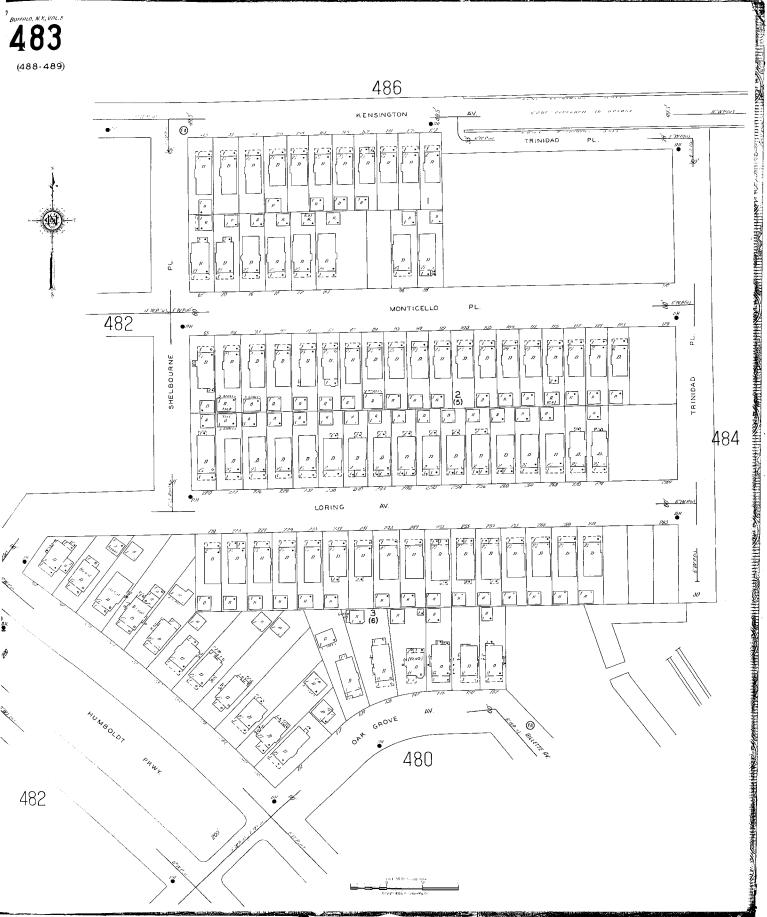


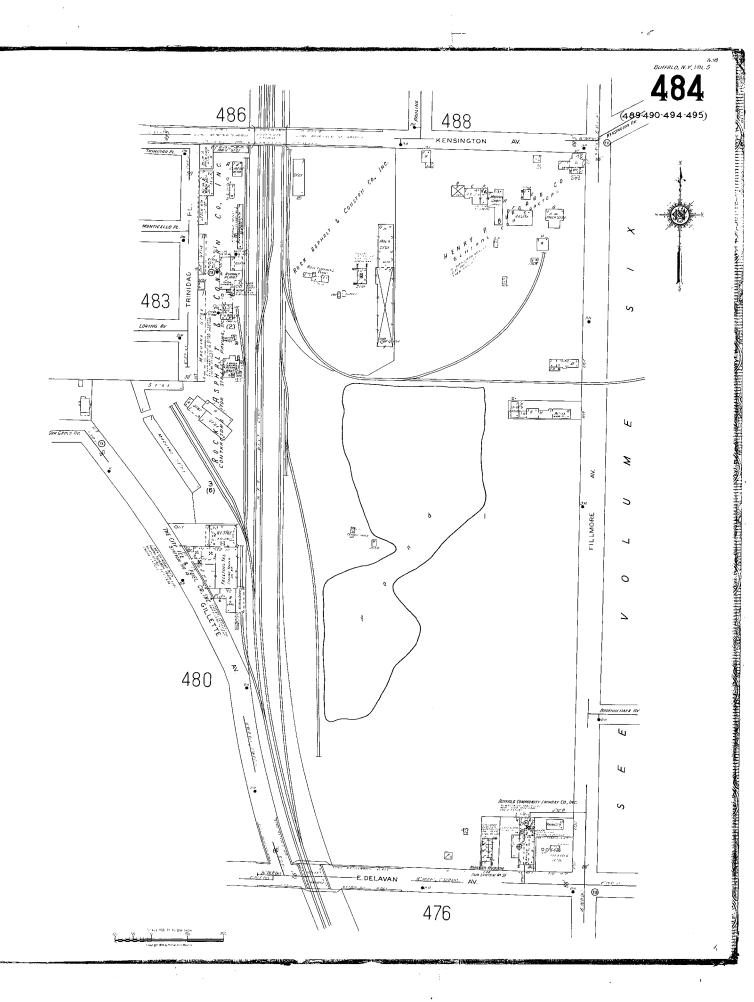


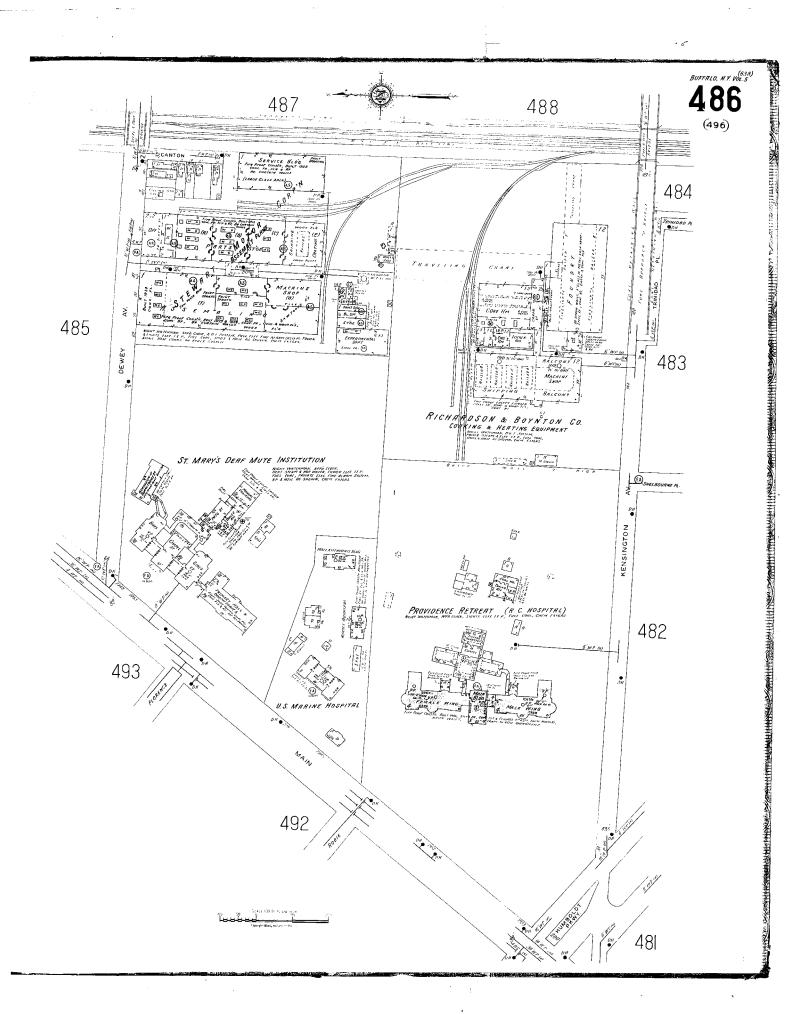


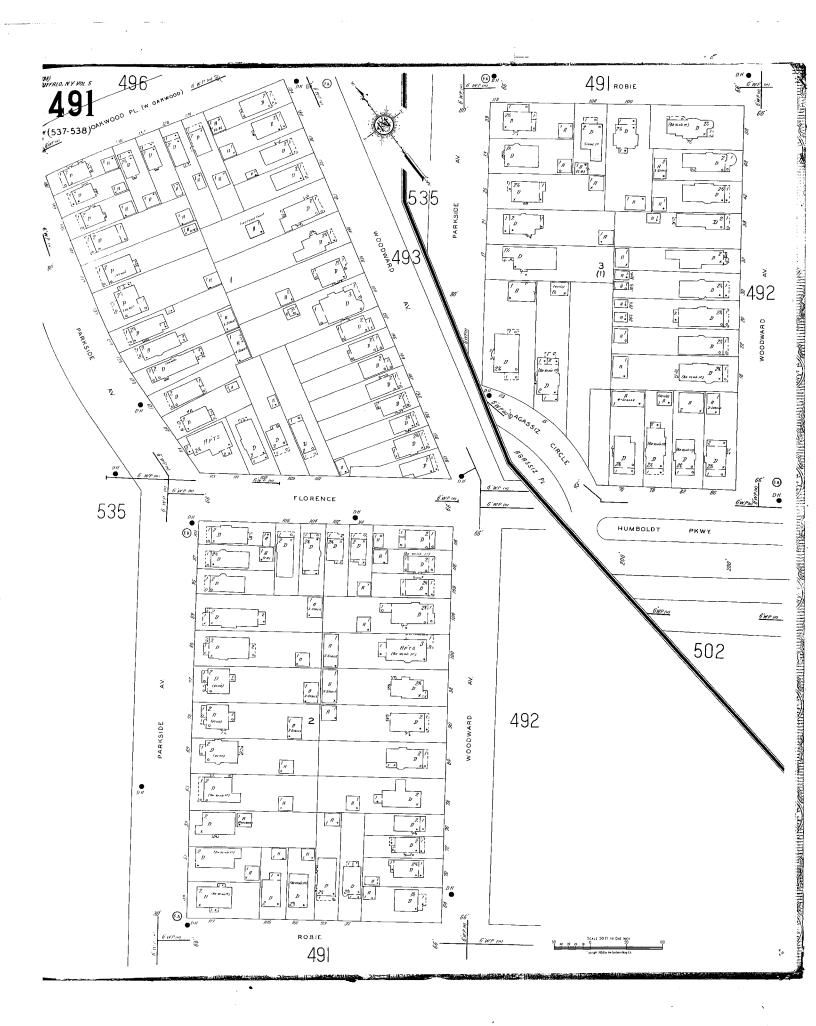


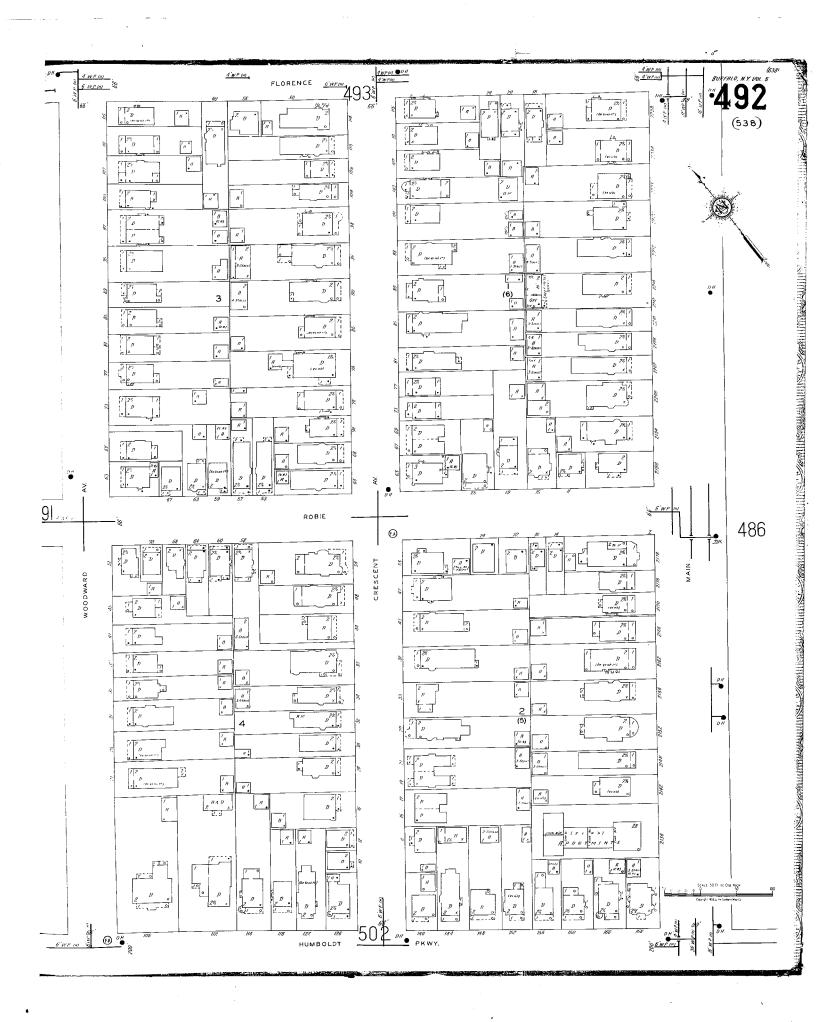


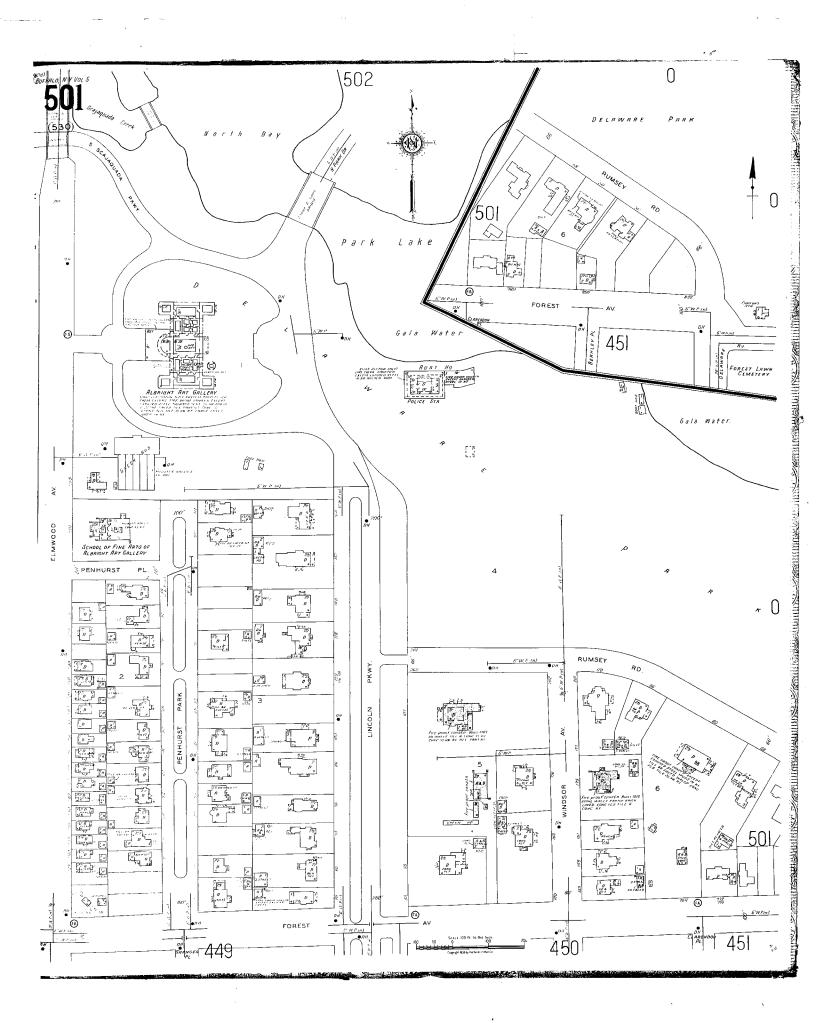


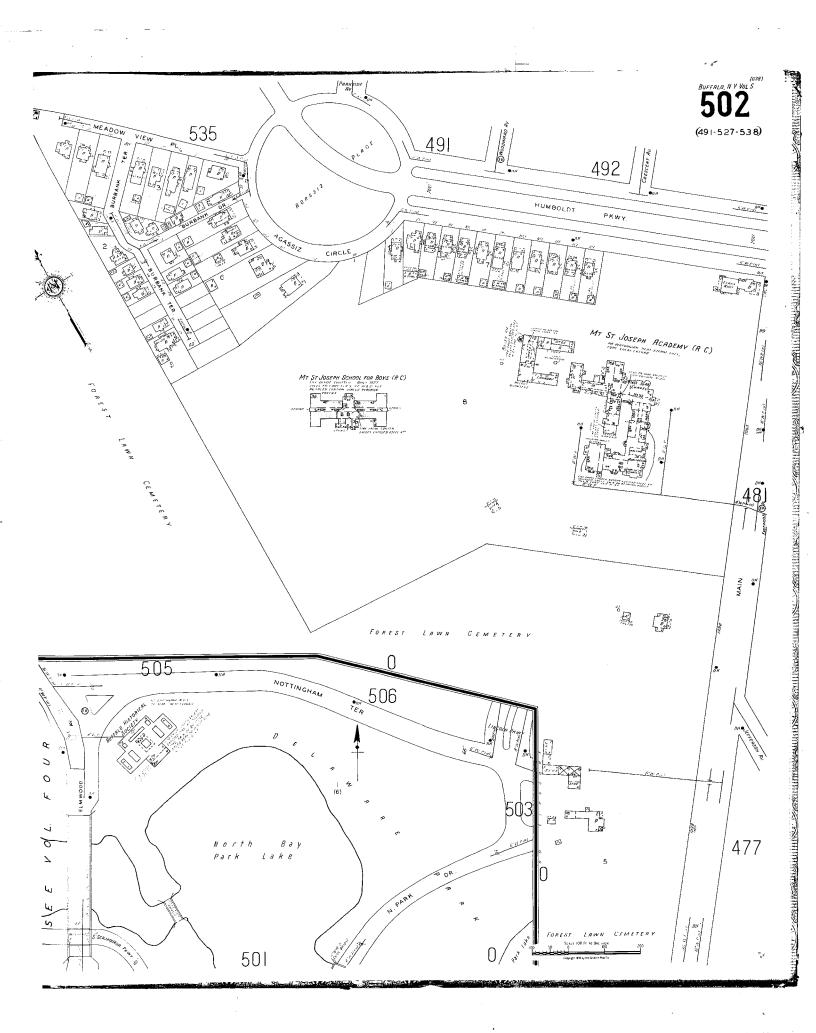


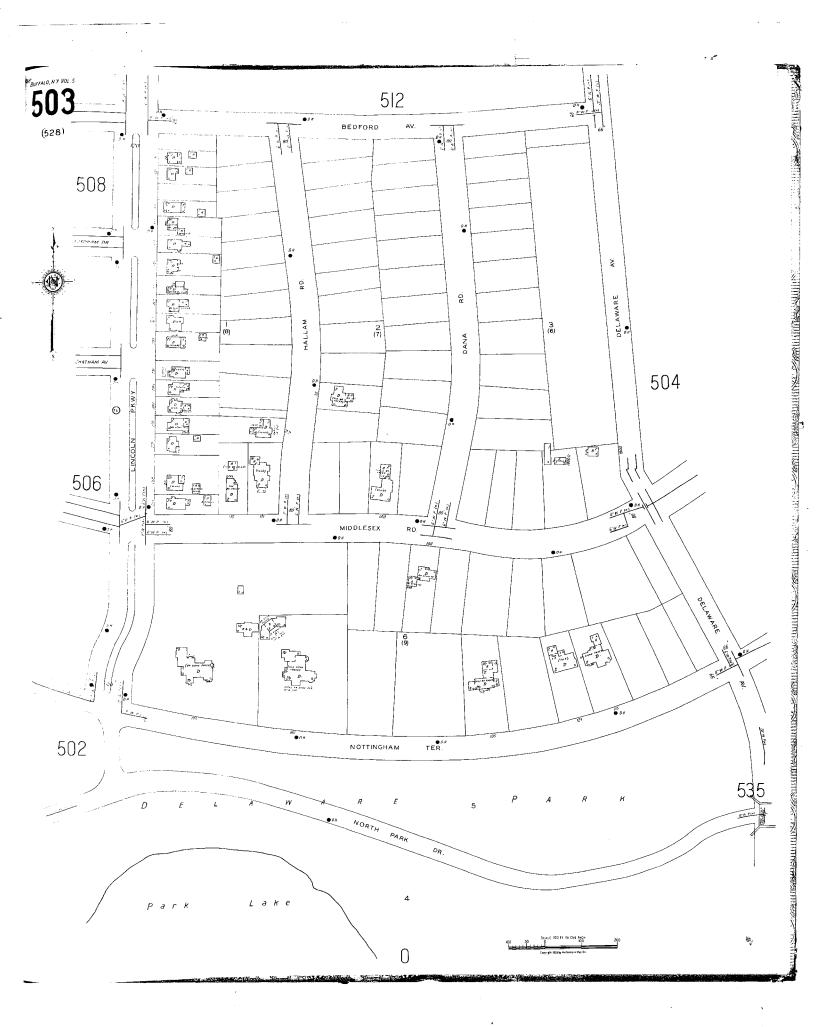


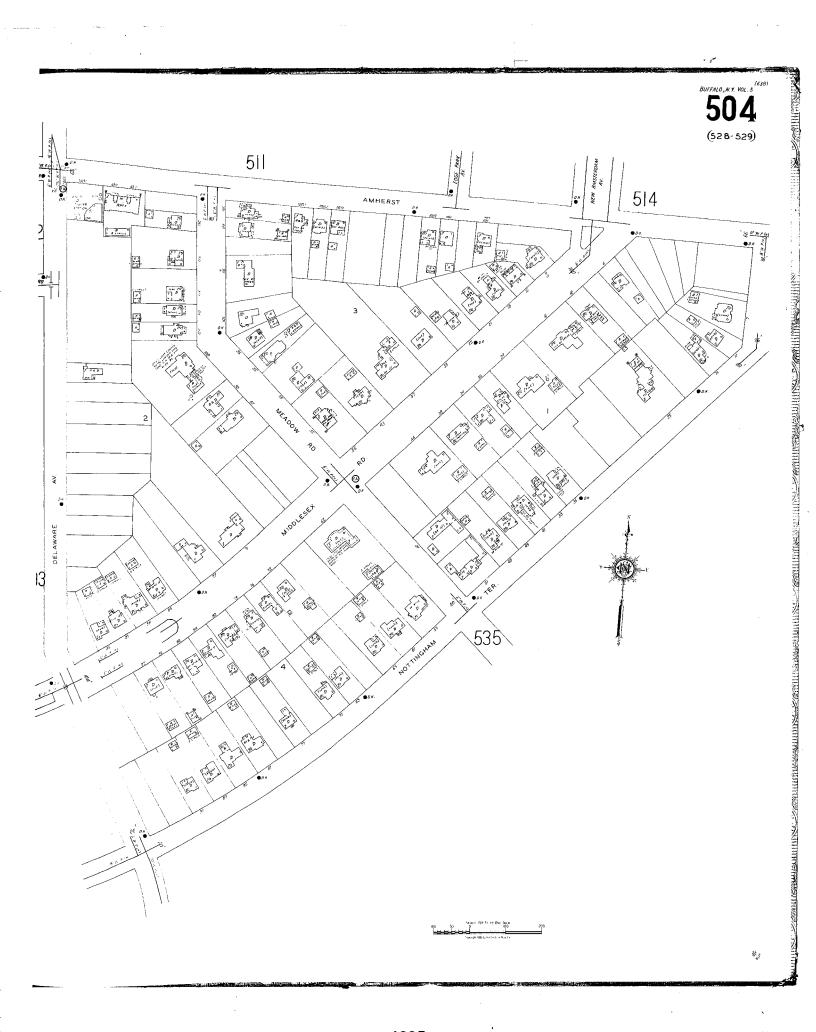


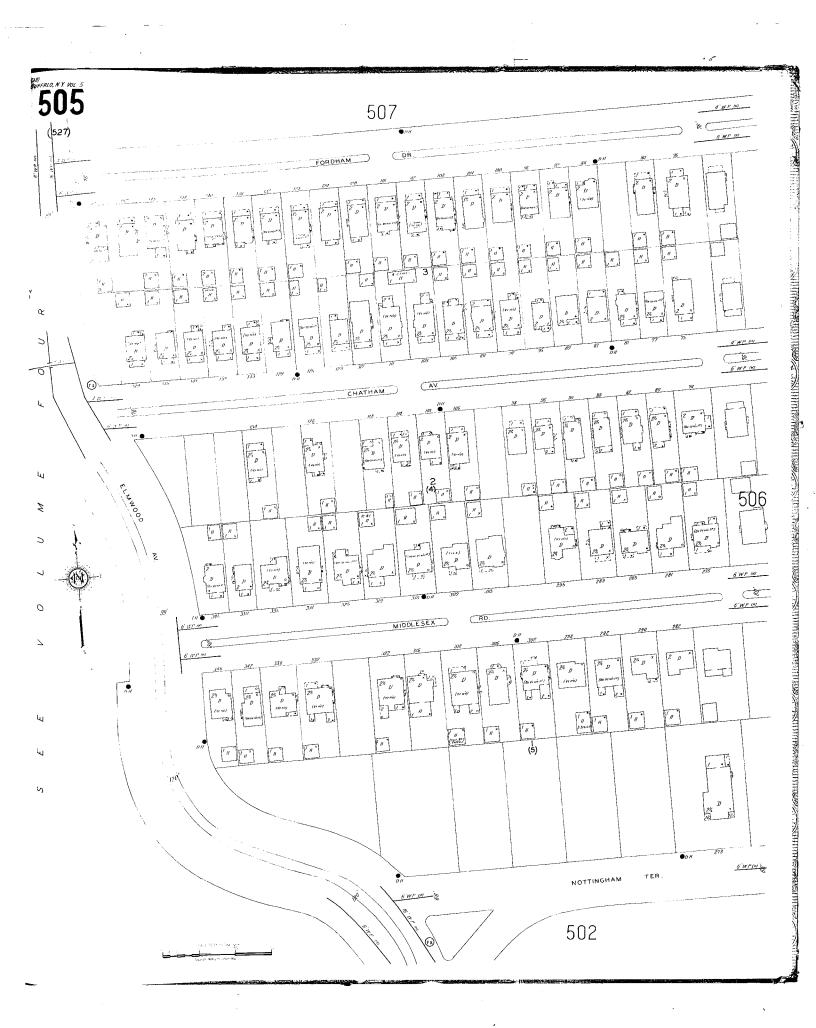


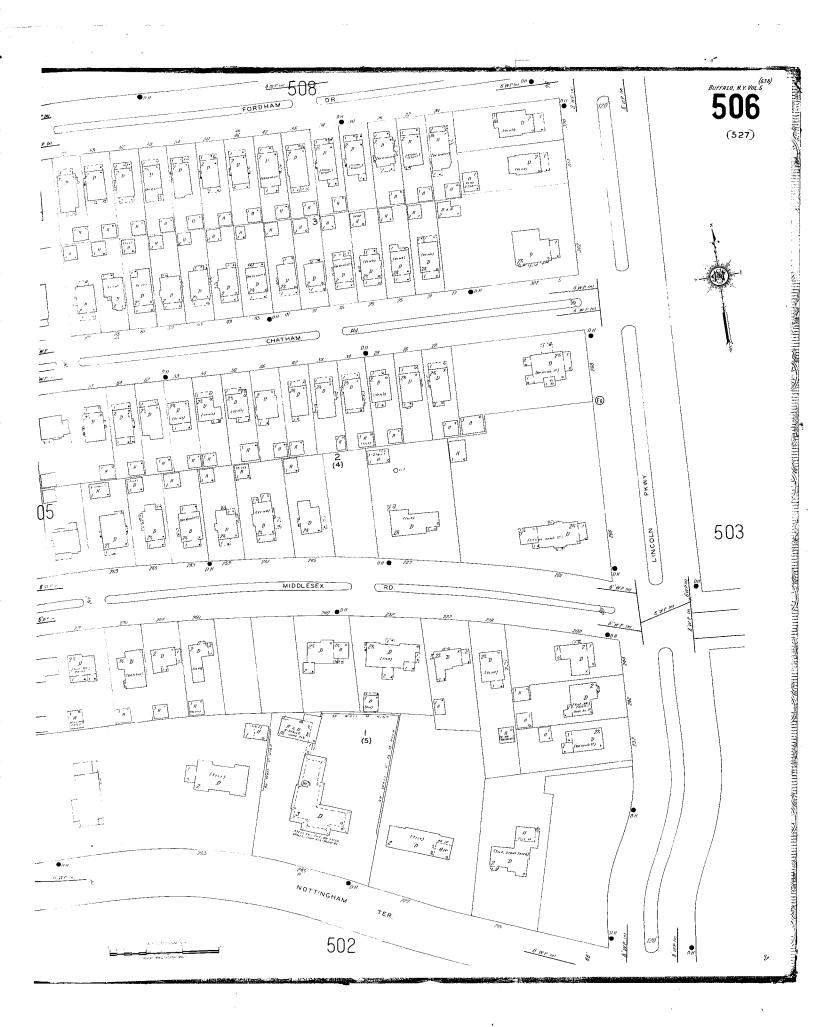


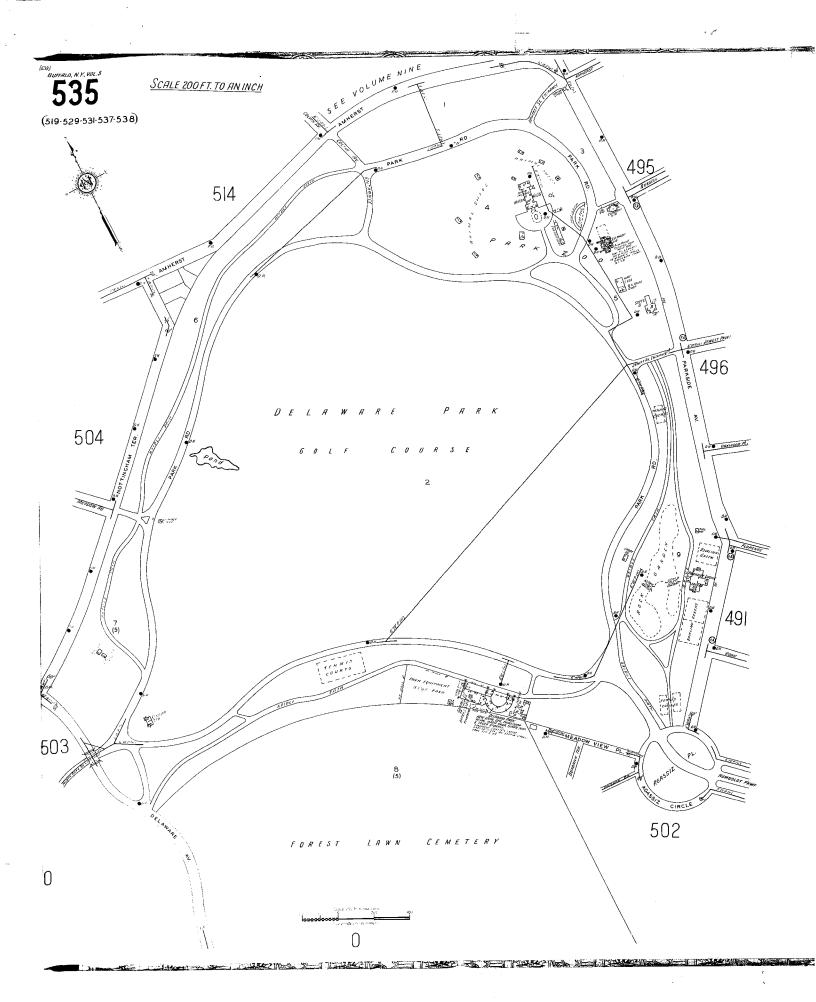


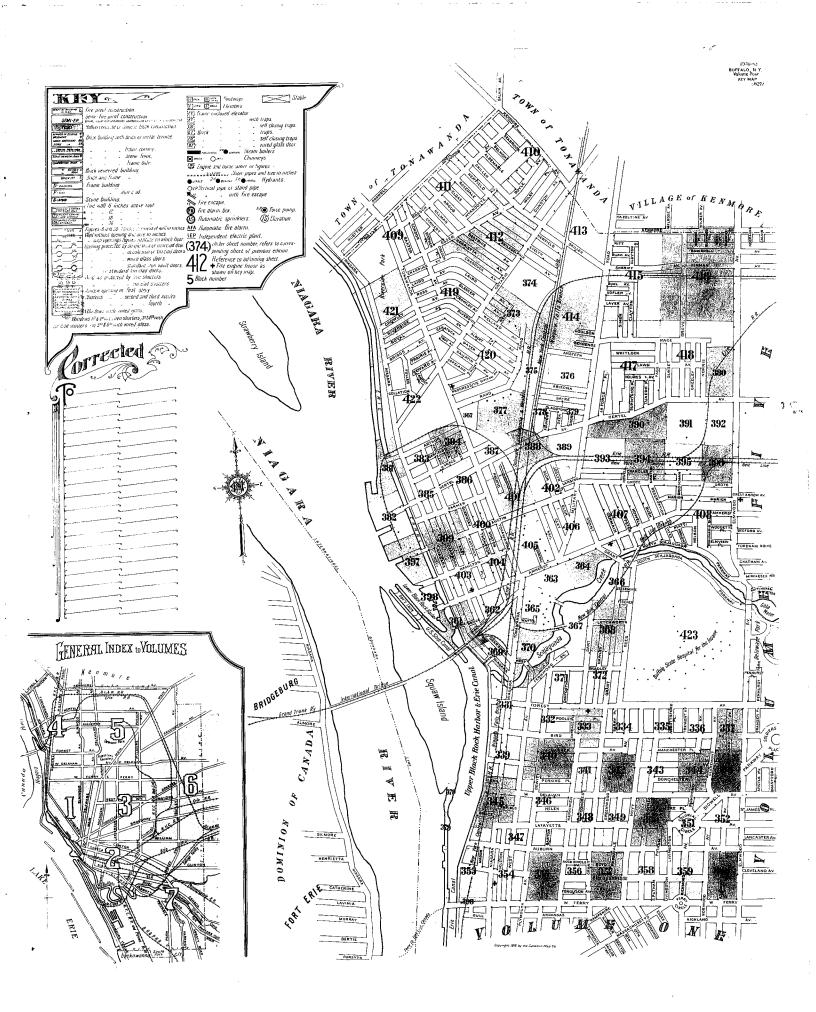


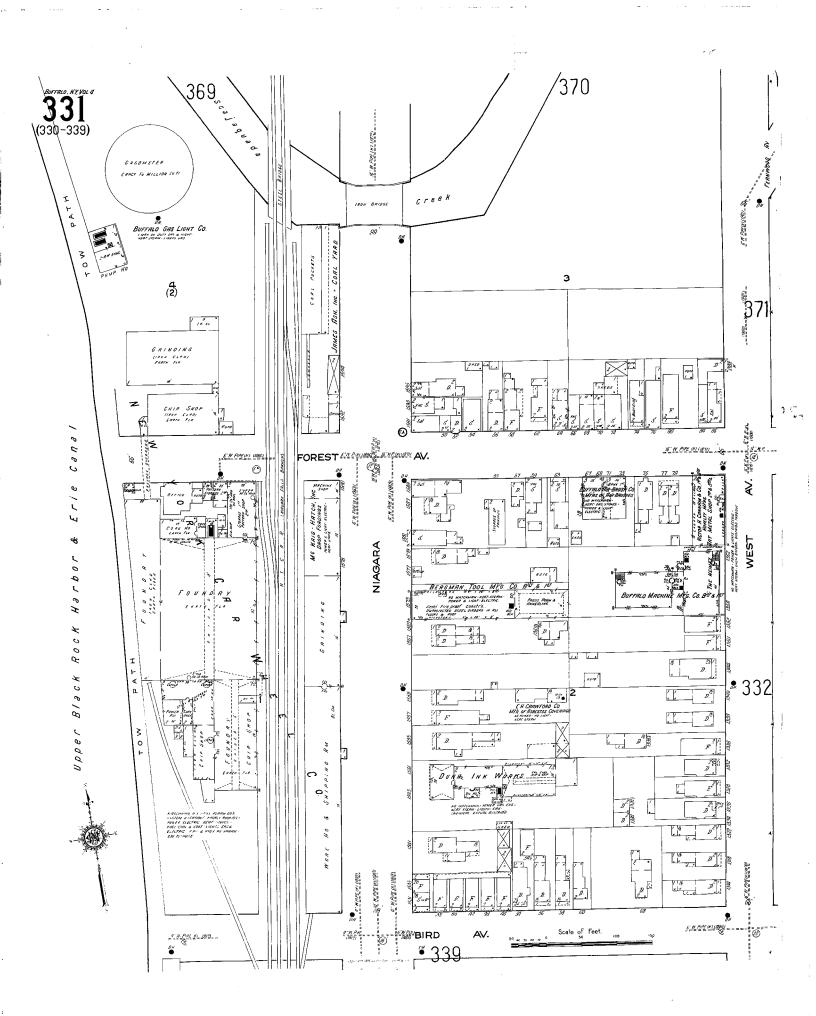


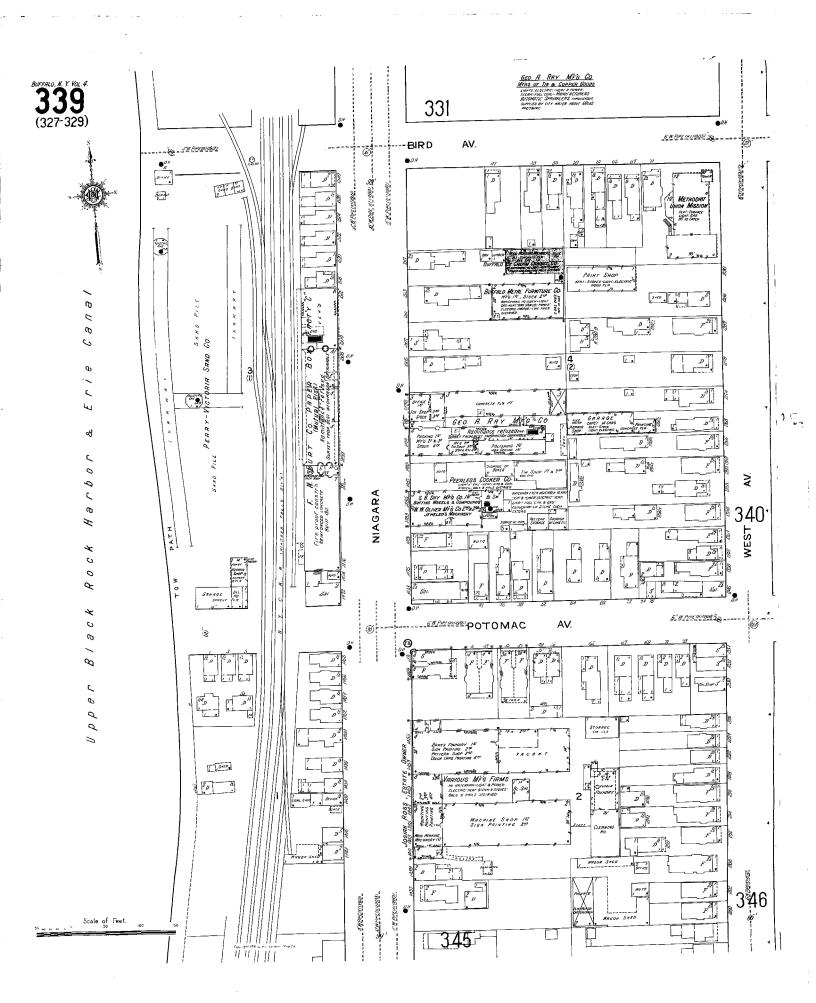


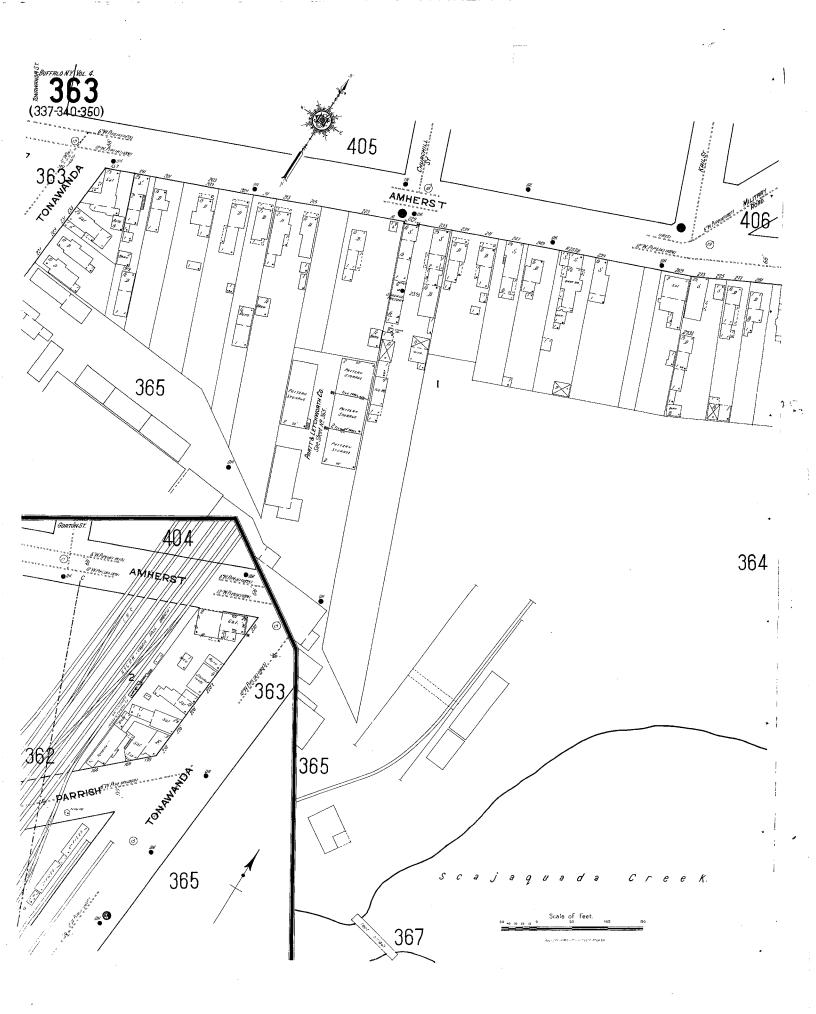


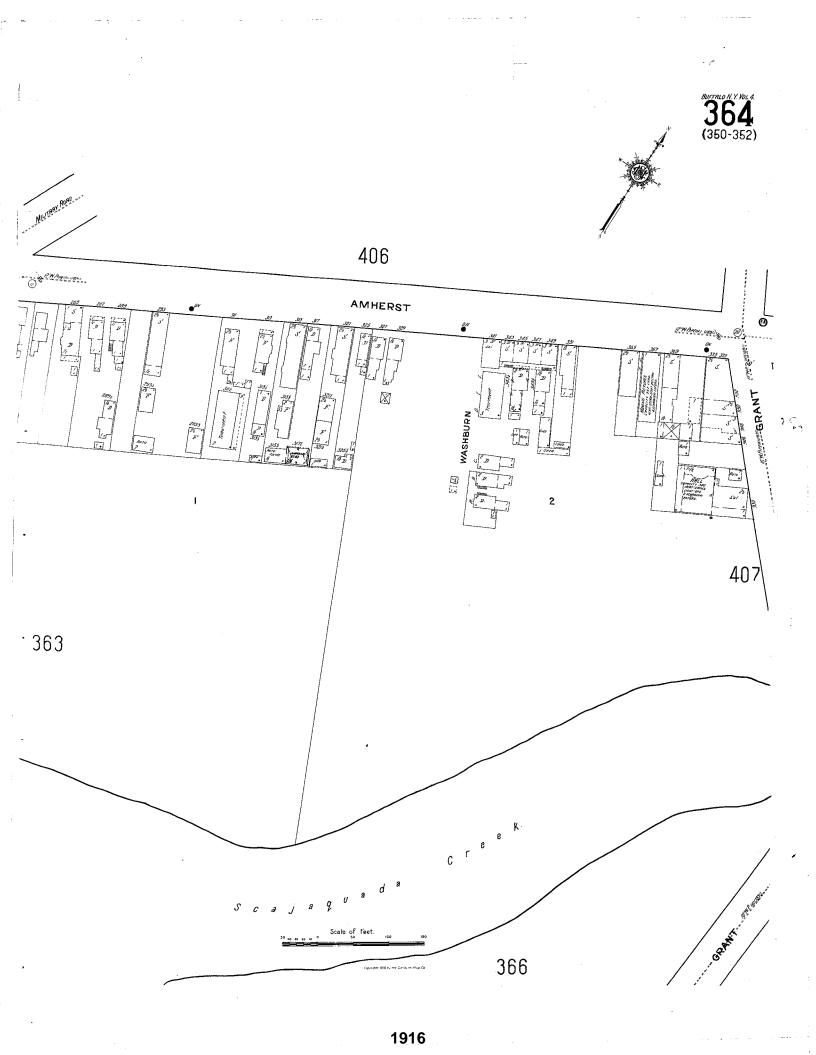


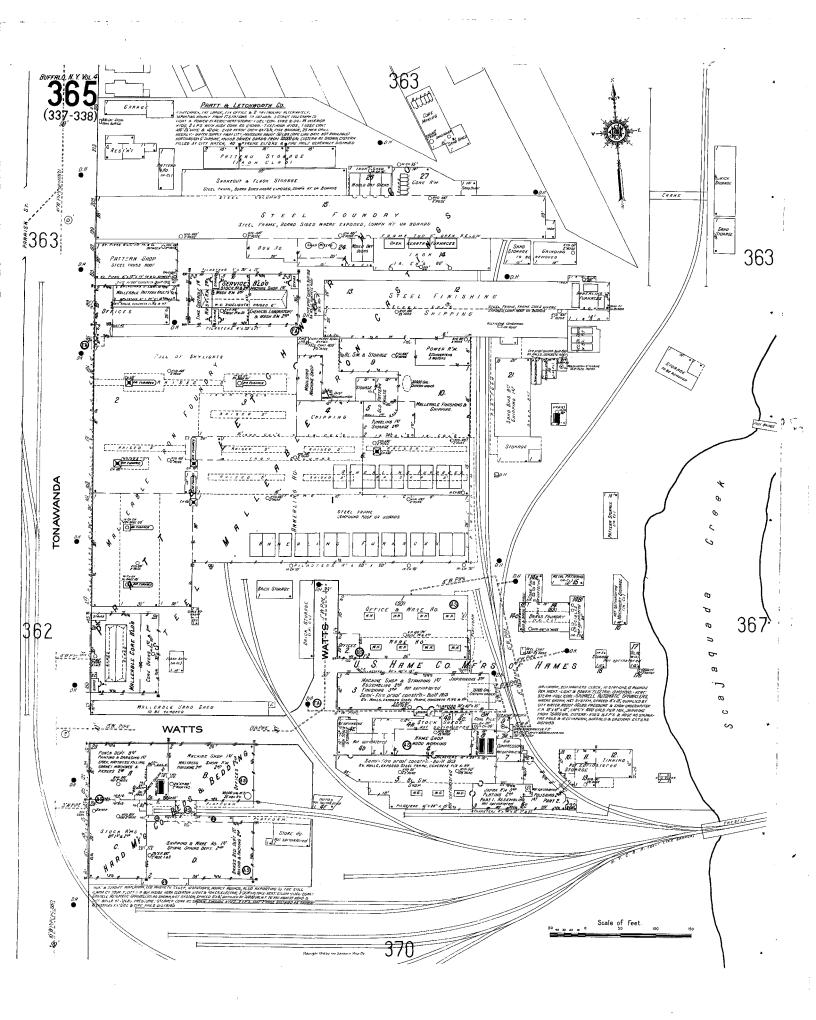


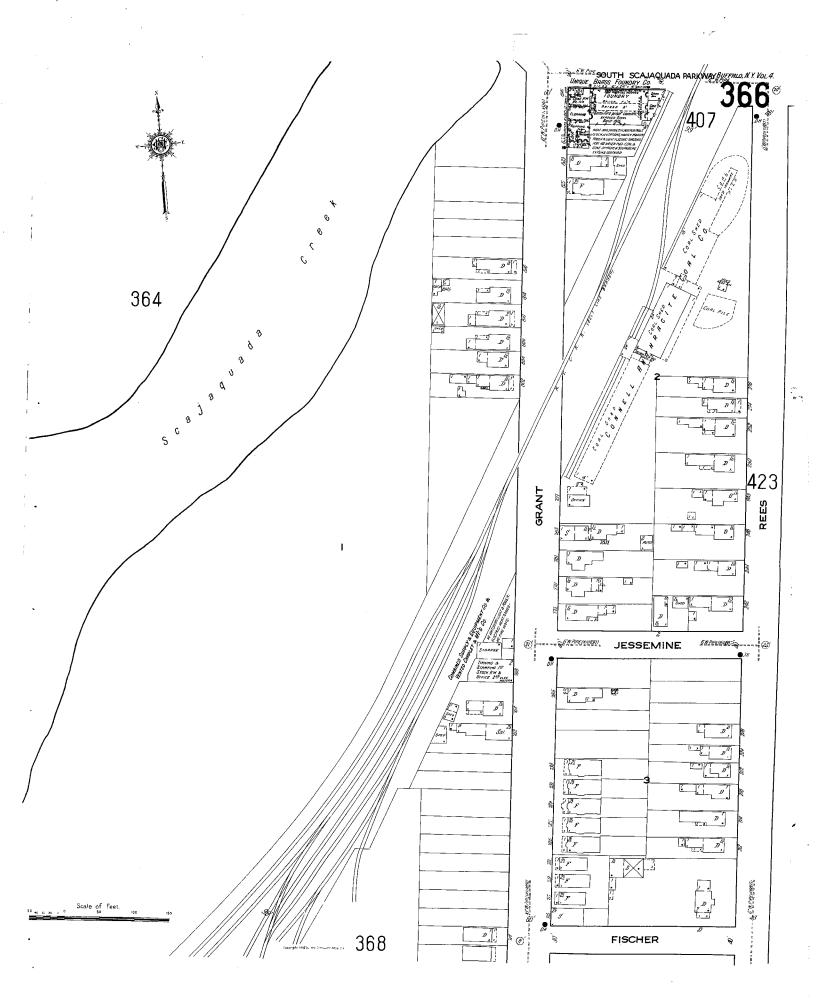


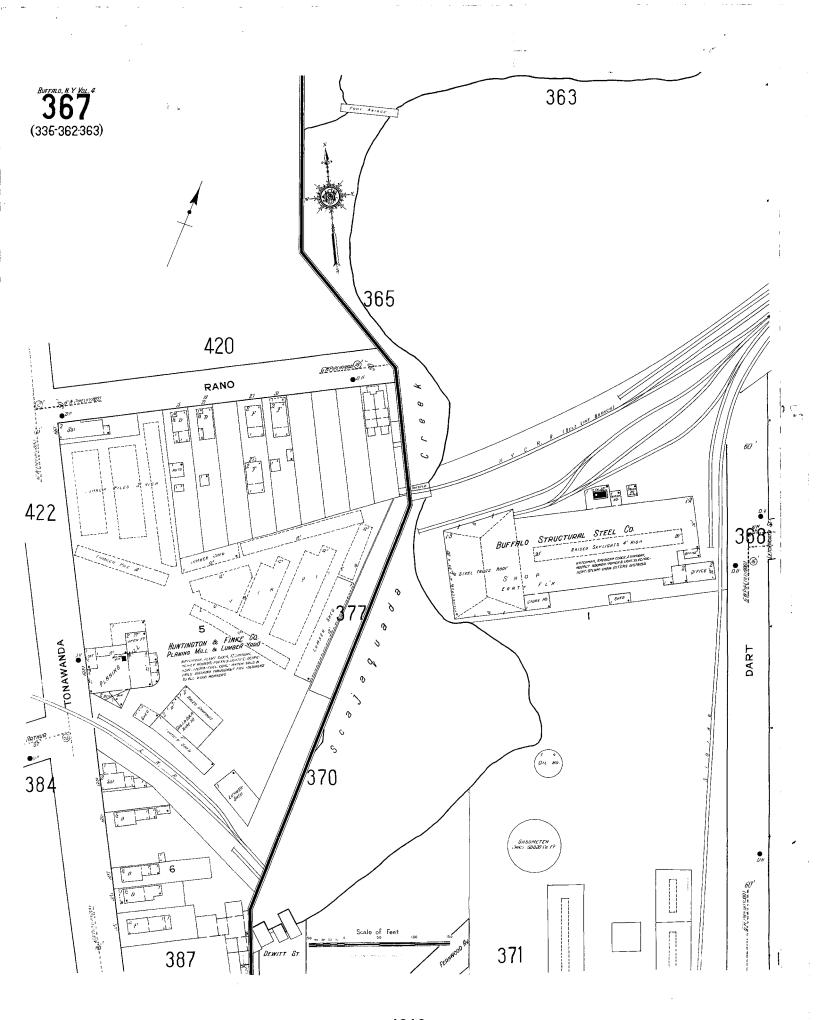

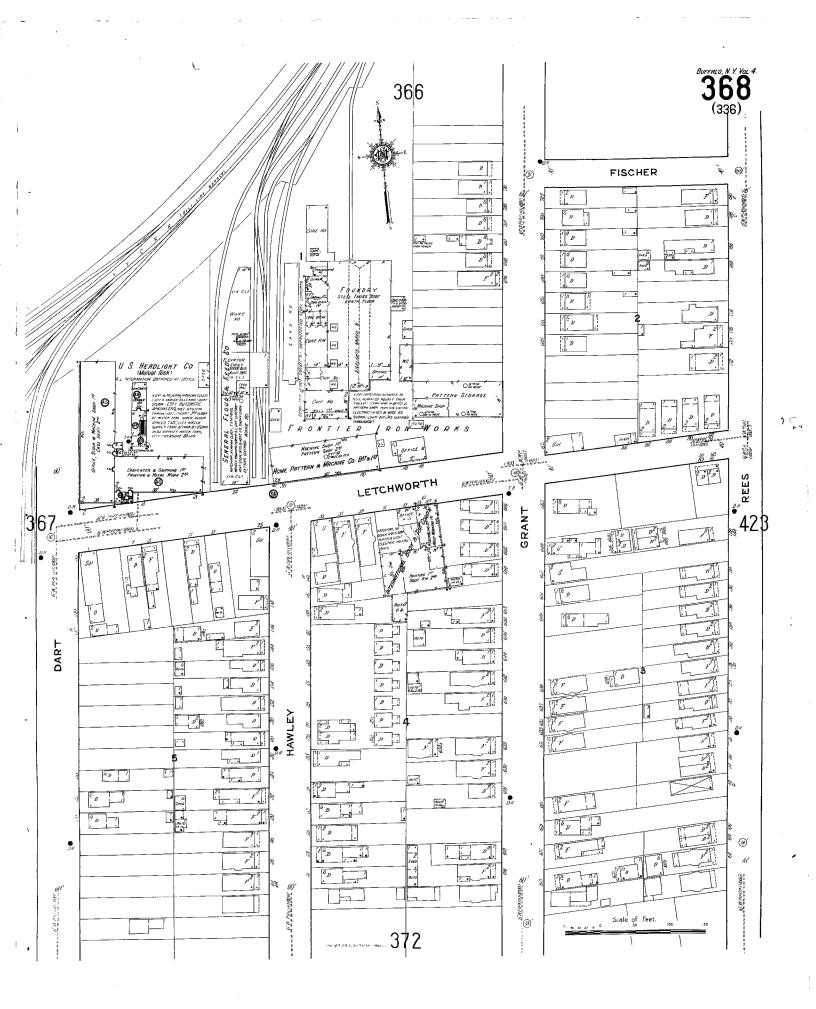


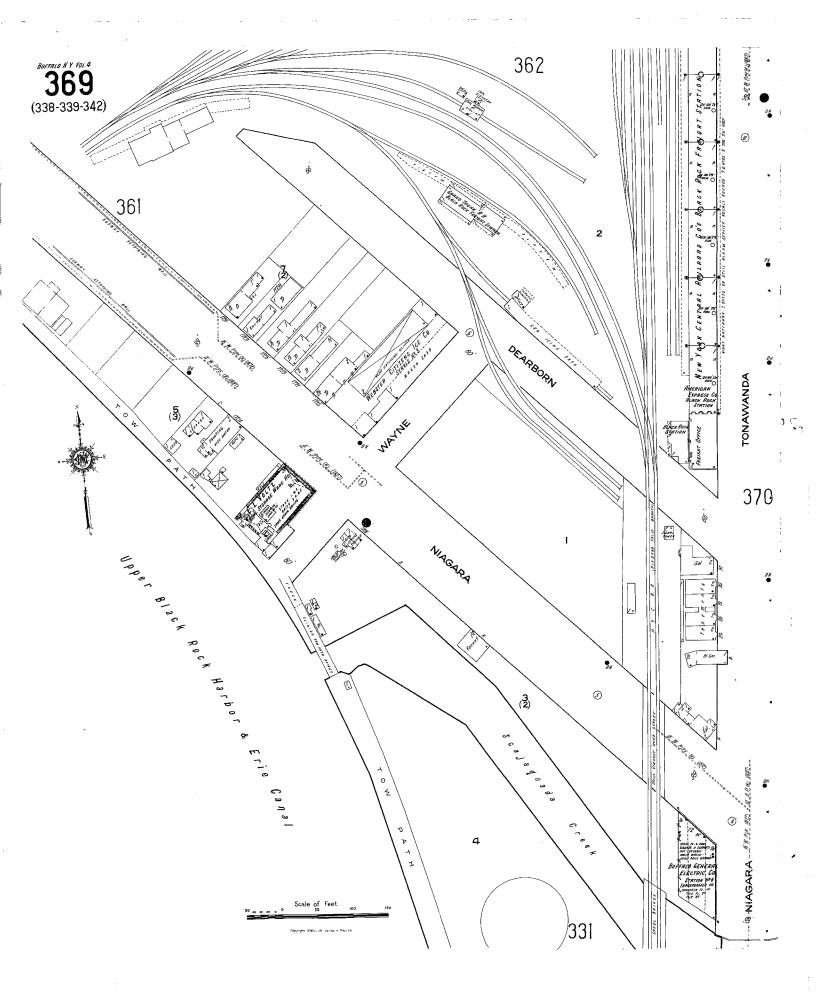


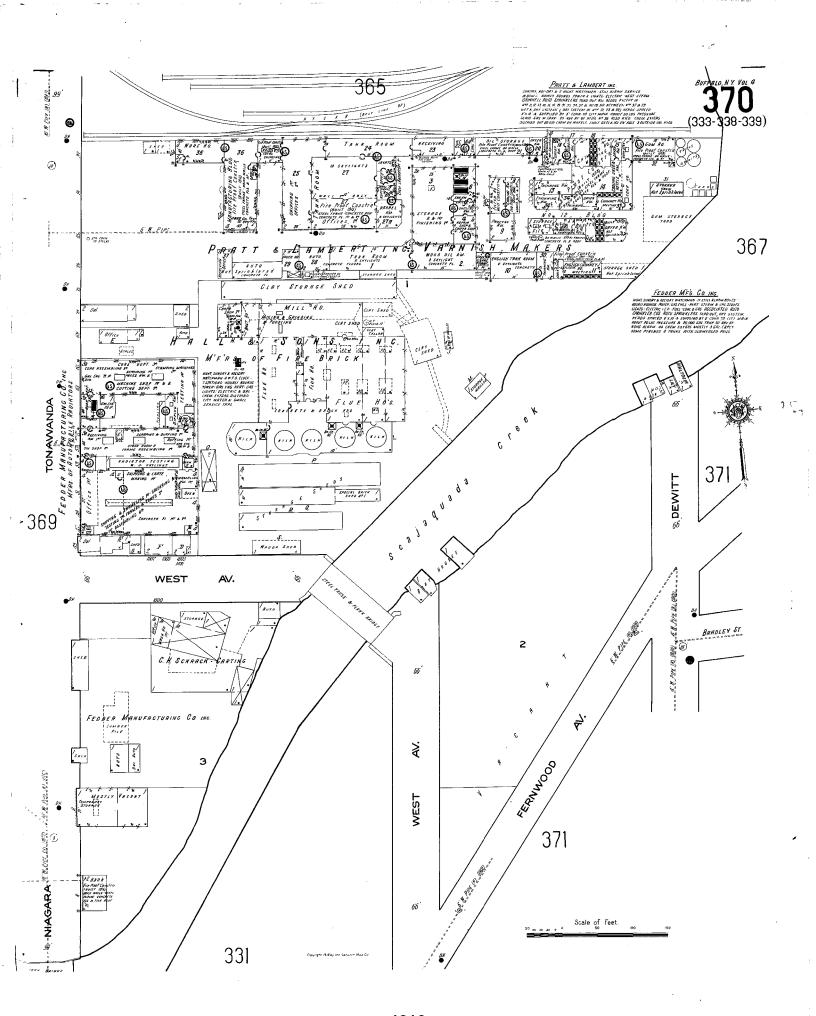


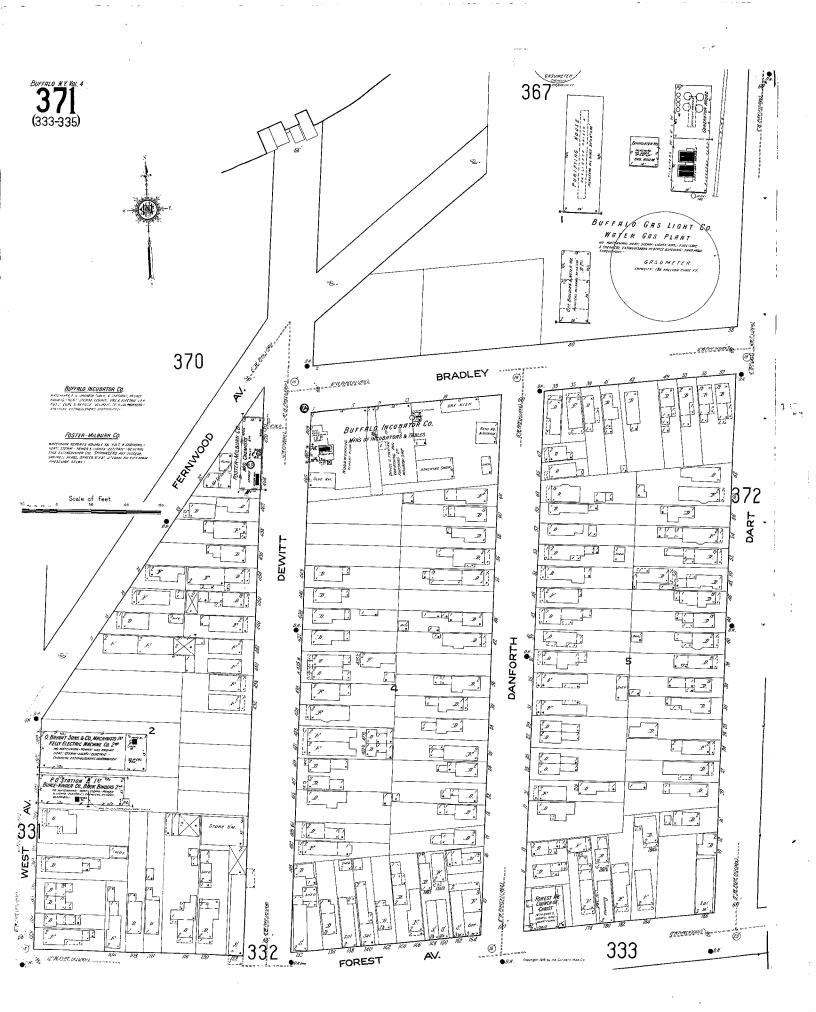





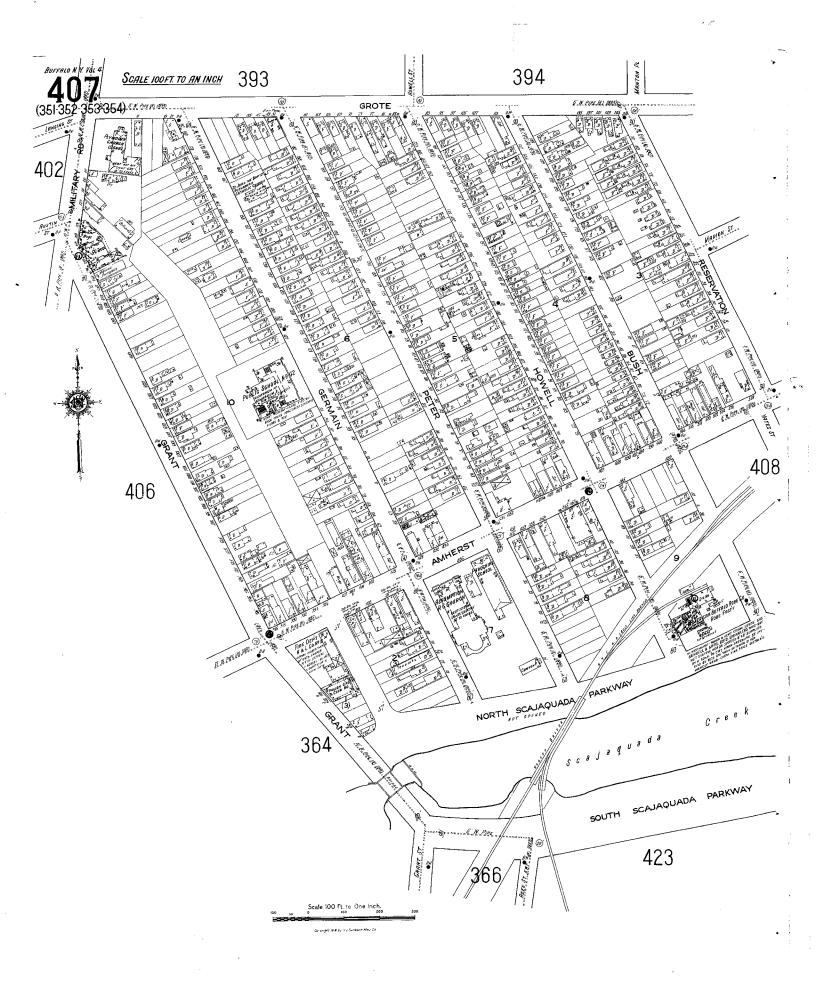


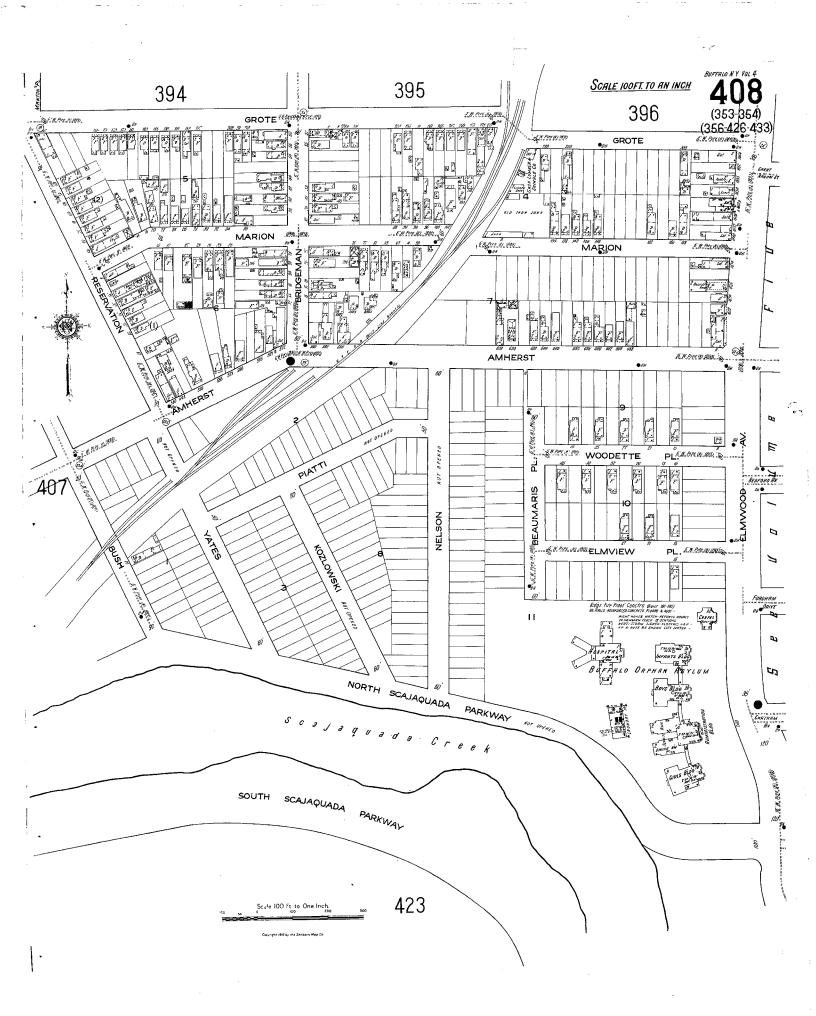


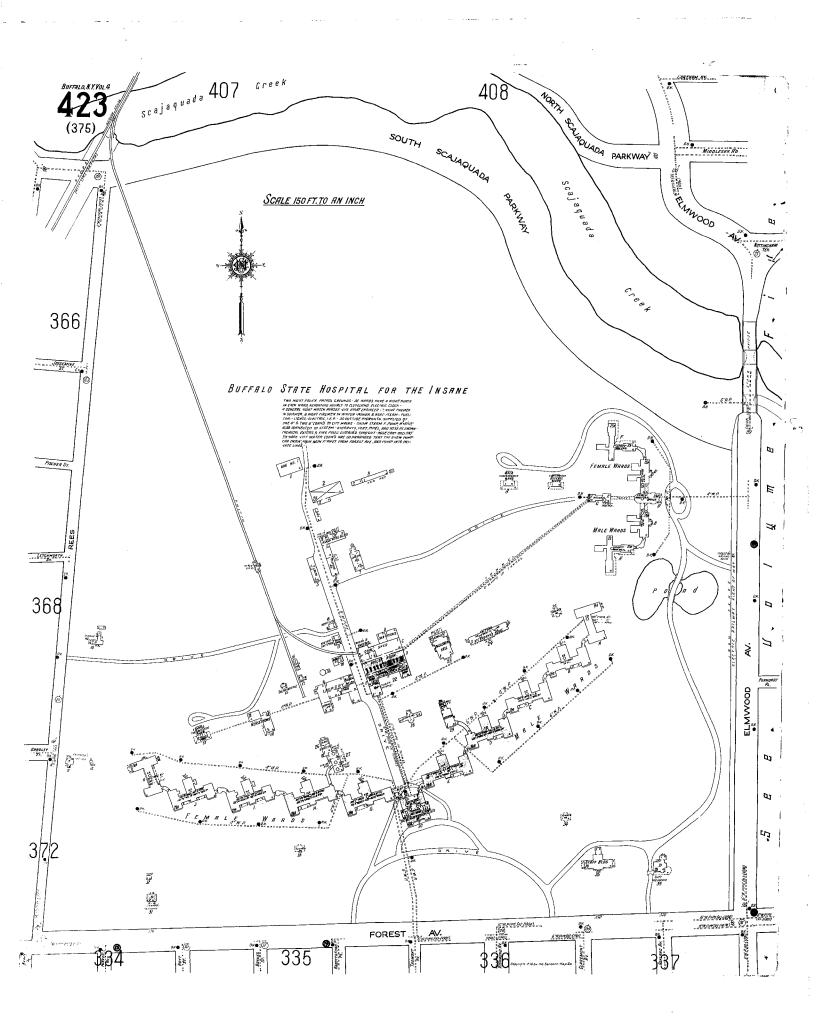


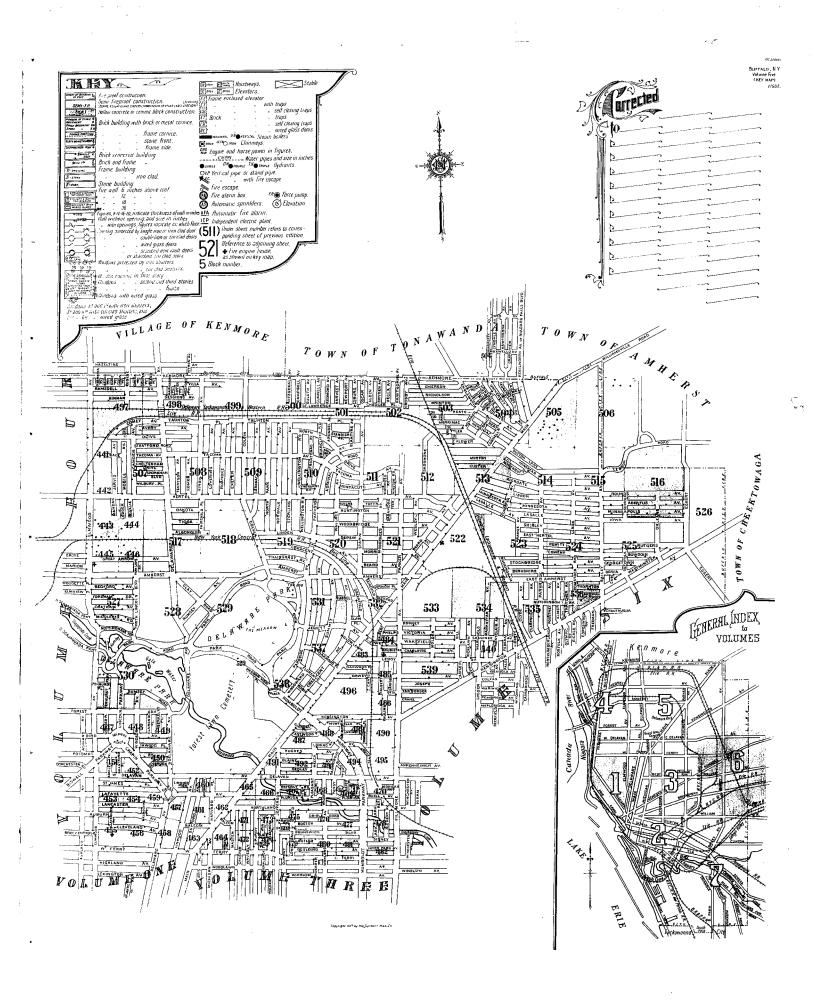


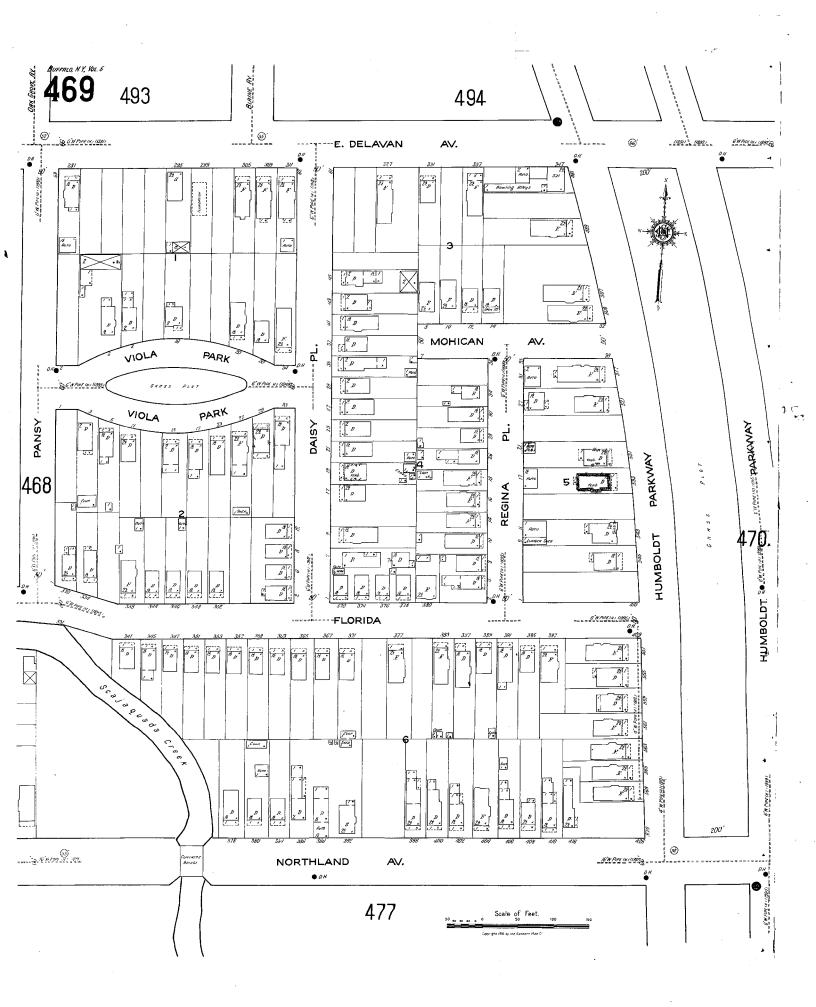


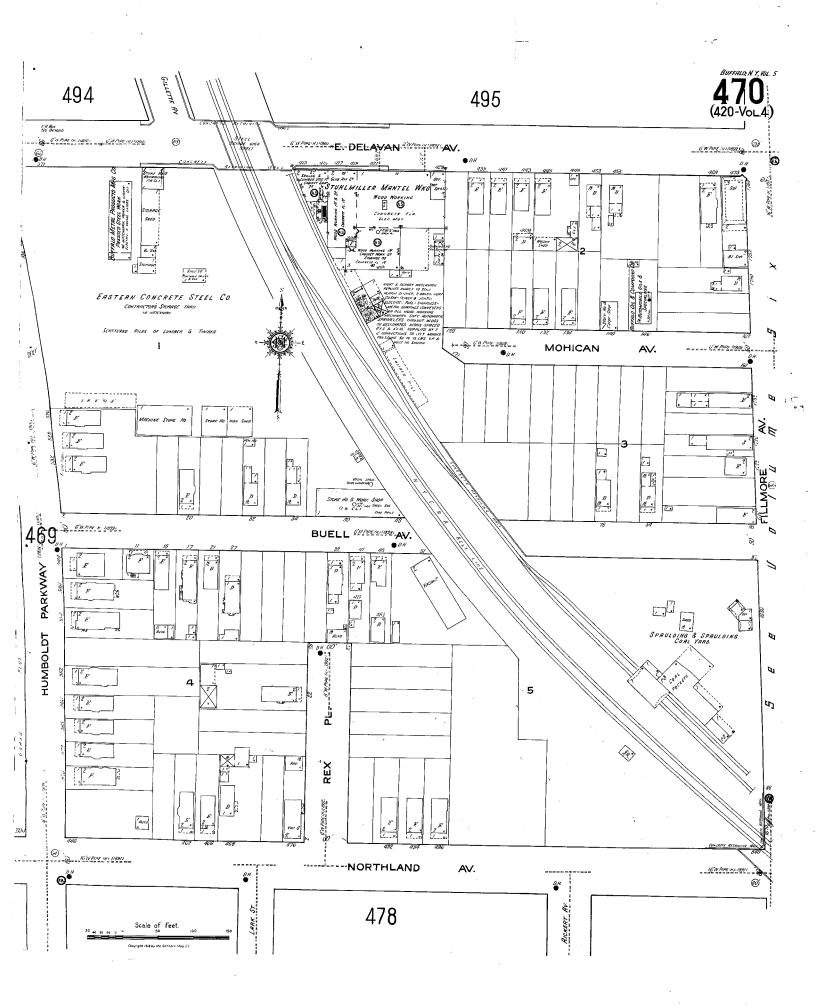


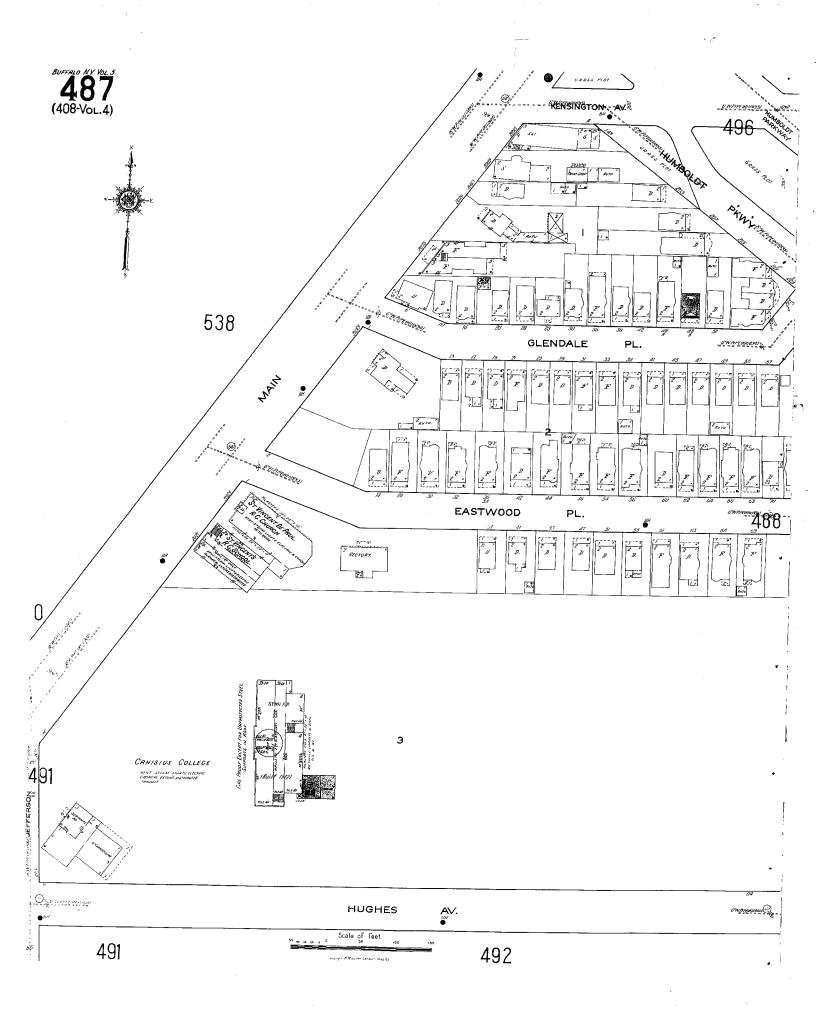


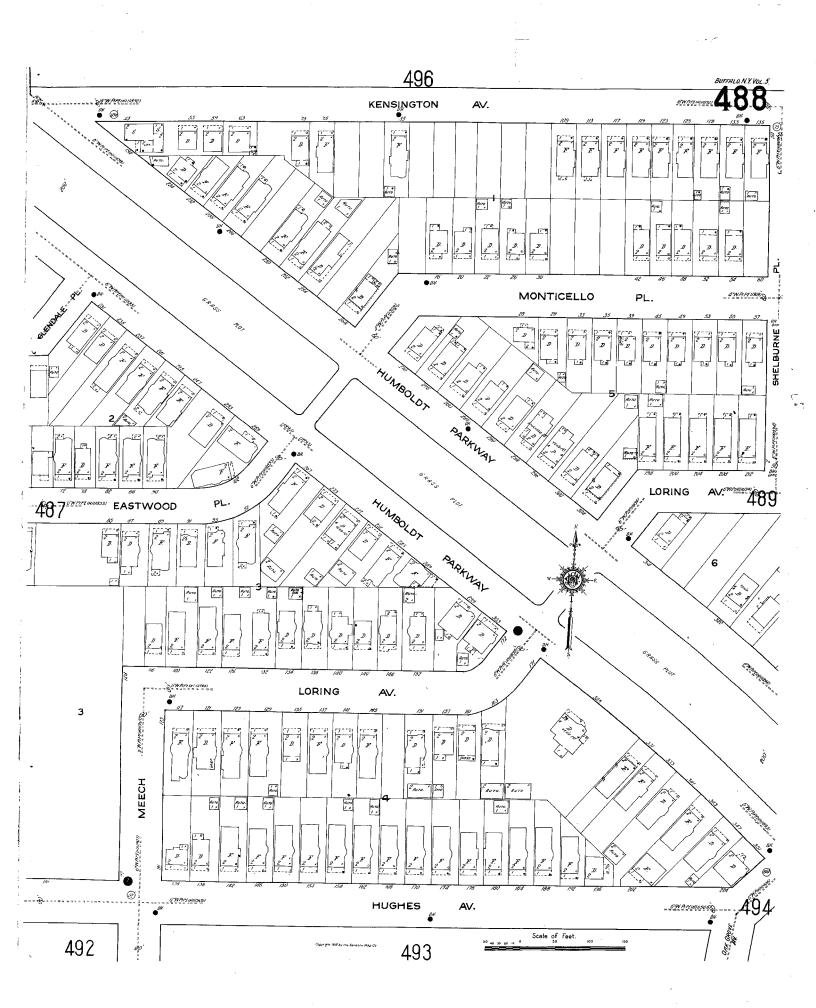


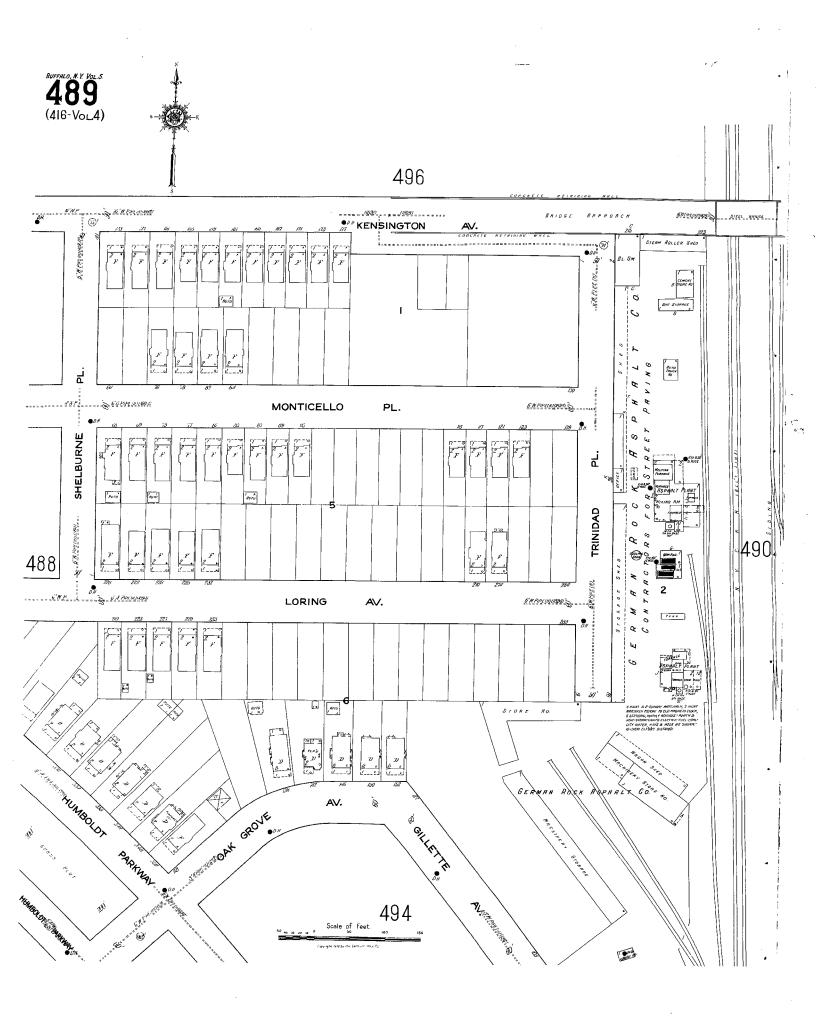


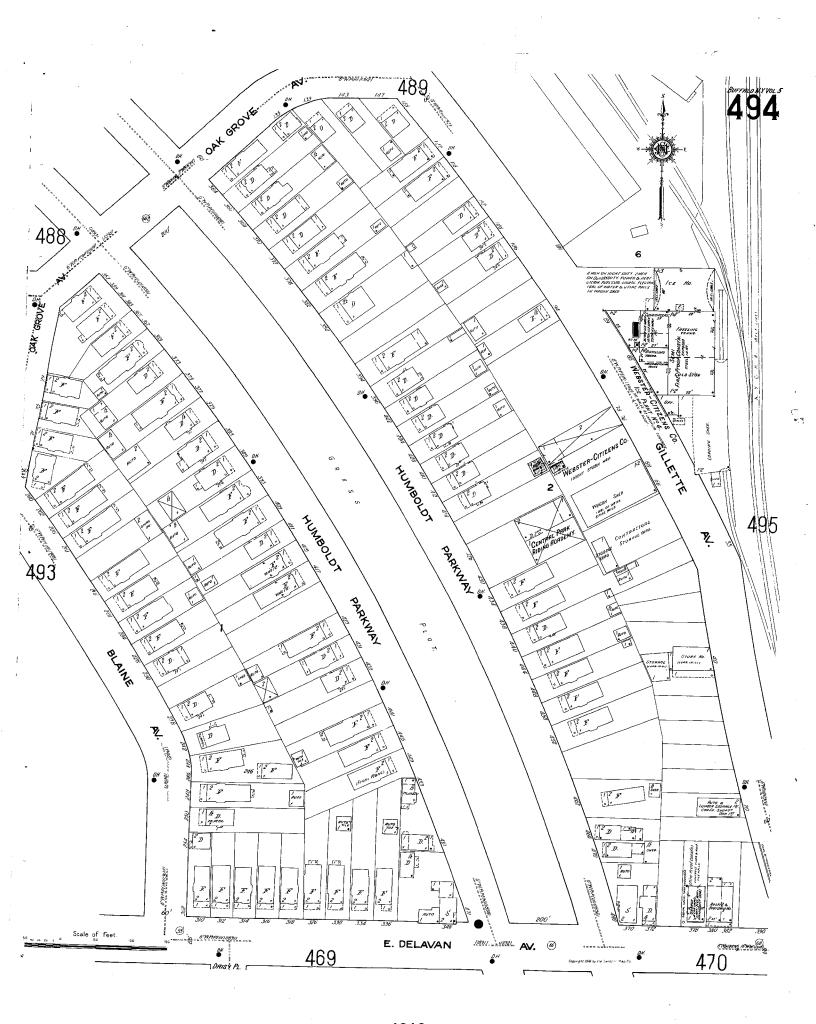


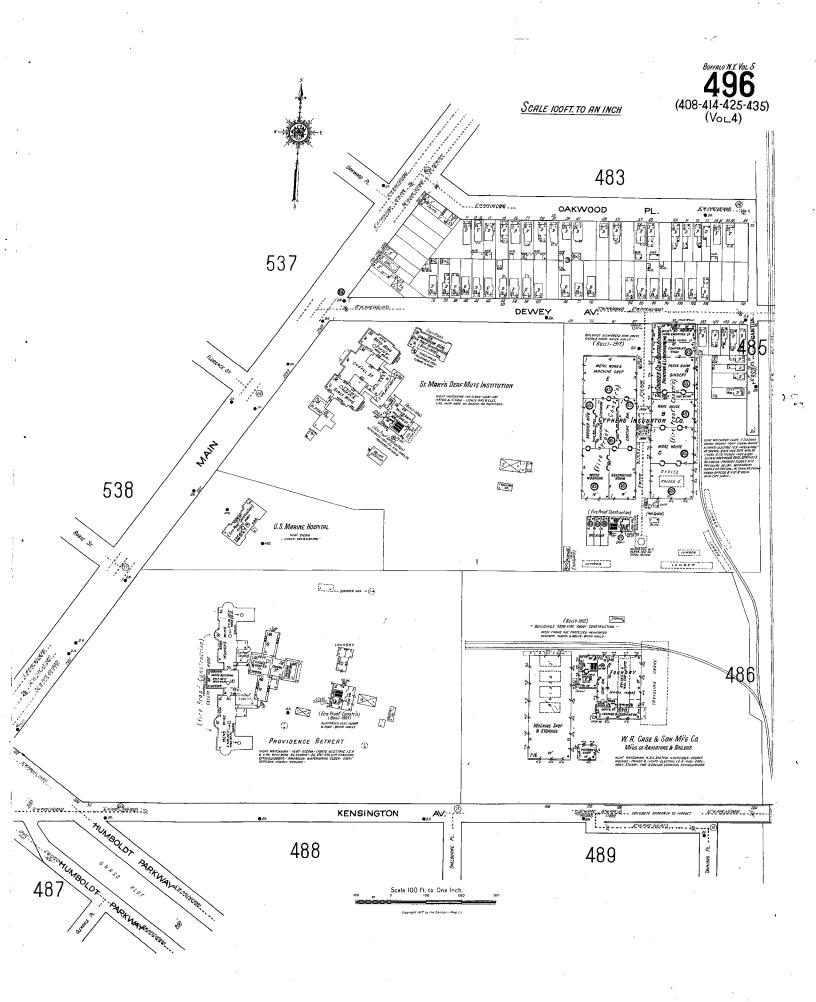


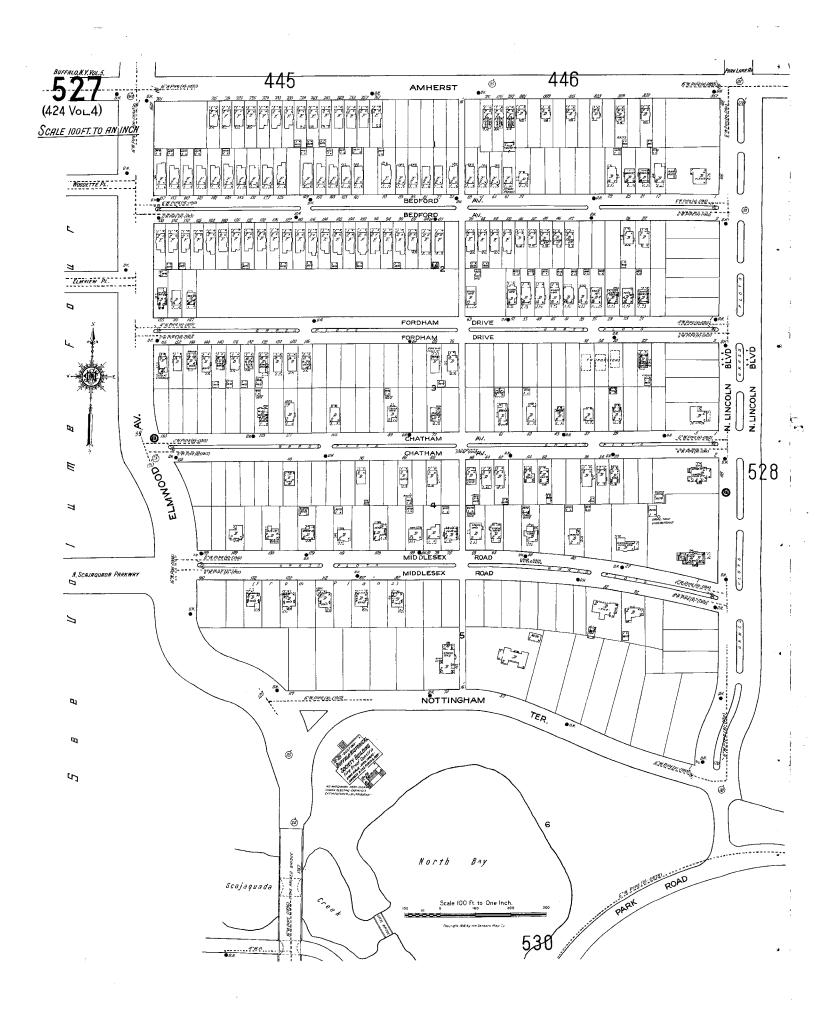


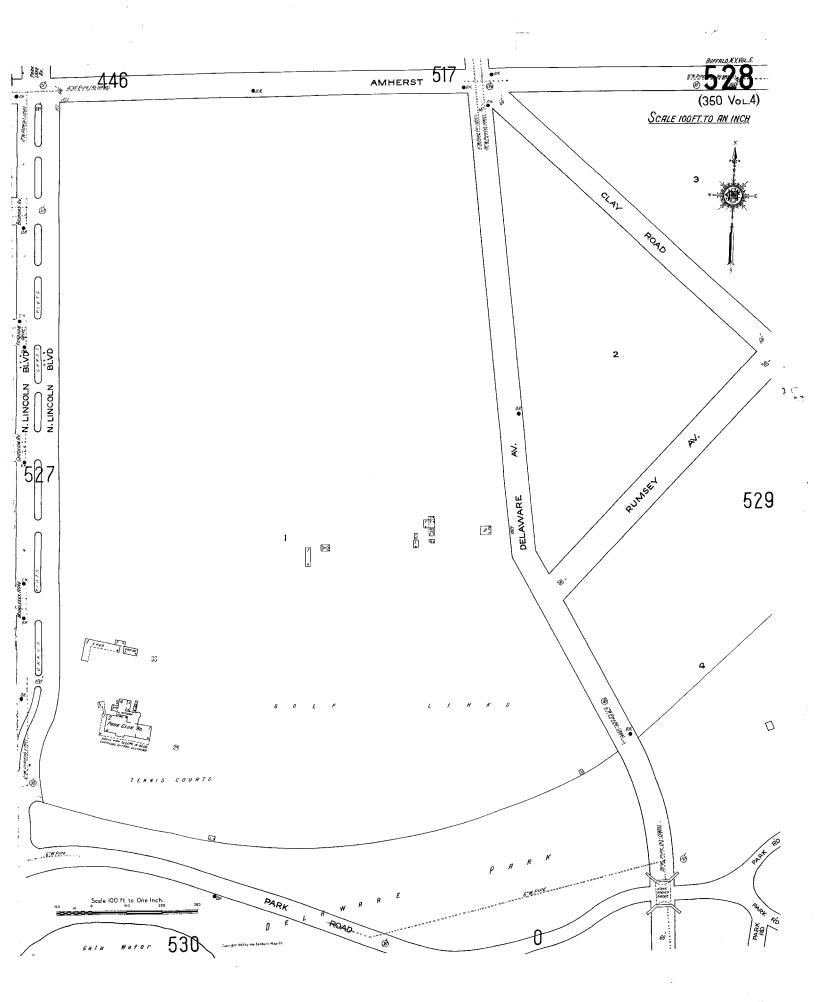


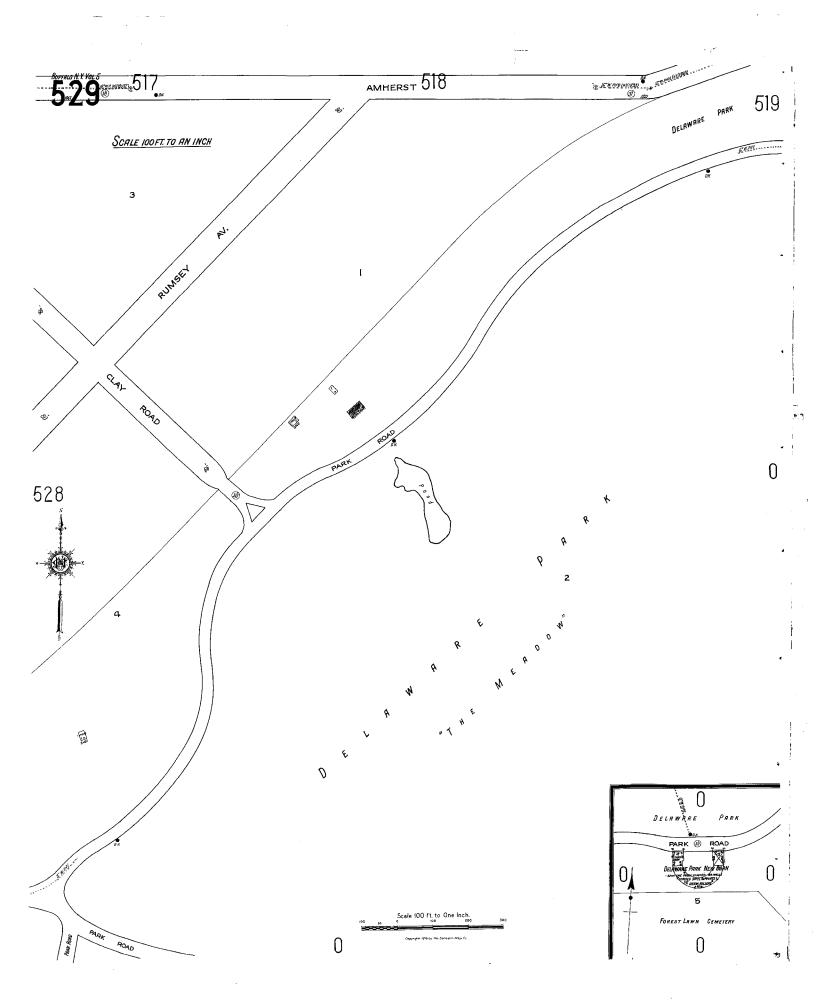


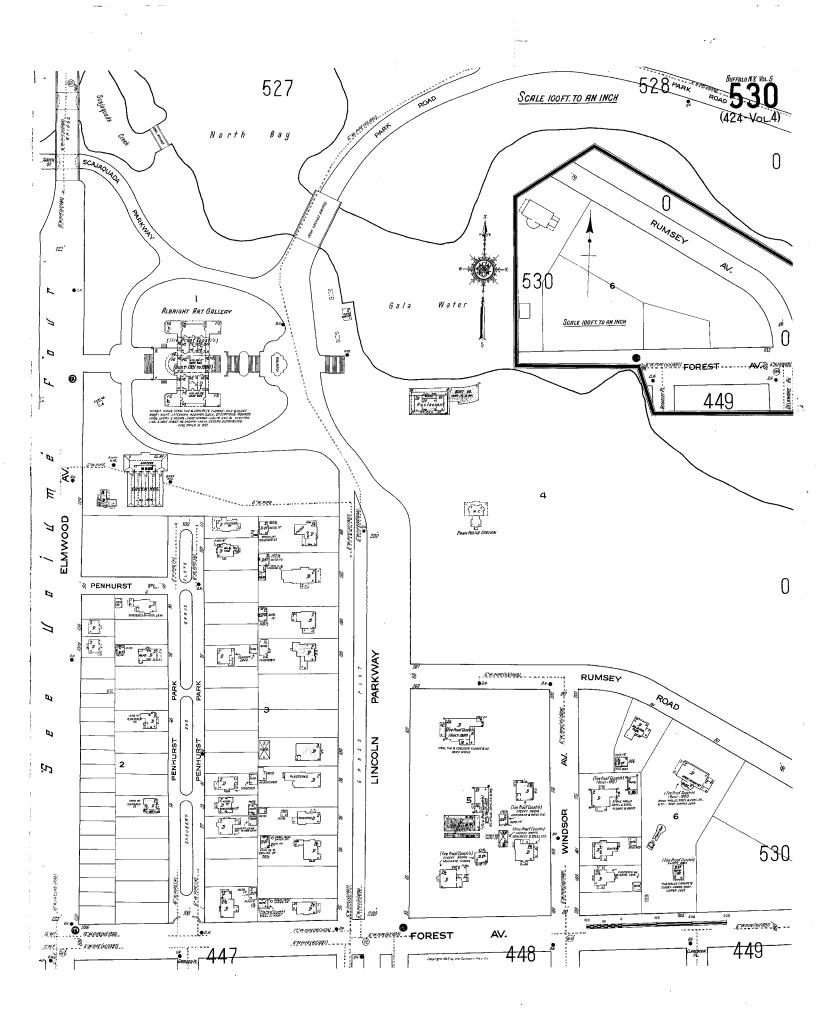


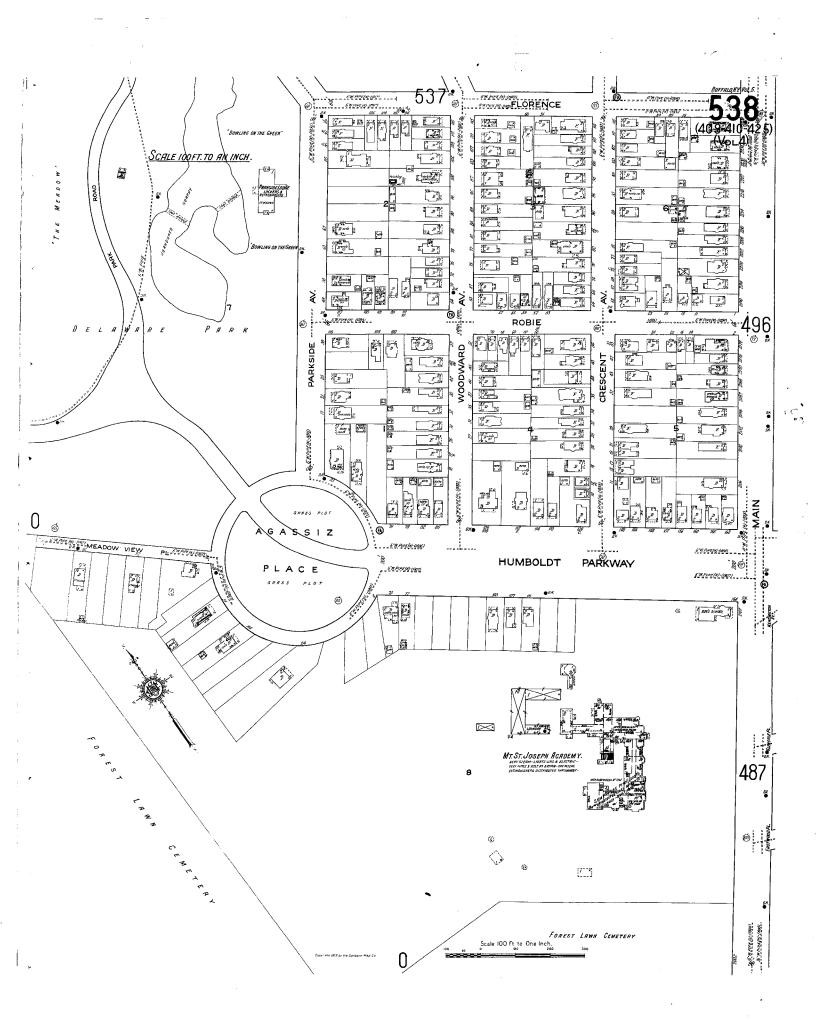


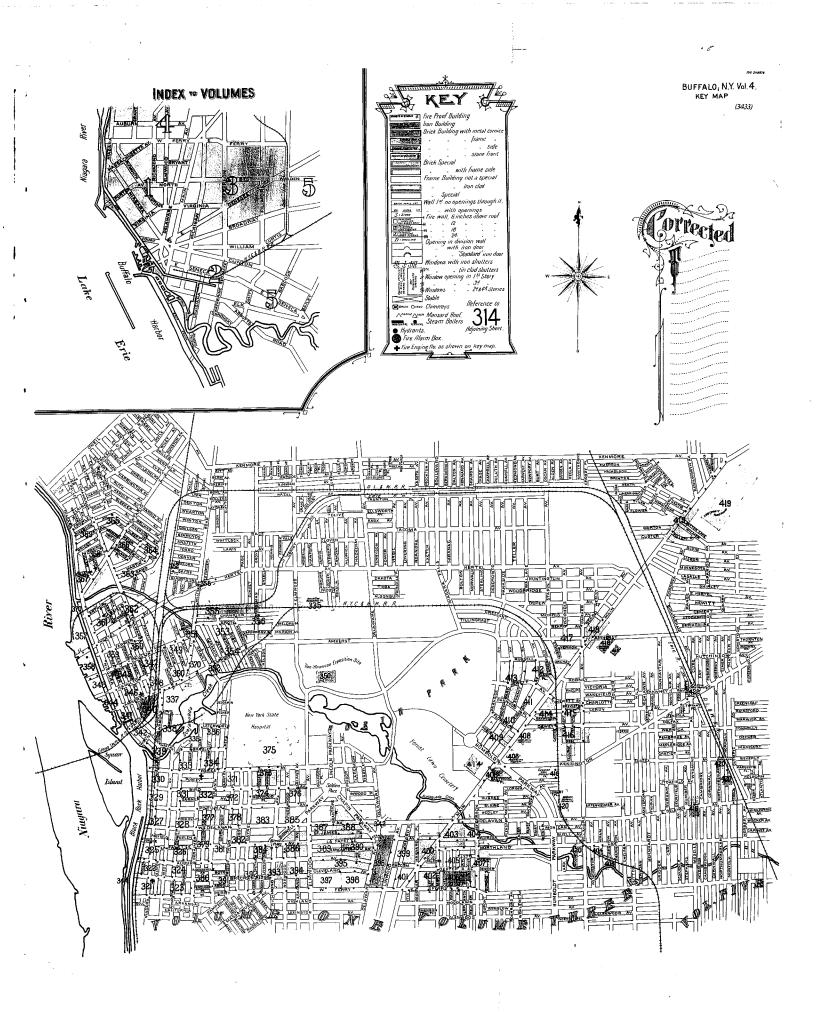


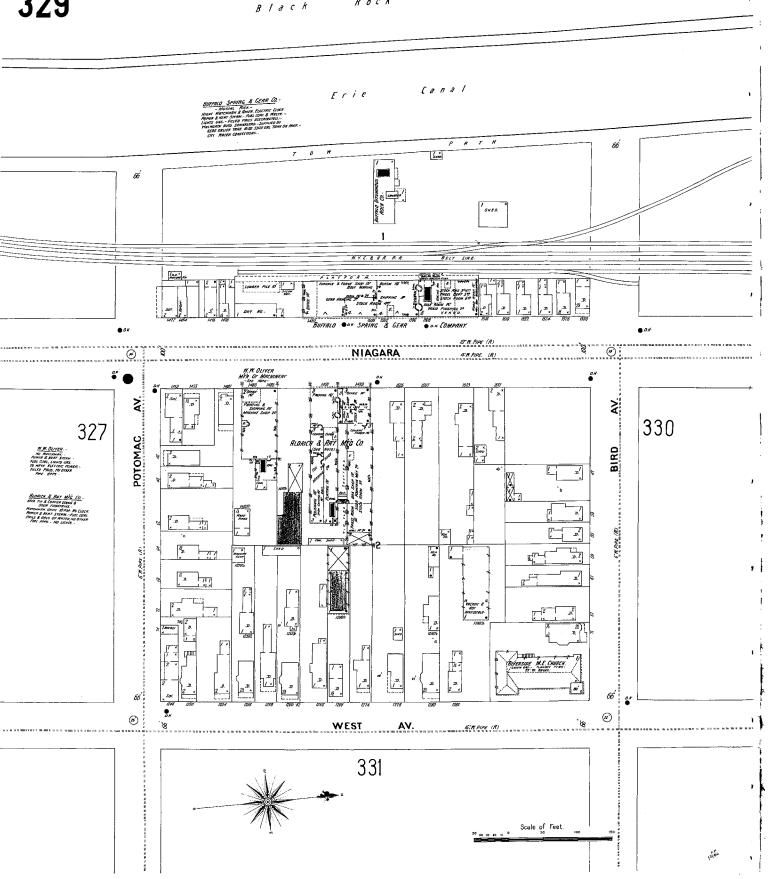


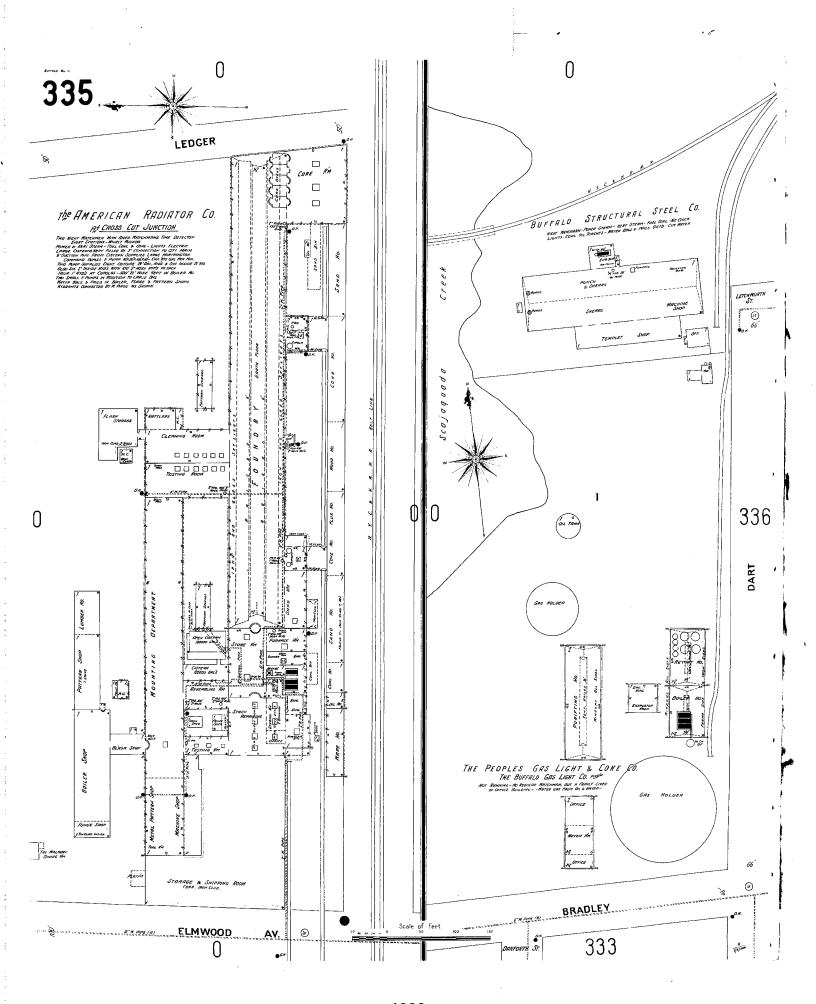


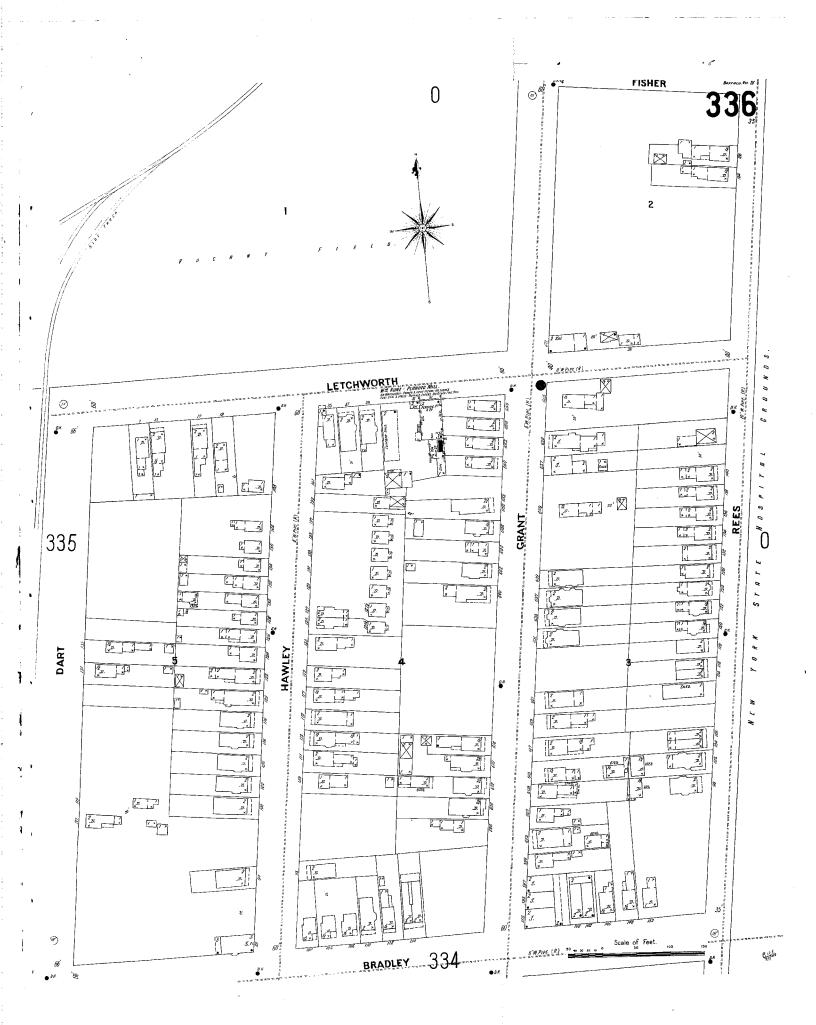


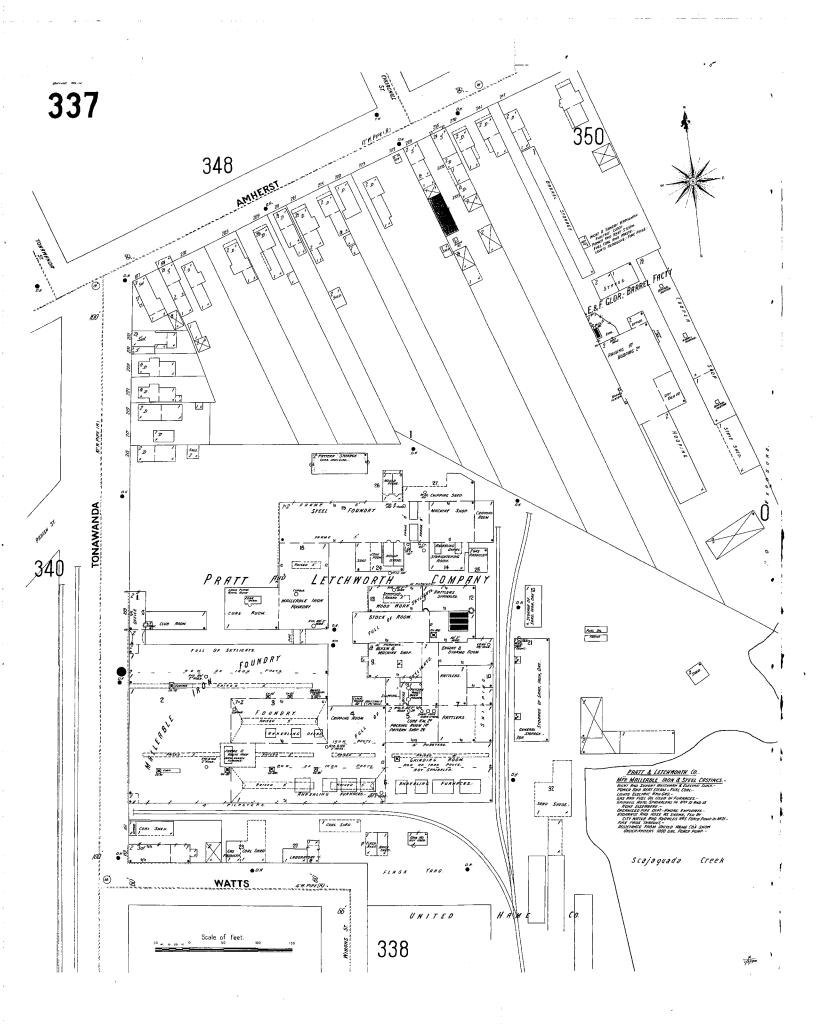


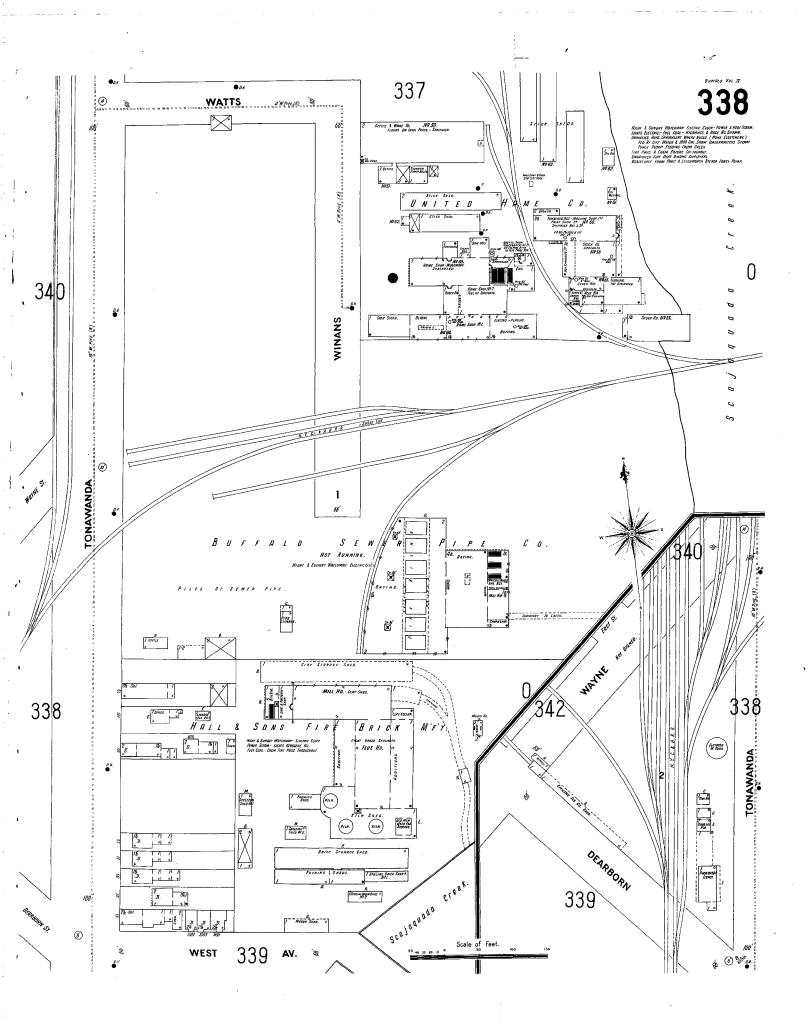


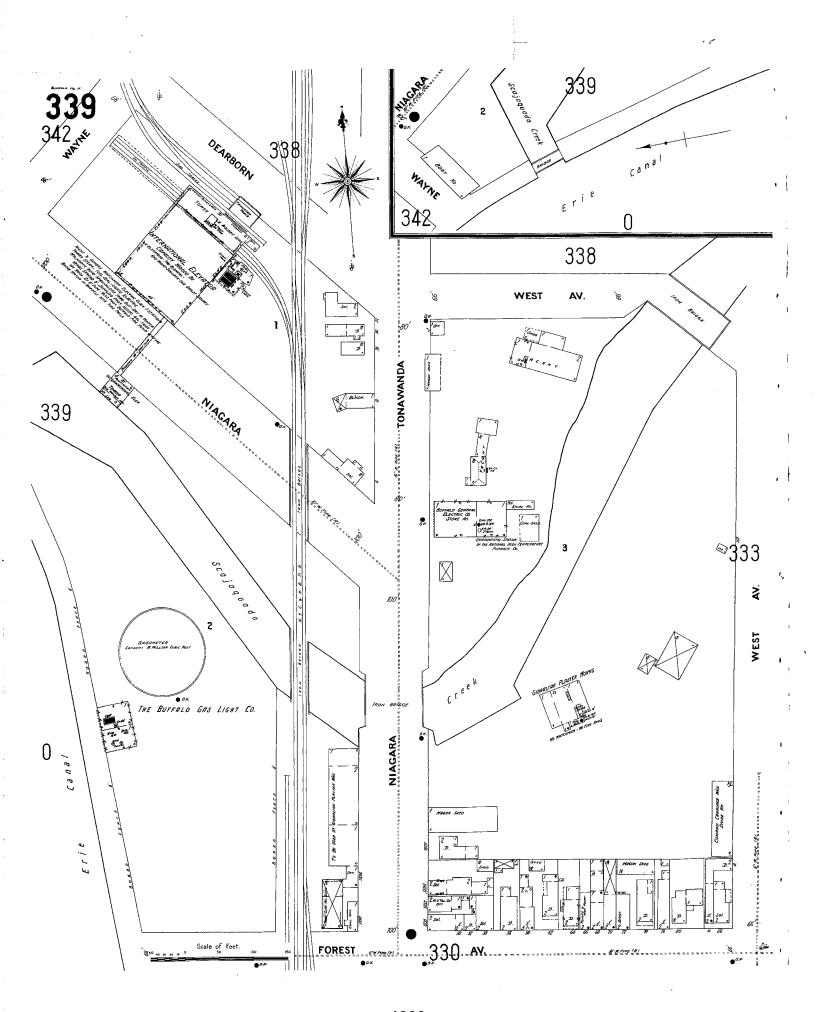


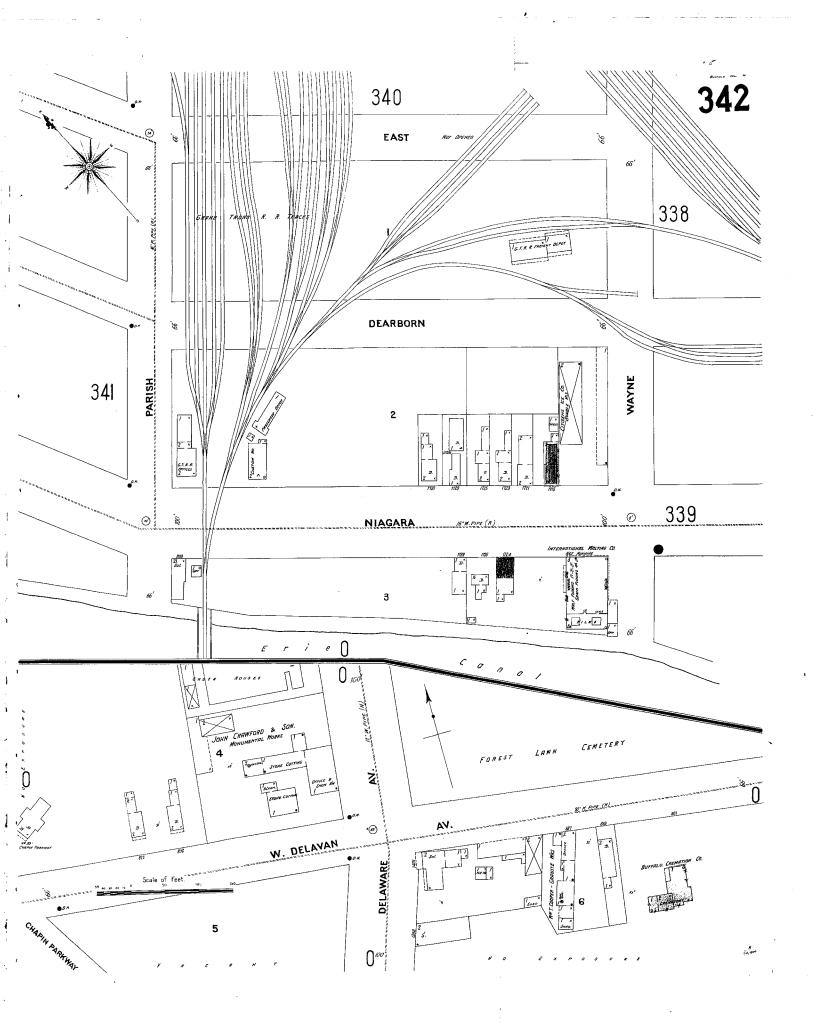


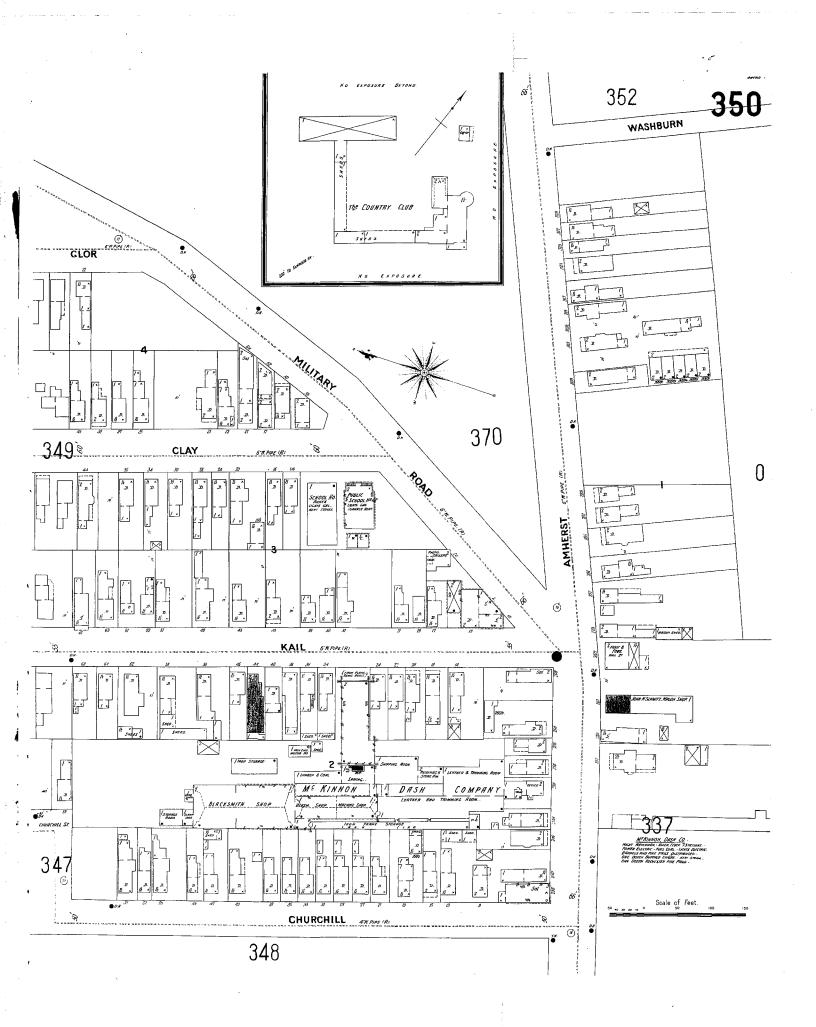


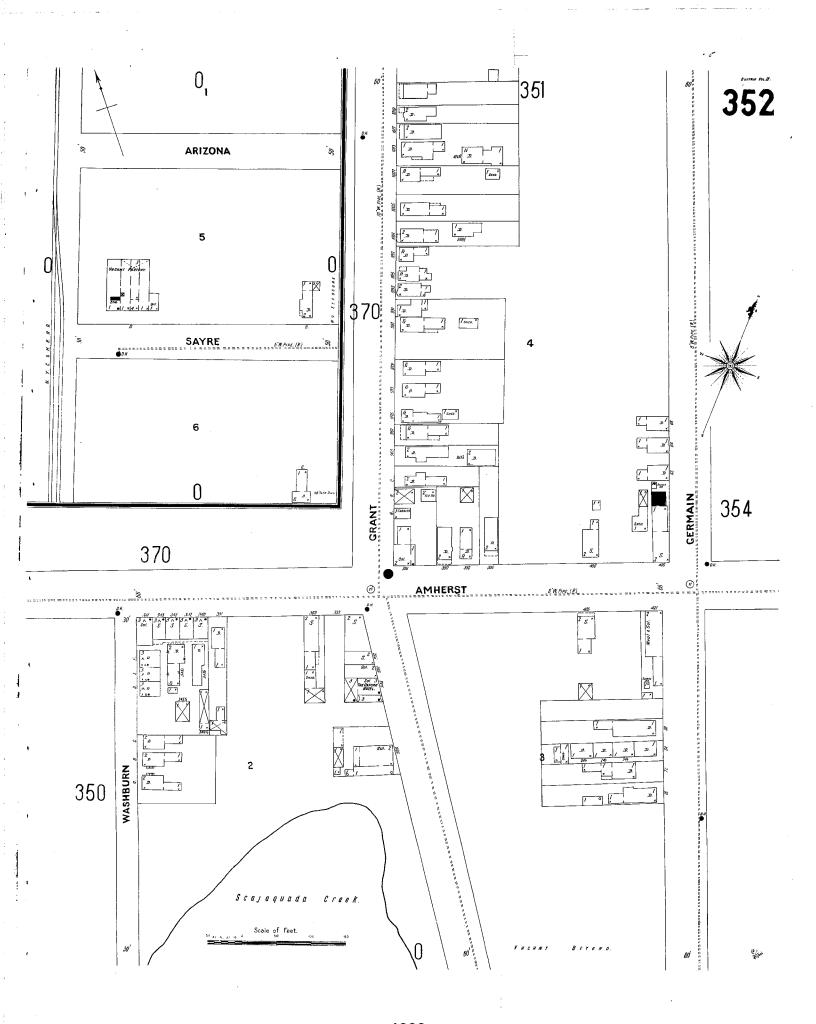


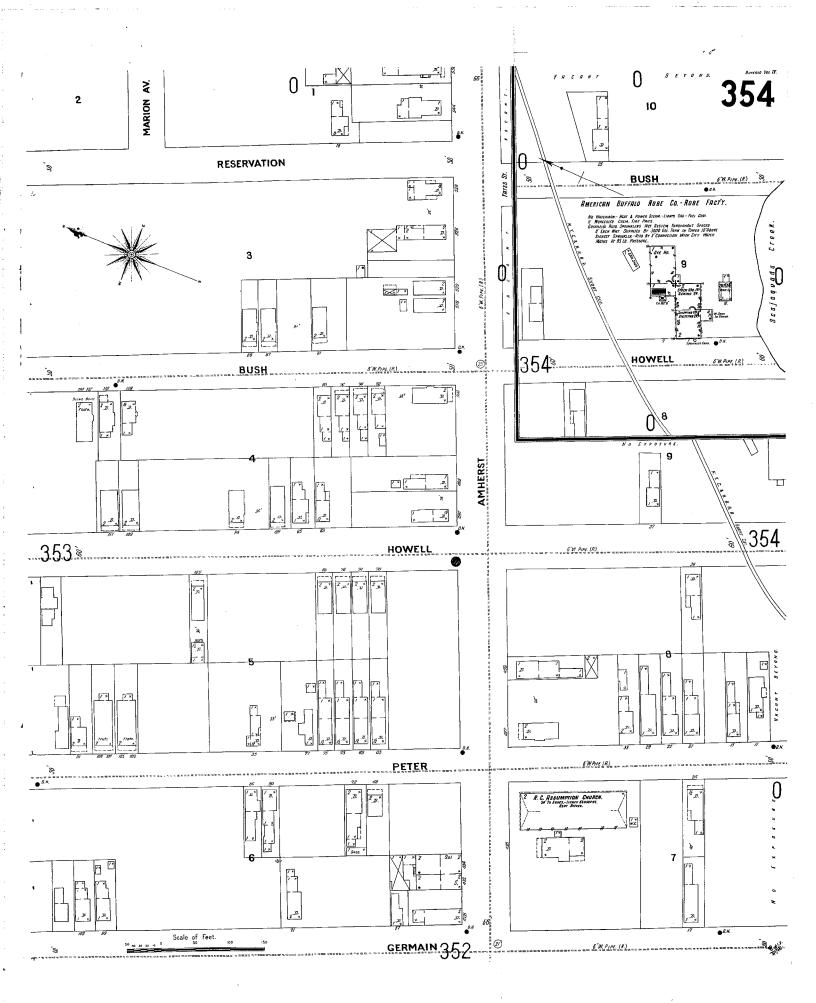


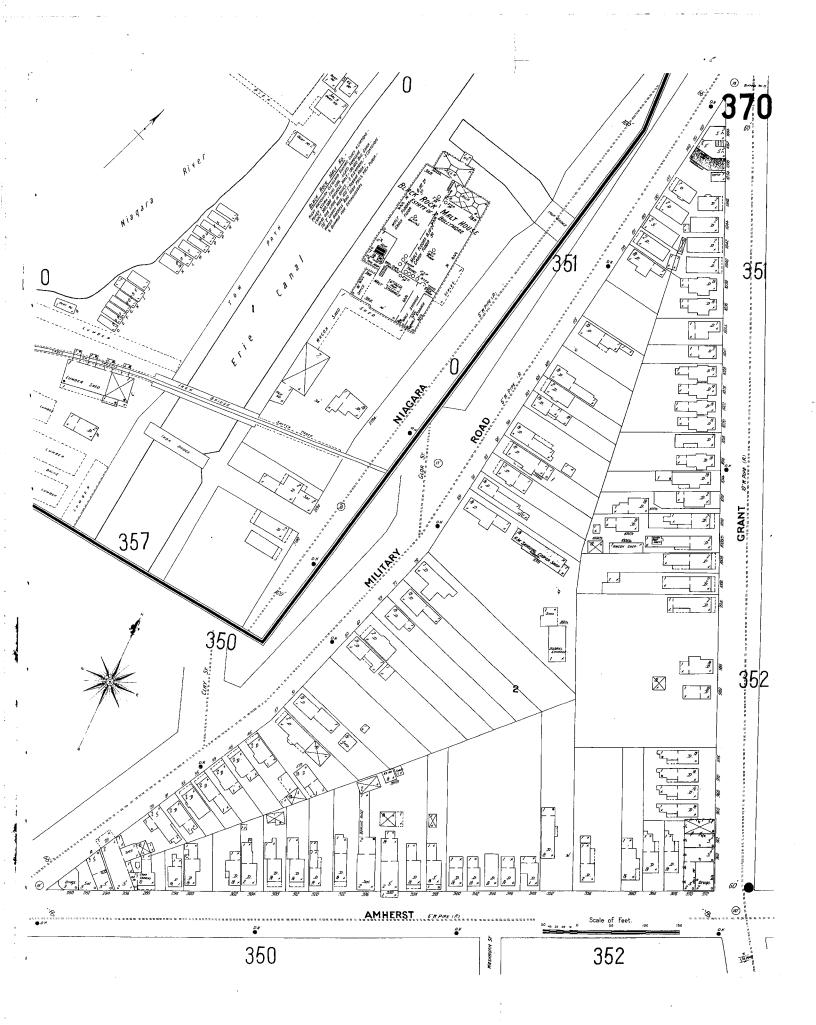


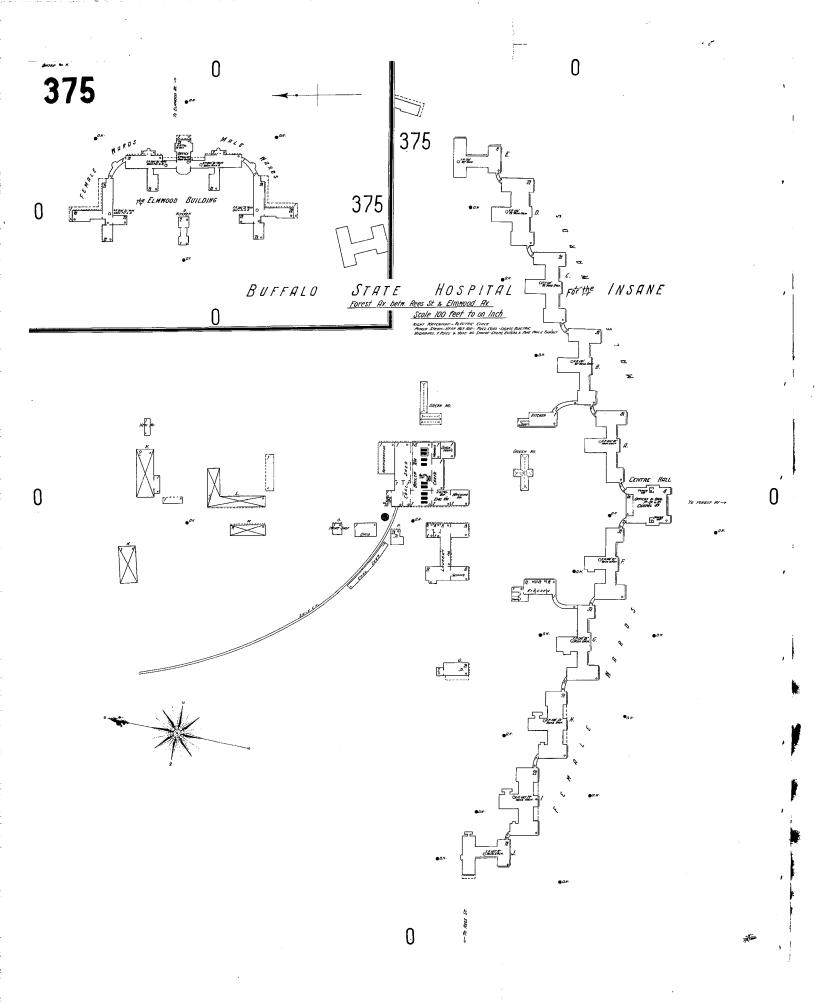


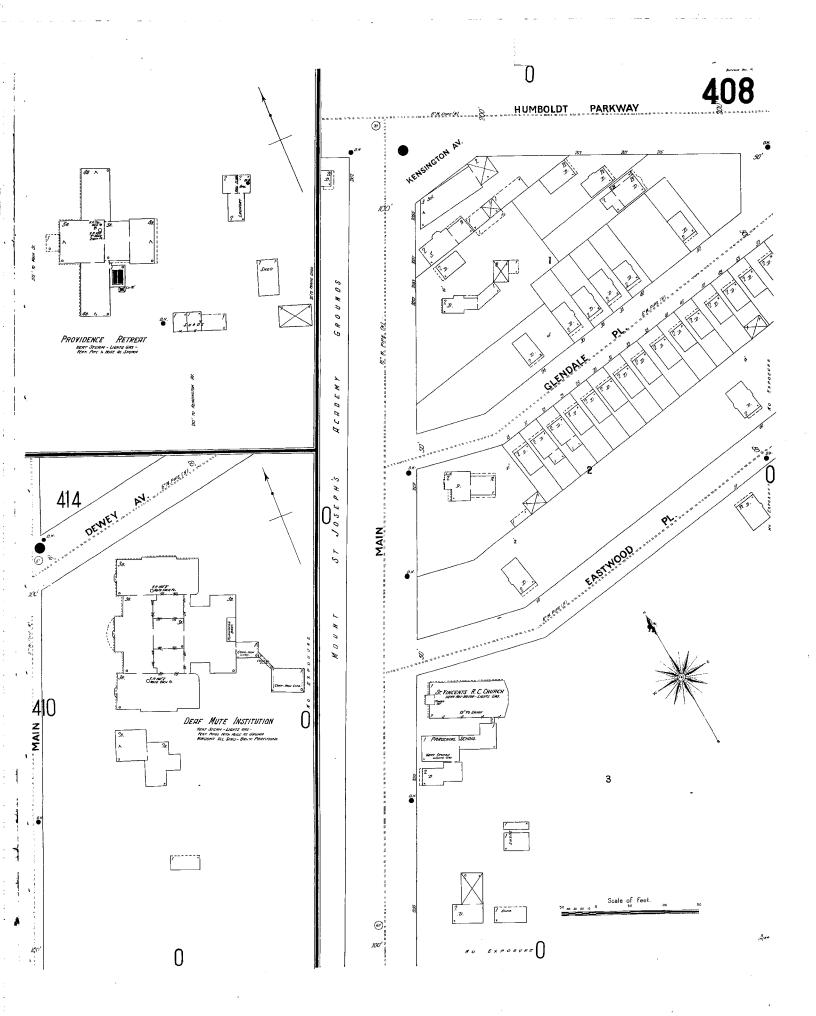


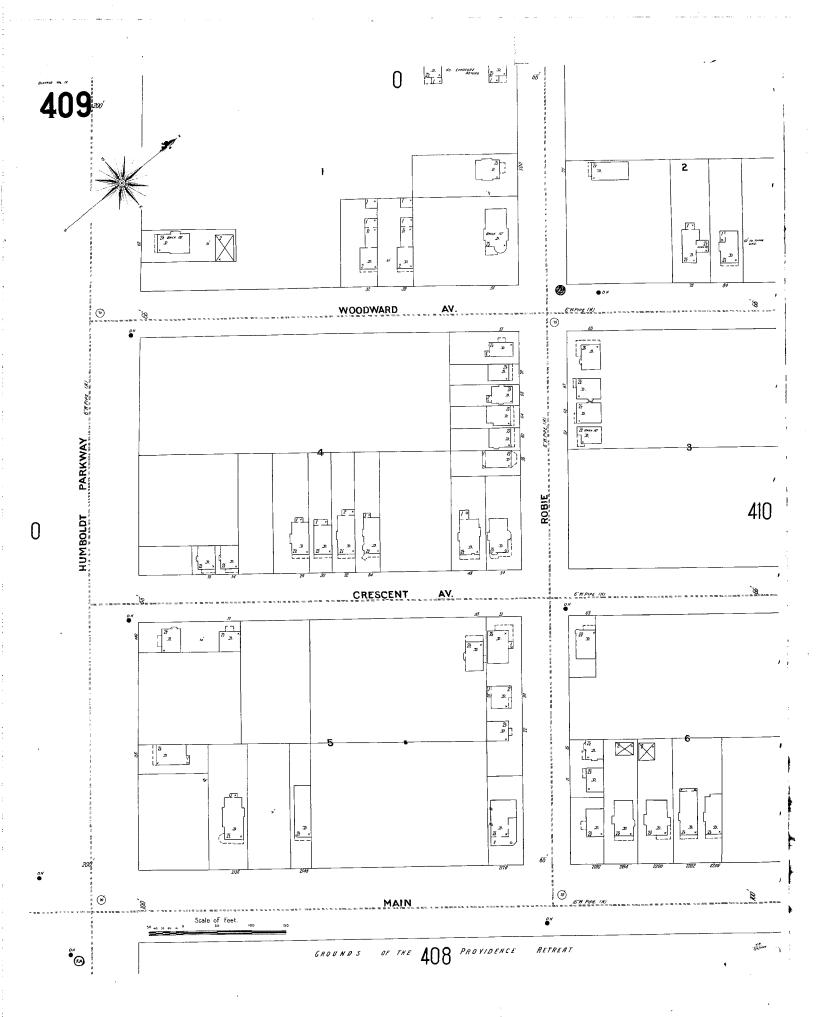


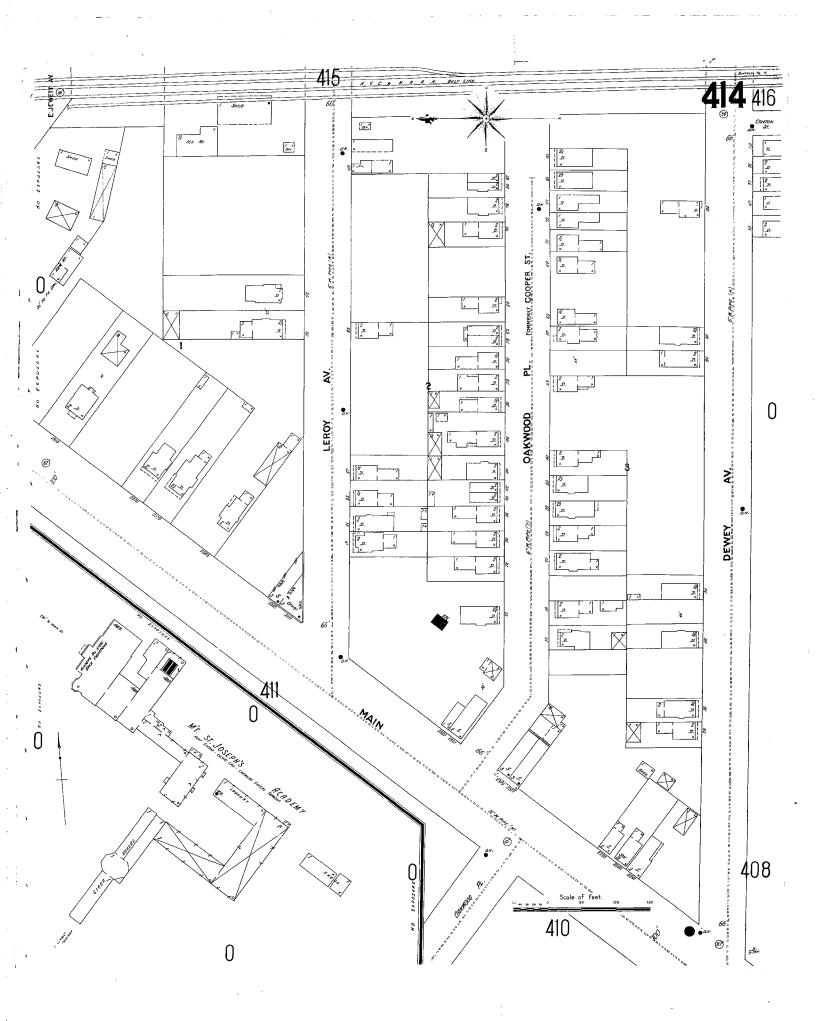


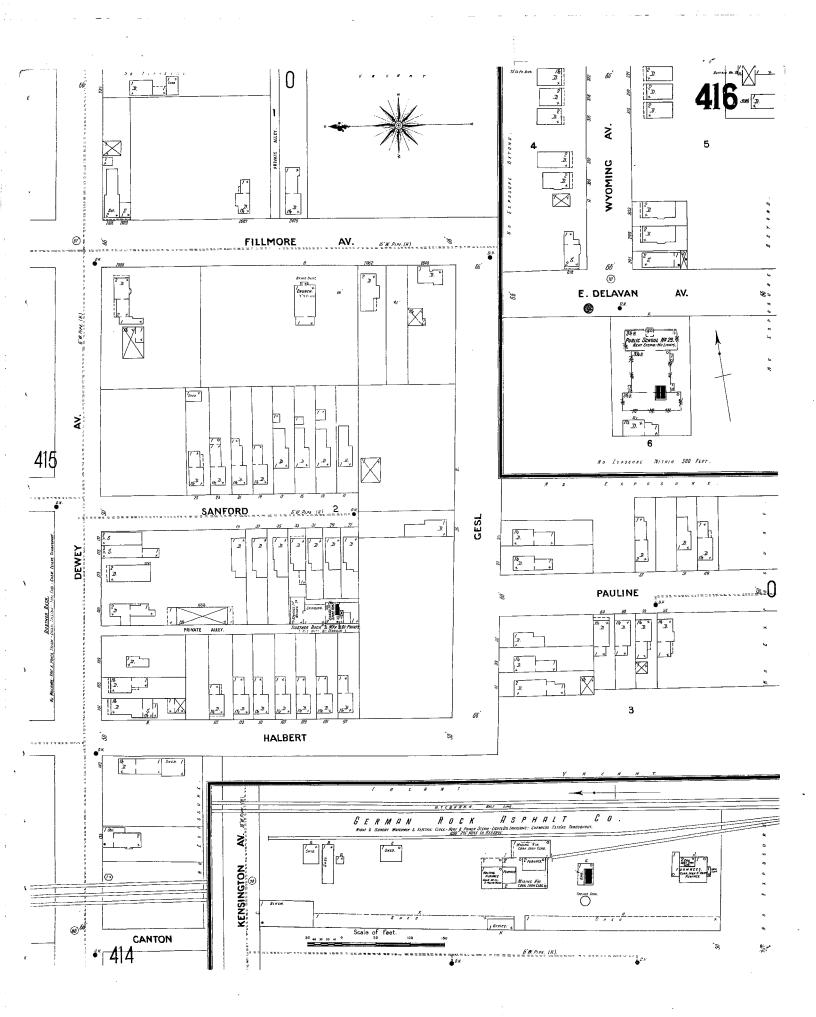


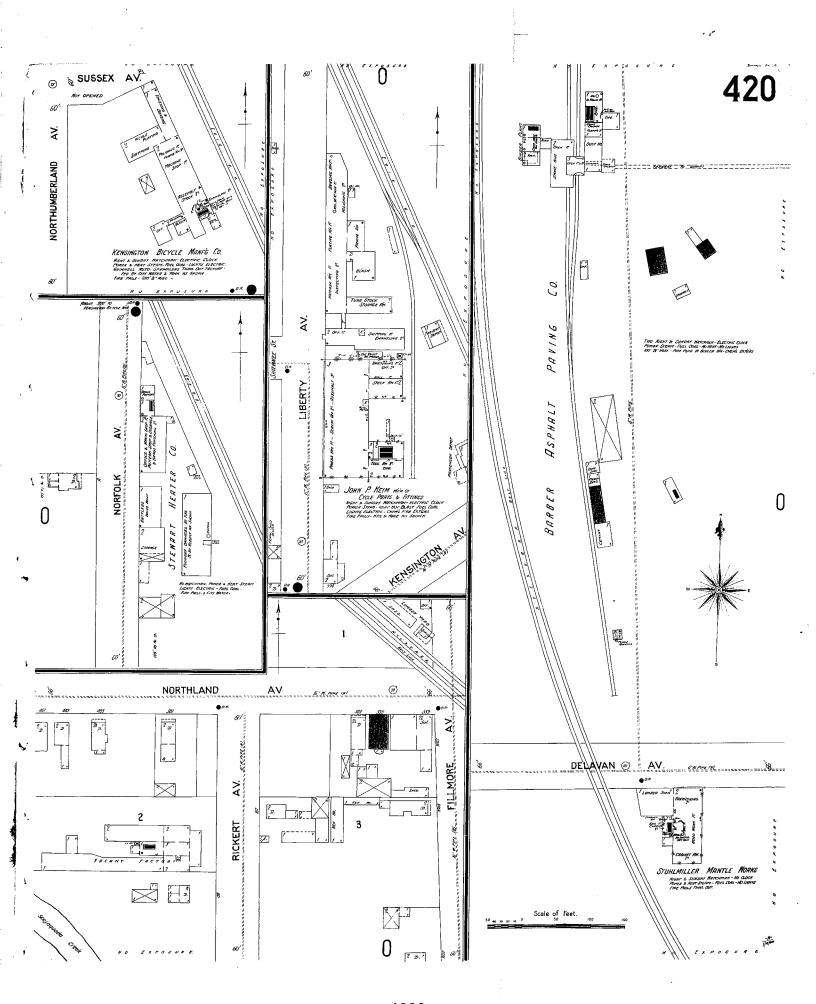


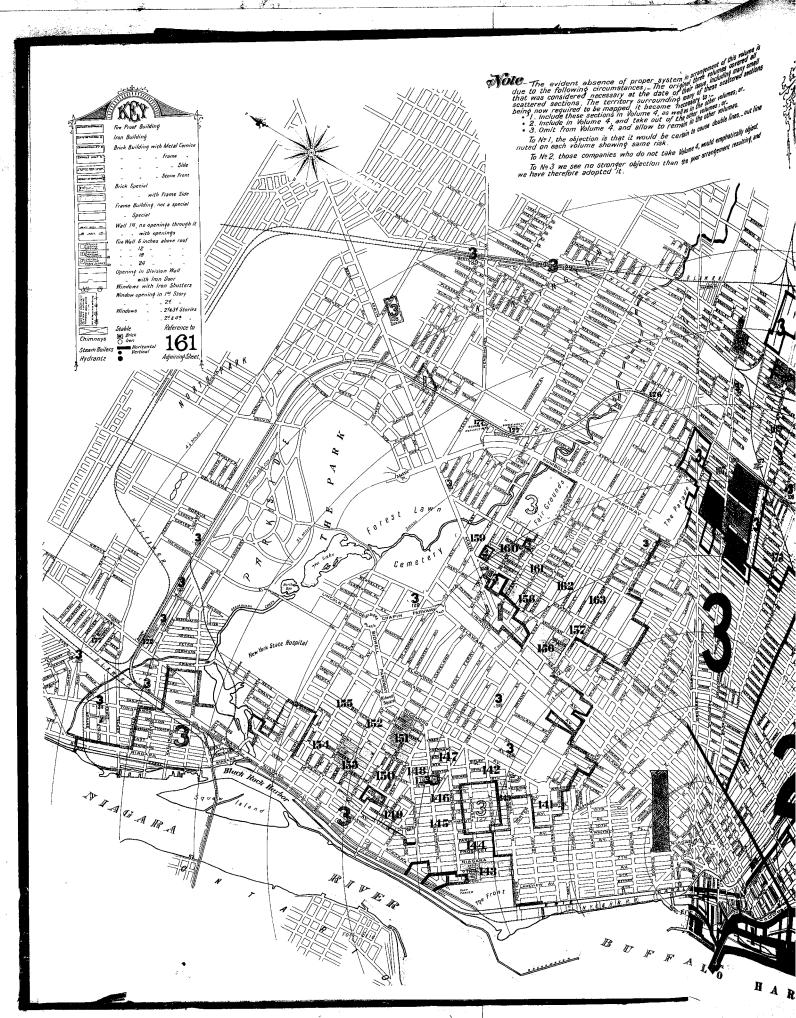

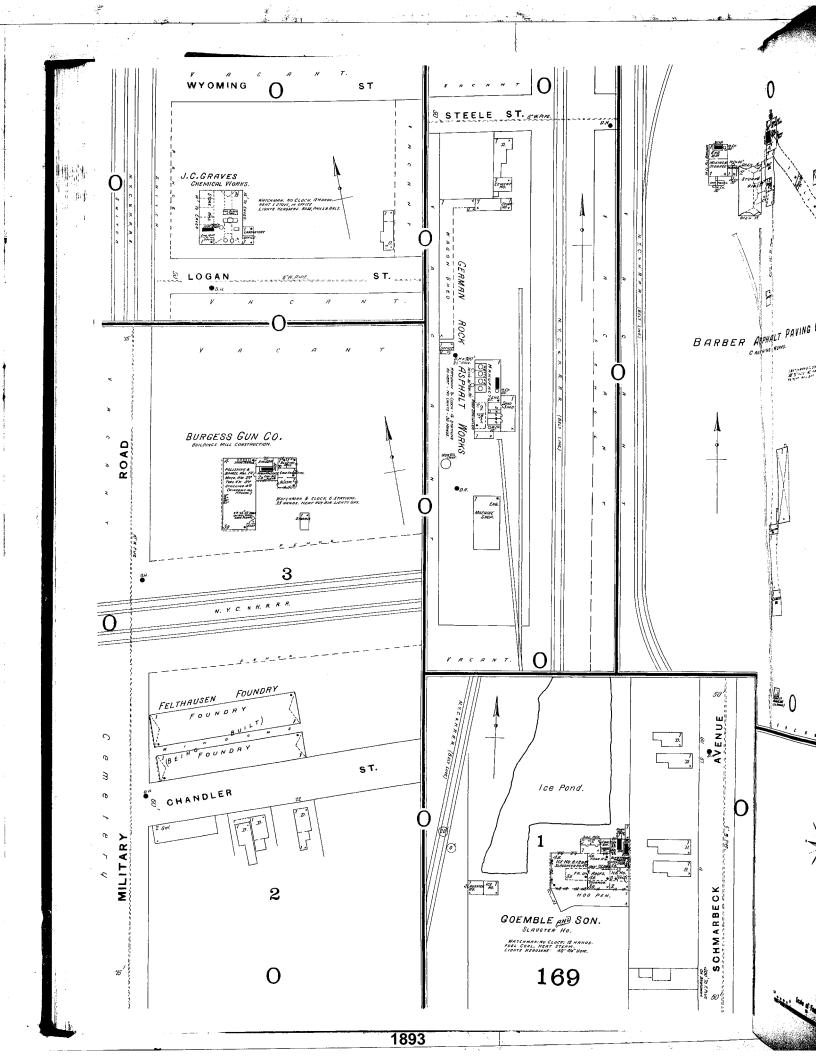

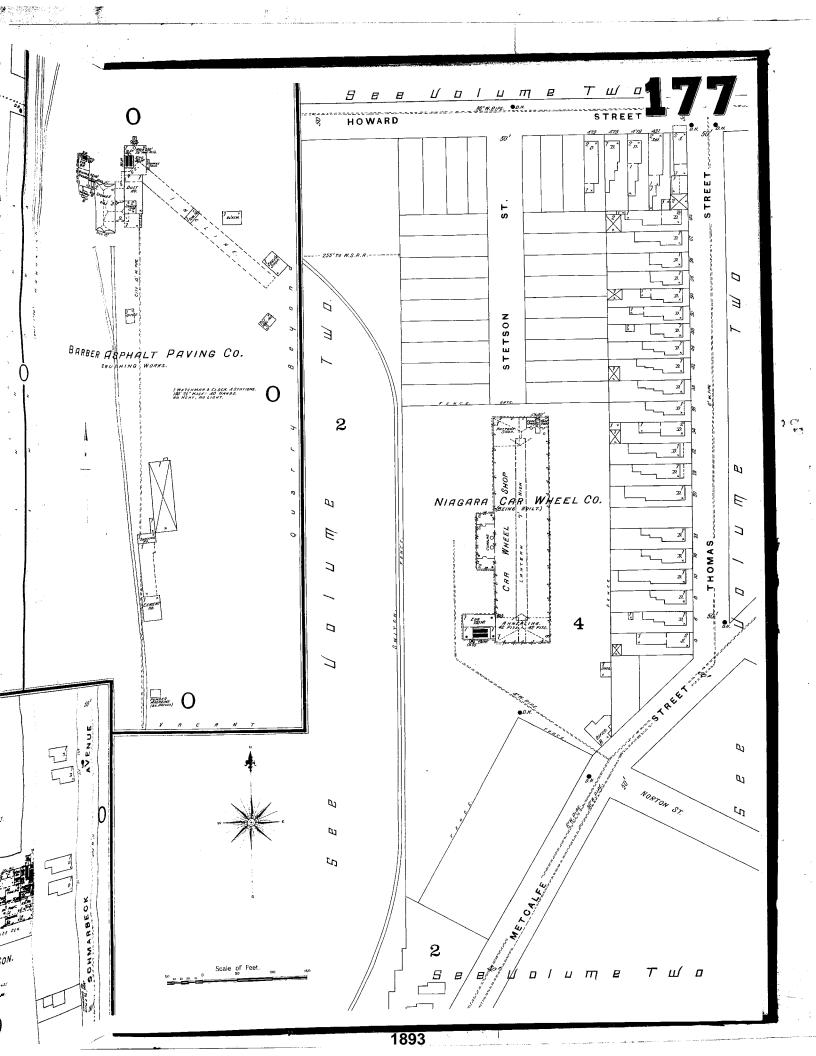

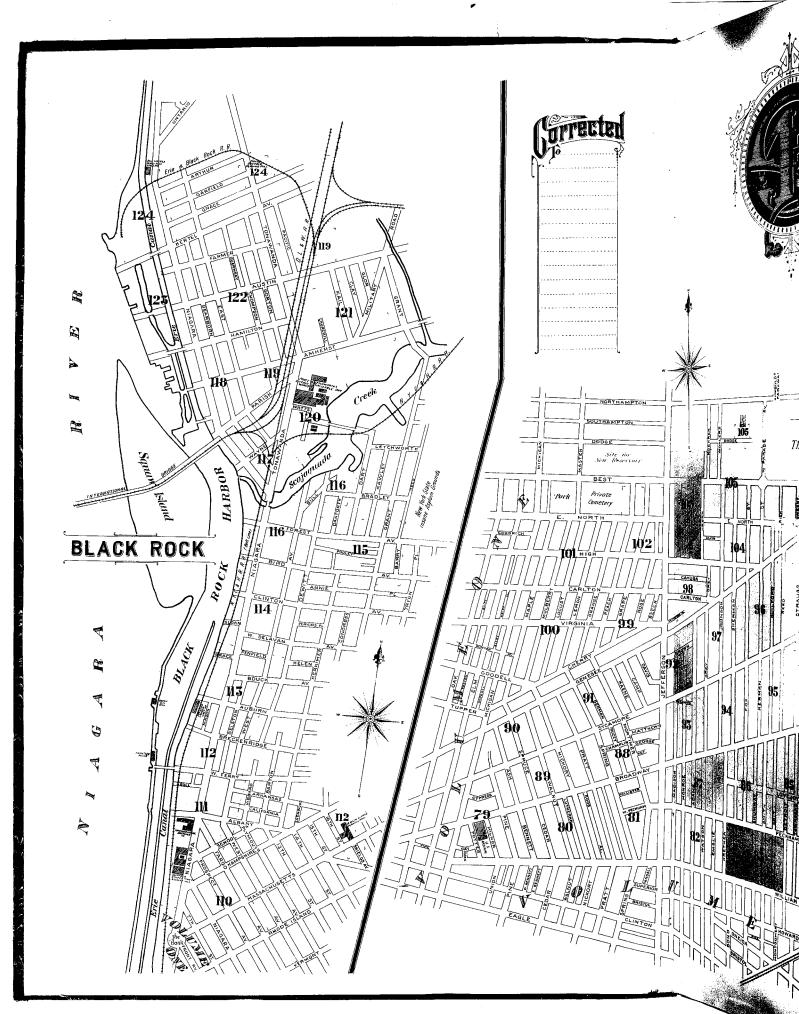

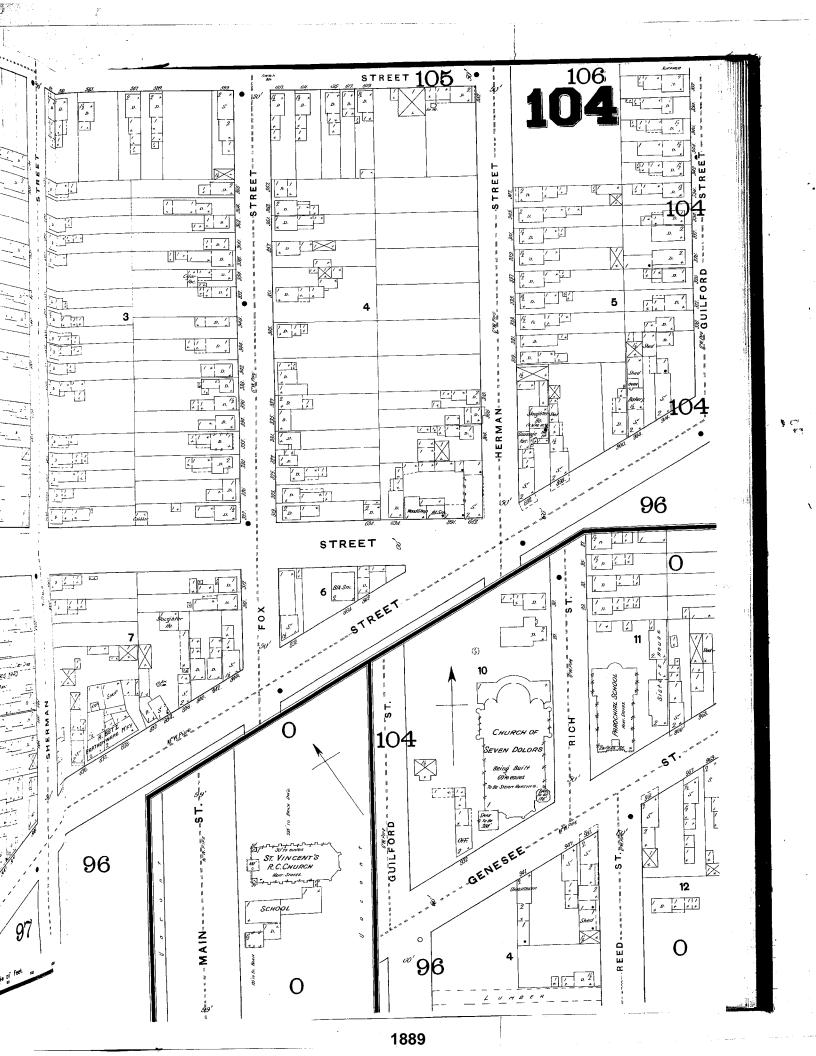

Poc K

o w


Р.


0


HARBOR


114


116

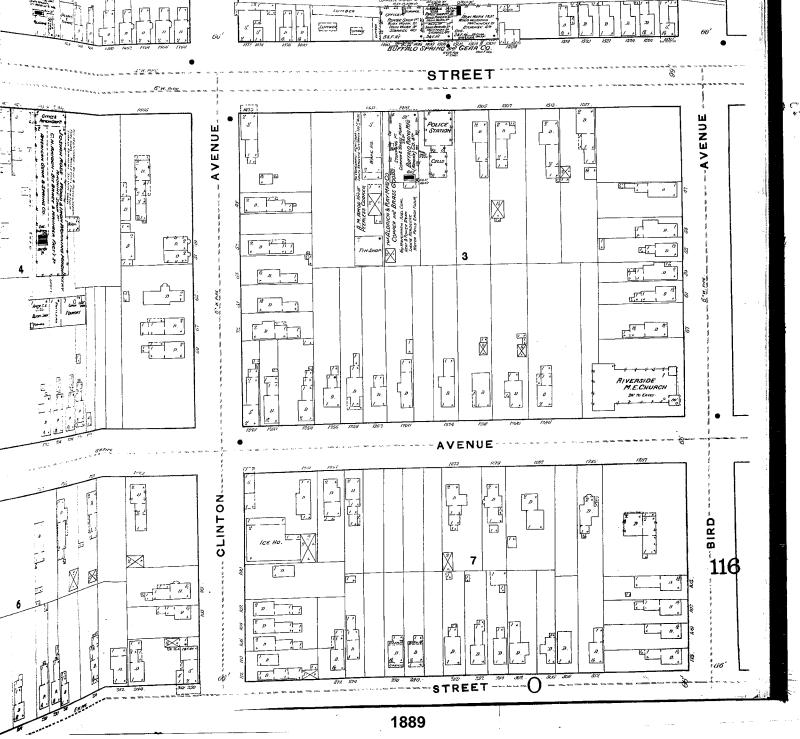


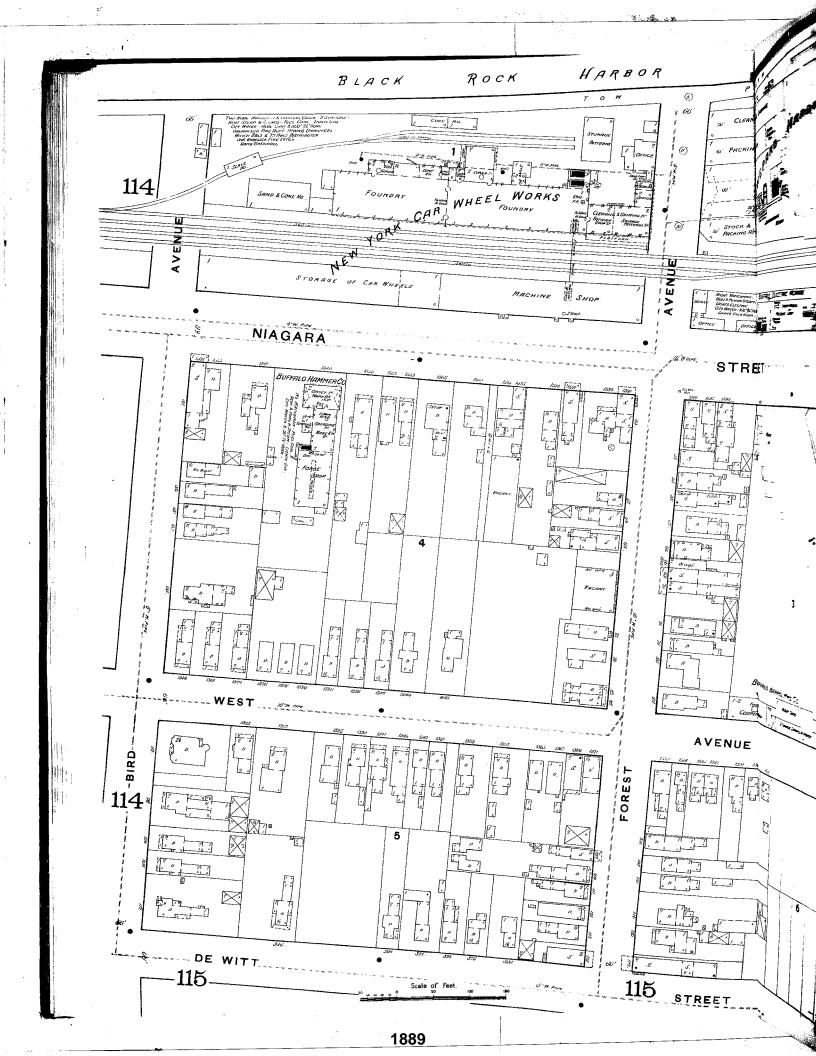


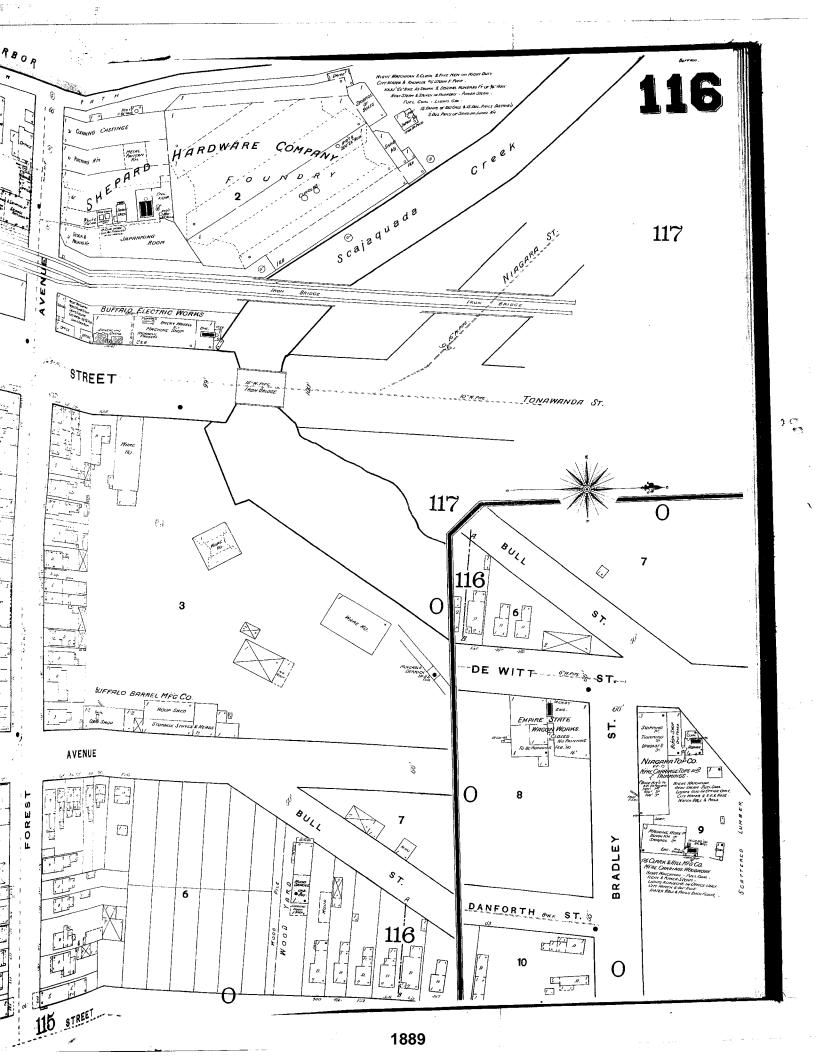


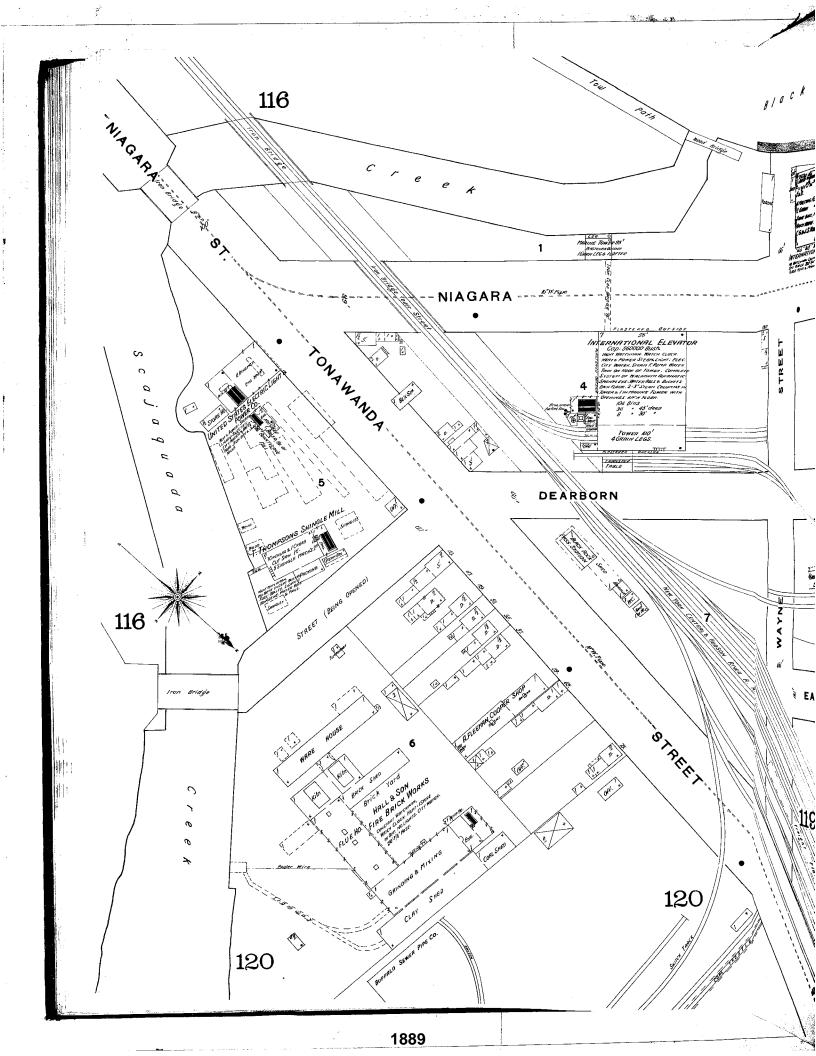

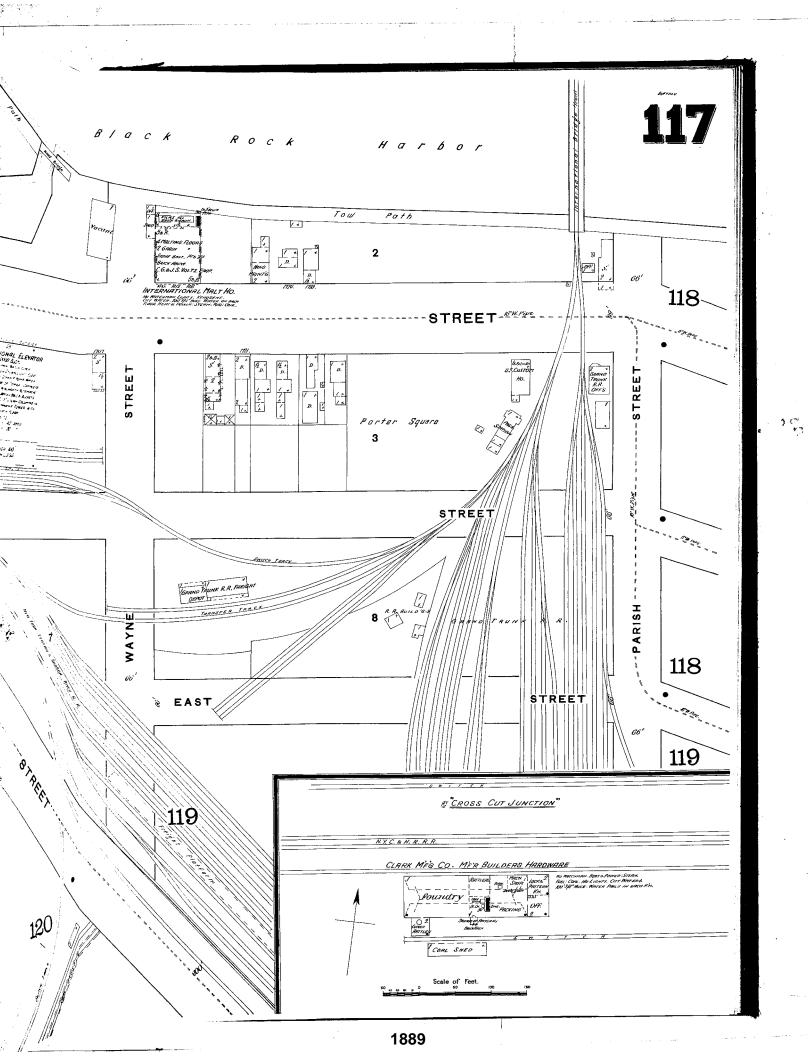

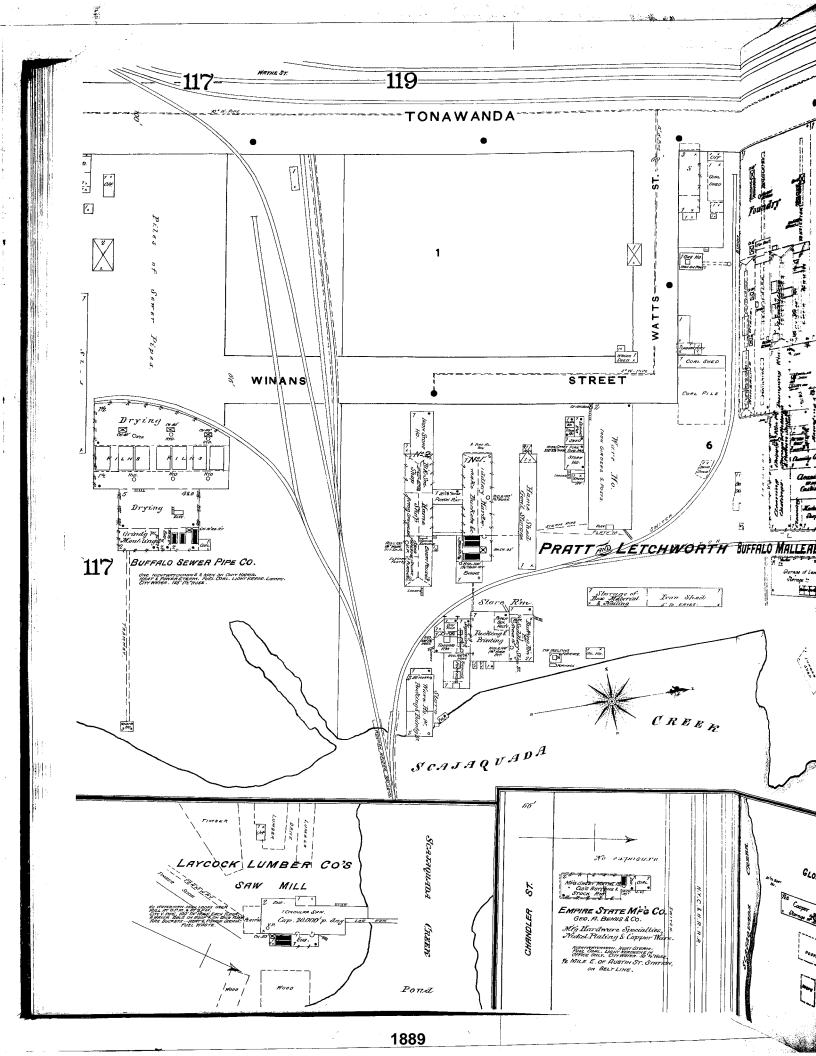

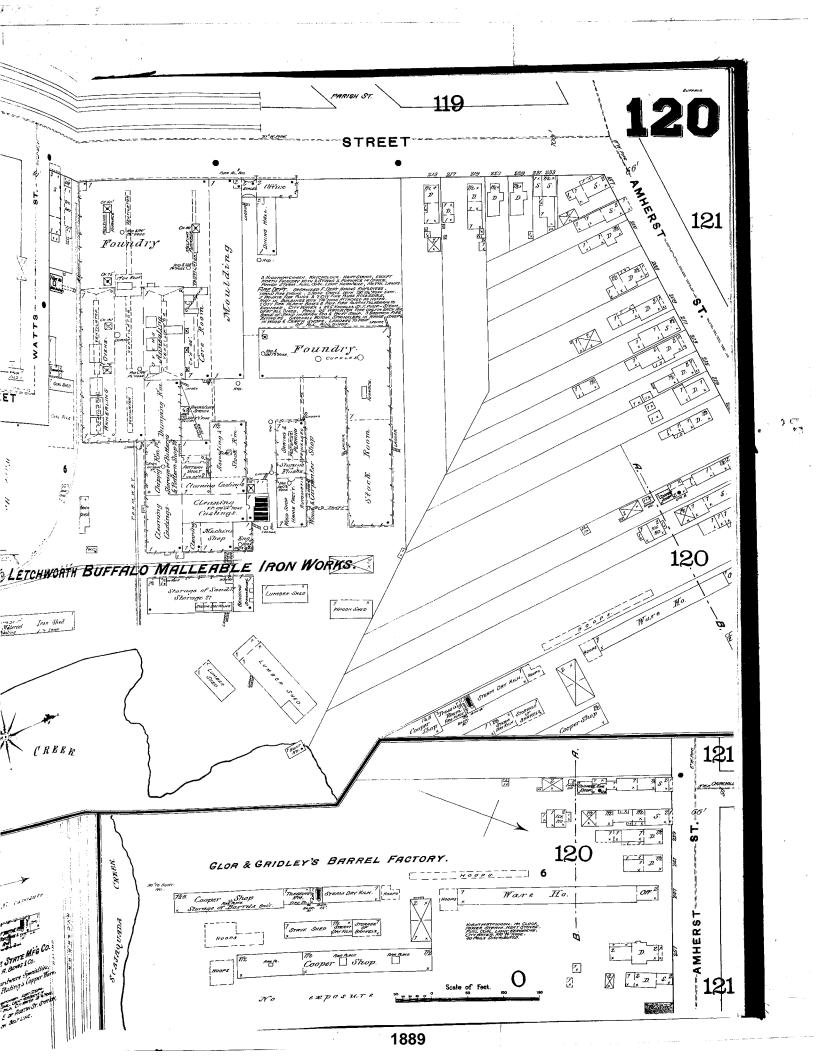

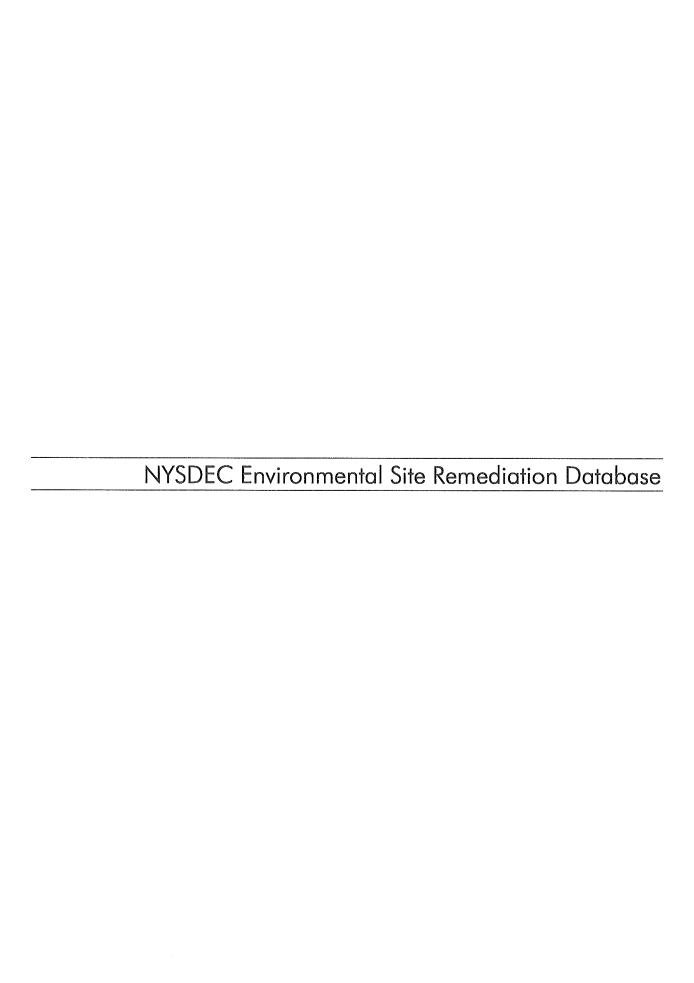



## Site Record

## Administrative Information

Site Name: 601 Amherst Street

Site Code: V00084

Program: Voluntary Cleanup Program

Classification: C EPA ID Number:

## Location

**DEC Region:** 9

Address: 601 Amherst Street

City: Buffalo Zip:

County:Erie

**Latitude:** 42.939254920 **Longitude:** -78.883186950

# Institutional And Engineering Controls

No Institutional And Engineering Controls Information Available

# Site Owner(s) and Operator(s)

Current Owner Name: Information Not Available Owner(s) during disposal: Information not available Operator during disposal: Information not available

# **Site Document Repository**

No Repository Information Available

# **Hazardous Waste Disposal Period**

No Hazardous Waste Disposal information available

## Site Description:

This site is located at 601 Amherst Street in an urban location in the City of Buffalo. The property was formerly the location of an industrial park known as Campus Industries which had one large building (380,000 sf) housing a number of commercial and industrial businesses on 17 acres. The property is adjacent to a residential neighborhood and on the south side is bounded by a city pike path and Scajaquada Creek. Historically the property was used for the disposal of ash and cinders from various sources as fill material. The property has been used for industrial and commercial businesses since the 1920's. In 1997 Wegman Food Markets purchased the property and entered the State's

Voluntary Cleanup Program to undertake the necessary investigation and remediation of the property. Remediation consisted of the removal of transformers containing PCB oil, three underground storage tanks (petroleum), one above ground storage tank (paint wastes), and the excvation and disposal of 345 tons of contaminated soil (solvents, ash). Deed restrictions were filed in 1997 and a final engineering report was submitted in 1997. Sampling of groundwater was conducted in 1998 - 2000. An assignable release and covenant not to sue was issued by DEC in 2001. No further action is required at this site. The site was developed as a supermarket in 1997-98.

# Material Disposed of at Site and Quantity:

No materials information available.

## **Assessment of Environmental Problems:**

Remediation of the site removed contaminants that posed a threat to the environment. Groundwater sampling has shown that the groundwater has not been impacted by the industrial operations.

## Assessment of Health Problems:

The site has been remediated and is now the location of a Wegman's Supermarket. The area is served by the City of Buffalo public water supply. Therefore, there are no current health concerns regarding this site.

For more Information: E-mail Us



## Site Record

## **Administrative Information**

Site Name: Pratt & Letchworth

**Site Code:** 915045

**Program:** State Superfund Program

Classification: C EPA ID Number:

## Location

**DEC Region:** 9

Address: 189 Tonawanda Street

City: Buffalo Zip: 14220

County: Erie

**Latitude:** 42.933041870 **Longitude:** -78.895617970

Site Type:

Estimated Size: 18.000 Acres

# Institutional And Engineering Controls

No Institutional And Engineering Controls Information Available

# Site Owner(s) and Operator(s)

Current Owner Name: 189 Tonawanda Street Corporation Current Owner(s) Address: Porter Avenue & 4th Street

Buffalo.NY, 14201

**Current Owner Name: PRATT & LETCHWORTH** 

Current Owner(s) Address: PORTER AVE. & 4TH STREET

BUFFALO, NY, 14201

Owner(s) during disposal: PRATT & LETCHWORTH Owner(s) during disposal: Information not available

Operator during disposal: Pratt & Letchworth
Stated Operator(s) Address: 189 TONAWANDA

BUFFALO, NY 14220

# Site Document Repository

No Repository Information Available

# **Hazardous Waste Disposal Period**

# Site Description:

The site was used to dispose foundry sand, slag, lubricants, hydraulic oil, paper and wood. The sediment samples taken from the Scajaquada Creek adjacent to the site during July of 1982 did not show any contamination. Inspections by DEC during 1985 indicated spills of waste oil at the site. About 100 barrels containing oil were stored on the ground and many of them were leaking. Later, Pratt & Letchworth removed all the barrels from the site. A Phase I Investigation was completed in 1987. A Phase II Investigation for this site was completed in 1989. A Consent Order (CO) for an Interim Remedial Measure (IRM) / Site Investigation was signed in August 1992. The area contaminated with PCBs was excavated and the contaminated soils were disposed off site in early 1994. The current owners have placed a new fill cover over most of the site. The Site Investigation was completed in 1993 and the report was submitted in January of 1995. The PCB contaminated area has been cleaned up below the selected clean up level of 1 ppm. The site investigation outside of the IRM area did not show PCBs above the clean up levels. No known hazardous wastes remain on site. A "No Further Action" Record of Decision (ROD) was signed in early 1995.

# Material Disposed of at Site and Quantity:

Type of Waste Quantity of Waste PCBS UNKNOWN

## **Assessment of Environmental Problems:**

PCB contaminated soils have been removed from the site. No known hazardous wastes remain on site.

## **Assessment of Health Problems:**

A NYSDEC preliminary investigation documented contamination of subsurface soils in the fill area, surface soils in the oil spill area, and surface water and sediments in Scajaquada Creek. Contaminants detected include polycyclic aromatic hydrocarbons, PCBs, phenolics, volatile organics and heavy metals. A petition to delist approximately a 3 acre portion of the site for the construction of a store and associated parking lot was submitted to NYSDEC and approved. A soil removal action was completed in the oil spill area thereby removing the potential for direct contact with contaminants in the surface soils. The area along the north bank of the Scajaquada Creek has been proposed for a public walkway/bicycle path. Sampling of this area for PCBs has not shown any health concern.

For more Information: E-mail Us



## Site Record

## Administrative Information

Site Name: Fedders Auto Components

Site Code: 915024

Program: State Superfund Program

Classification: 03

EPA ID Number: NYD002115087

## Location

**DEC Region:** 9

**Address: 57 TONAWANDA STREET** 

City: BUFFALO Zip: 14207

County: Erie

Latitude: 42.931153150 Longitude: -78.894458040

Site Type:

Estimated Size: 2.000 Acres

# Institutional And Engineering Controls

No Institutional And Engineering Controls Information Available

# Site Owner(s) and Operator(s)

Current Owner Name: Fedco Automotive Components Current Owner(s) Address: 57 Tonawanda Street

Buffalo, NY, 14207

**Current Owner Name: FEDDERS AUTO COMPONENTS** 

Current Owner(s) Address: 57 TONAWANDA ST.

BUFFALO, NY, 14207

Owner(s) during disposal: FEDDERS AUTO COMPONENTS

Owner(s) during disposal: Information not available Operator during disposal: Fedders Auto Components Stated Operator(s) Address: 57 Tonawanda Street Buffalo,NY 14207

Operator during disposal: Fedders Auto Components Stated Operator(s) Address: 57 Tonawanda Street

Buffalo, NY 14207

# Site Document Repository

No Repository Information Available

# **Hazardous Waste Disposal Period**

No Hazardous Waste Disposal information available

# Site Description:

The site was a 2 acre parking lot for the Fedco Automotive Components Company located at 57 Tonawanda Street in the city of Buffalo, Erie County. The site is located in an urban commercial and industrial area within the City of Buffalo immediately adjacent to Scajaguada Creek. The nearest residential area is approximately 0.5 miles north of the site. In 1936-1942 a building housing furnace kilns that existed at the same location as the site was torn down and used as fill for the parking lot. Historically, waste oils (consisting of hydraulic fluids and light lubrication oils) were spread over the parking area as a dust suppressant. Further it was alleged that the waste oil contained PCBs. Reportedly 165 Gal/yr of waste oil was used. A 1978 Site Inspection reports that solvent still bottoms were used for this purpose. Conflicting reports exist as to when this spreading practice was discontinued (1976 vs 1981). In 1981, the lot was covered with gravel so no further dust control measures were necessary. Investigations conducted at this site to date include a USEPA Site Inspection, NYSDEC Phase I and Phase II Investigations (1985, 1992) and a Site Investigation conducted on behalf of Fedco Automotive in 1989. As a result of remedial activities at the adjacent Iroguois Gas/Westwood Pharmaceutical Site # 915141, a highly concentrated oily material was found adjacent to Fedco property in 1998. This material would be removed with extraction wells as part of ongoing remediation for the Iroquois/Westwood Pharmaceutical Company. NYSDEC reclassified the site to a 3 in 1993. A subsurface soil investigation around the naphthalene underground storage tank was conducted by S&W Redevelopment in 2002.

# Material Disposed of at Site and Quantity:

Type of Waste

**Quantity of Waste** 

SOLVENT STILL BOTTOMS (F001 WASTE) 165 GALLONS/YEAR (EST.)

## **Assessment of Environmental Problems:**

Volatile organics, PCBs and lead contaminants were detected in site soil and sediments of Scajaquada Creek. VOCs were detected in groundwater. The Scajaquada Creek sediment was remediated in 1998 - 1999 as part of site #915141. The remaining contamination is not currently posing a significant threat to the environment.

## **Assessment of Health Problems:**

The potential for direct contact with contaminated soil is low because the site is fenced and partially covered with gravel. Exposures via drinking water are not expected because the community near the site is served by public water and there are no known private wells in the immediate area.

For more Information: E-mail Us



## Site Record

## Administrative Information

Site Name: Iroquois Gas/Westwood Pharm. Riparian

Site Code: 915141B

Program: State Superfund Program

Classification: 04 EPA ID Number:

## Location

**DEC Region:** 9

Address: Scajaquada Creek, Upstream of West Ave. Bridge

City: Buffalo Zip: 13213

County: Erie

Latitude: 42.932353130 Longitude: -78.893063390

Site Type:

Estimated Size: 1.000 Acres

# Institutional And Engineering Controls

No Institutional And Engineering Controls Information Available

# Site Owner(s) and Operator(s)

Current Owner Name: New York State

Current Owner(s) Address:

77

Current Owner Name: New York State

Current Owner(s) Address:

ZZ

Owner(s) during disposal: IROQUOIS GAS (NATIONAL FUEL GAS)

Owner(s) during disposal: Information not available

Operator during disposal: Iroquois Gas (National Fuel Gas)

Stated Operator(s) Address: 10 Lafayette Square

Buffalo.NY 14203

Operator during disposal: Iroquois Gas (National Fuel Gas)

**Stated Operator(s) Address:** 10 Lafayette Square Buffalo, NY 14203

# **Site Document Repository**

No Repository Information Available

# **Hazardous Waste Disposal Period**

No Hazardous Waste Disposal information available

# Site Description:

The Site is located immediately west of Dart Street and north of Bradley Street in the City of Buffalo. Scajaquada Creek lies adjacent to the site on the west and has been impacted by site contaminants. Land use near the site is mixed industrial and residential. The site is broken down into two projects noted as sites 95141A (Terrestrial) and 915141B (Reparian). This portion of the site is a 1600 foot long section of Scajaguada Creek, extending upstream from the West Avenue Bridge. The Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation, operated a manufactured gas plant during the early and middle part of the 1900s, in an area on the south bank of the creek on Dart Street. The wastes from the plant operations entered the creek via discharges from piped outlets, spills, and movement of surface and groundwater. The creek sediments were contaminated with high levels of polynuclear aromatic hydrocarbons (PAHs), benzene, toluene, ethylbenzene, and xylene (BTEX), the same contaminants found at the Terrestrial Site #915141A. A Record of Decision (ROD), signed in 1994, selected a site remedy that required removal of contaminated stream sediments and off site disposal. A Consent Decree issued by Federal Court in 1995 directed National Fuel Gas to implement the remedy and remove contaminated sediments to a depth of six feet. The presence of I-198 expressway bridge piers at the site did not allow the removal of all contaminated sediments to the maximum depth in some areas of the creek. The Remedial Design, therefore, was modified to include removal of sediments, coupled with capping of the stream bed to contain any residual contaminants, and long term pumping of two deep pockets of non-aqueous phase liquid (NAPL) from the substrata of the creek. Remedial Action (RA) was started in August 1998 and was completed in 2001. Approximately 19,000 cubic yards of contaminated sediments were excavated and disposed off-site. An 18 inch thick stream bed cap, comprised of geo-synthetic clay liner overlain by sand, geotextile and stone was installed after excavation and removal of the sediments. Restoration of aquatic habitat was included as a part of the RA to enhance the re-establishment of the stream fishery. Two NAPL recovery wells were installed using directional drilling technology to recover the NAPL from the substrata of the creek and both wells are operating. Long-term OM&M is ongoing.

# Material Disposed of at Site and Quantity:

Type of Waste

**Quantity of Waste** 

VOLATILE ORGANICS
BENZENE, TOULENE, ETHYLBENZENE, XYLENE (BTEX)

UNKNOWN

UNKNOWN

## **Assessment of Environmental Problems:**


Removal and off-site disposal of contaminated sediments, installation of the stream bed cap, aquatic habitat restoration and NAPL recovery under the long-term OM&M plan have effectively addressed the environmental impacts at the site. The majority of wastes have been removed. NAPL recovery is active from the north and south recovery systems.

## **Assessment of Health Problems:**


Exposures via drinking water are not expected because homes and businesses in the area are served by public water and no known private wells or public water intakes exist in the immediate area. The remediation of Scajaquada Creek sediments reduced the potential for direct contact exposure to site-related contaminants.


For more Information: E-mail Us




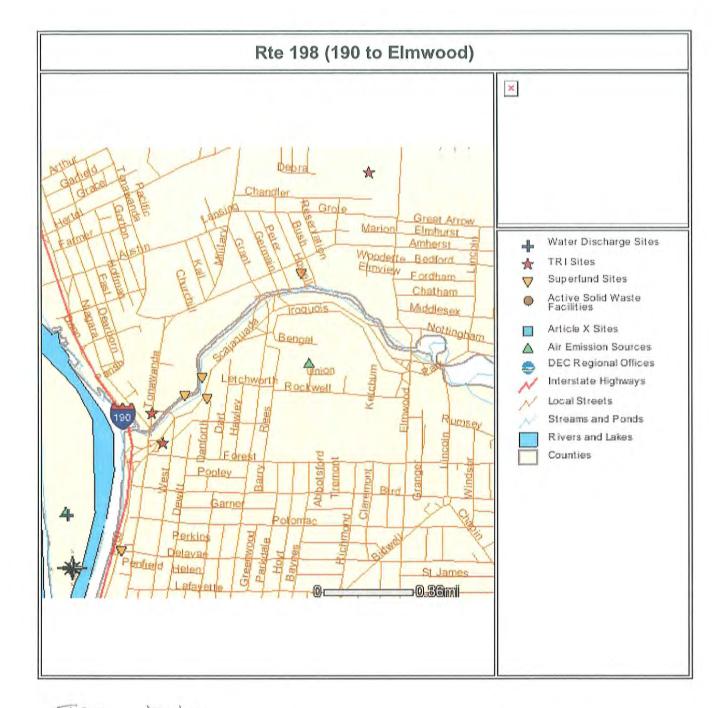


TRI - Fedo WESTWOOD- SQUIBB Superfund - Fedders Iroguous GAS/Westwood 3 guilde Marcon Erectors Air - Bisters of Charity Hospital

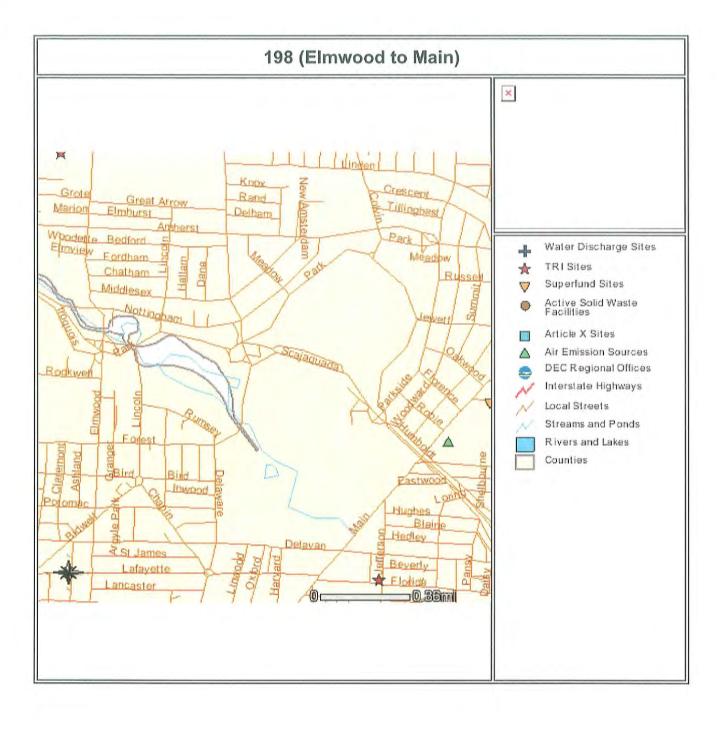

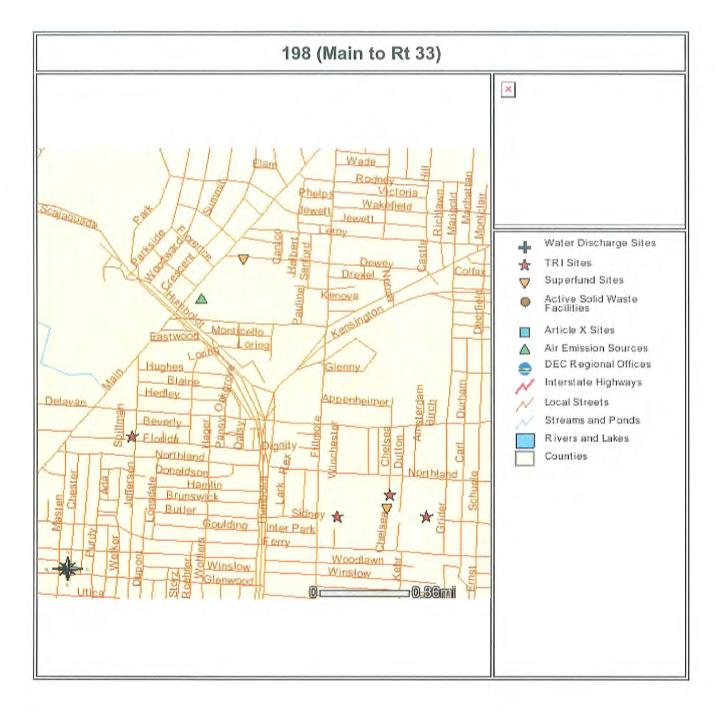

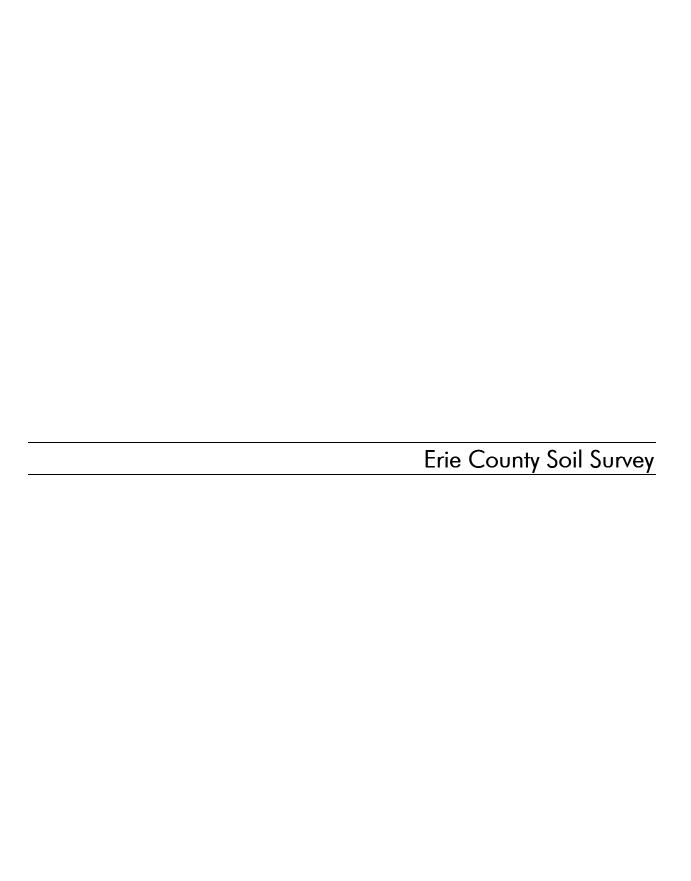

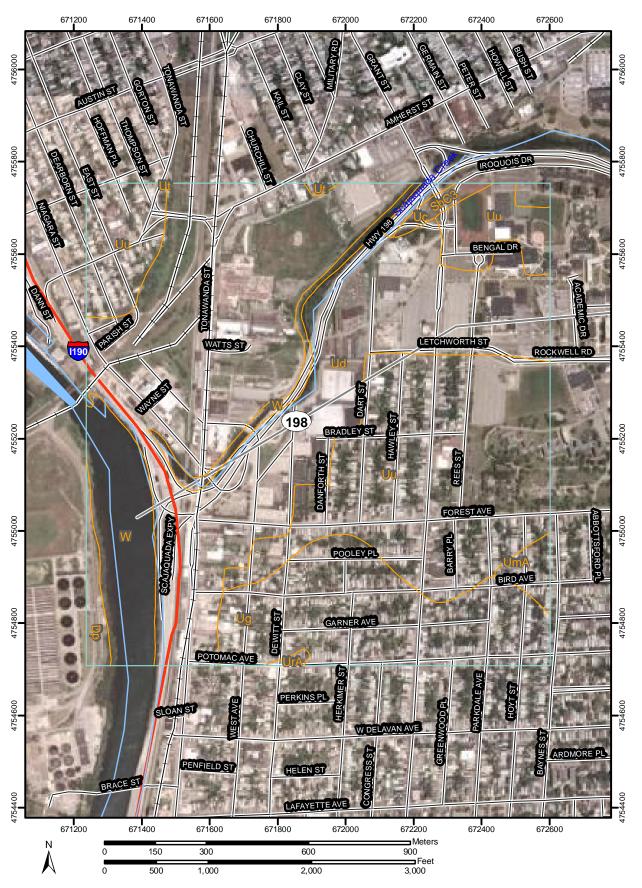

## MAP LEGEND

#### Area of Interest (AOI)

Area of Interest (AOI)

#### Soils

Soil Map Units

#### **Special Point Features**

Blowout

■ Borrow Pit

Clay Spot

Closed Depression

Gravel Pit

.. Gravelly Spot

Landfill

∧ Lava Flow

علد Marsh

Mine or Quarry

Miscellaneous Water

Perennial Water

Rock Outcrop

+ Saline Spot

"." Sandy Spot

Severely Eroded Spot

Sinkhole

Slide or Slip

Spoil Area

Stony Spot

### m v

Very Stony Spot

Wet Spot

Other

#### Special Line Features

λ G

Gully

Short Steep Slope

Other

## **Political Features**

## Municipalities



Cities

Urban Areas

#### **Water Features**



Oceans

Streams and Canals

#### Transportation



Rails

## Roads



Interstate Highways



US Routes



State Highways



Local Roads



Other Roads

## MAP INFORMATION

Original soil survey map sheets were prepared at publication scale. Viewing scale and printing scale, however, may vary from the original. Please rely on the bar scale on each map sheet for proper map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL: http://websoilsurvey.nrcs.usda.gov Coordinate System: UTM Zone 17N

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.


Soil Survey Area: Erie County, New York Survey Area Data: Version 6, Aug 24, 2007

Date(s) aerial images were photographed: 3/28/1995

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

# **Map Unit Legend**

Erie County, New York (NY029)				
Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI	
Dp	Dumps	5.7	1.2%	
SbC3	Schoharie silty clay loam, 8 to 15 percent slopes, seve relyeroded	3.2	0.7%	
Uc	Udorthents, smoothed	2.3	0.5%	
Ud	Urban land	223.0	46.5%	
Ug	Urban land-Cayuga complex	64.3	13.4%	
UmA	Urban land-Collamer complex 1 to 6 percent slopes	4.9	1.0%	
UrA	Urban land-Lima complex 1 to 6 percent slopes	0.8	0.2%	
Ut	Urban land-Odessa complex	0.6	0.1%	
Uu	Urban land-Schoharie complex	137.8	28.7%	
W	Water	37.2	7.8%	
Totals for Area of Interest (AOI)		479.9	100.0%	

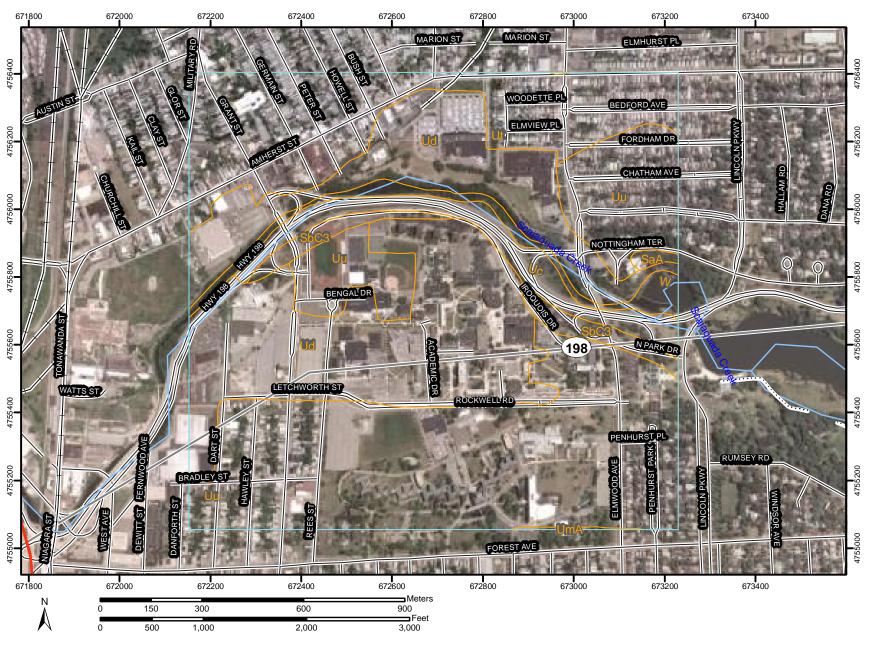

## MAP LEGEND

#### Area of Interest (AOI)

Area of Interest (AOI)

#### Soils

Soil Map Units

#### **Special Point Features**

Blowout

■ Borrow Pit

Clay Spot

Closed Depression

Gravel Pit

.. Gravelly Spot

Landfill

∧ Lava Flow

علد Marsh

Mine or Quarry

Miscellaneous Water

Rock Outcrop

Saline Spot

Perennial Water

.

"." Sandy Spot

... comby spot

Severely Eroded Spot

Sinkhole

Slide or Slip

Spoil Area

Stony Spot

### Very Stony Spot

Wet Spot

Other

#### Special Line Features

℃ Gully

Short Steep Slope

Other

### **Political Features**

#### Municipalities

\_\_\_

Urban Areas

Cities

#### Water Features



Oceans

Streams and Canals

### Transportation

111

Rails

## Roads



Interstate Highways



US Routes



State Highways



Local Roads



Other Roads

## MAP INFORMATION

Original soil survey map sheets were prepared at publication scale. Viewing scale and printing scale, however, may vary from the original. Please rely on the bar scale on each map sheet for proper map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL: http://websoilsurvey.nrcs.usda.gov

Coordinate System: UTM Zone 17N

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.


Soil Survey Area: Erie County, New York Survey Area Data: Version 6, Aug 24, 2007

Date(s) aerial images were photographed: 3/28/1995

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

# **Map Unit Legend**

Erie County, New York (NY029)				
Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI	
SaA	Schoharie silt loam, 0 to 3 percent slopes	1.4	0.3%	
SbC3	Schoharie silty clay loam, 8 to 15 percent slopes, seve relyeroded	12.4	2.6%	
Uc	Udorthents, smoothed	22.2	4.6%	
Ud	Urban land	161.0	33.4%	
UmA	Urban land-Collamer complex 1 to 6 percent slopes	0.5	0.1%	
Ut	Urban land-Odessa complex	80.5	16.7%	
Uu	Urban land-Schoharie complex	191.0	39.7%	
W	Water	12.4	2.6%	
Totals for Area of Interest (AOI)		481.5	100.0%	

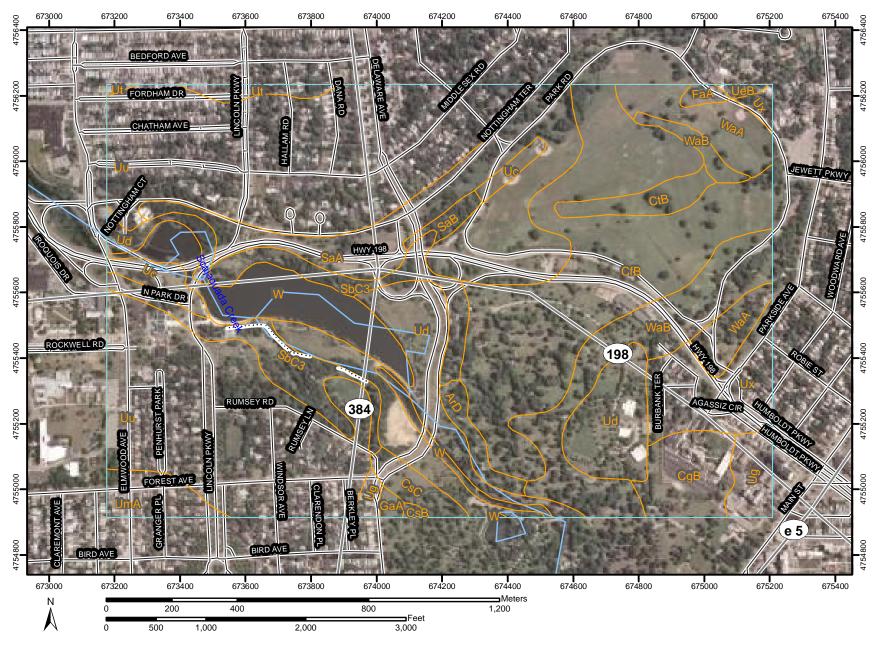

## MAP LEGEND

#### Area of Interest (AOI)

Area of Interest (AOI)

#### Soils

Soil Map Units

#### **Special Point Features**

 $\odot$ Blowout

X Borrow Pit

Ж Clay Spot

Closed Depression

× Gravel Pit

Gravelly Spot ٨

Ճ Landfill

Lava Flow

Marsh

Mine or Quarry 52

⊚ Miscellaneous Water

◉ Perennial Water

Rock Outcrop

Saline Spot

Sandy Spot

Severely Eroded Spot =

Sinkhole ٥

Slide or Slip

Sodic Spot

3 Spoil Area

Stony Spot

### Very Stony Spot

Wet Spot

Other

#### **Special Line Features**

2

Gully

Short Steep Slope

11 Other

### **Political Features**

#### Municipalities



Cities

**Urban Areas** 

#### **Water Features**



Oceans

Streams and Canals

#### Transportation



Rails

## Roads



Interstate Highways



**US Routes** 



State Highways



Local Roads





Other Roads

## MAP INFORMATION

Original soil survey map sheets were prepared at publication scale. Viewing scale and printing scale, however, may vary from the original. Please rely on the bar scale on each map sheet for proper map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL: http://websoilsurvey.nrcs.usda.gov Coordinate System: UTM Zone 17N

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Erie County, New York Survey Area Data: Version 6, Aug 24, 2007

Date(s) aerial images were photographed: 3/28/1995

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

### **Map Unit Legend**

	Erie County, New Y	ork (NY029)	
Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
ArD	Arkport very fine sandy loam, 15 to 25 percent slopes	5.8	0.9%
CfB	Cayuga silt loam, 3 to 8 percent slopes	104.0	15.7%
CgB	Cazenovia silt loam, 3 to 8 percent slopes	16.7	2.5%
CsB	Collamer silt loam, 3 to 8 percent slopes	0.7	0.1%
CsC	Collamer silt loam, 8 to 15 percent slopes	6.5	1.0%
CtB	Collamer silt loam, till substratum, 3 to 8 percent slo pes	8.1	1.2%
FaA	Farmington channery loam, 0 to 3 percent slopes	1.8	0.3%
GaA	Galen very fine sandy loam, 0 to 3 percent slopes	1.3	0.2%
SaA	Schoharie silt loam, 0 to 3 percent slopes	61.3	9.3%
SaB	Schoharie silt loam, 3 to 8 percent slopes	3.1	0.5%
SbC3	Schoharie silty clay loam, 8 to 15 percent slopes, seve relyeroded	33.8	5.1%
Uc	Udorthents, smoothed	8.6	1.3%
Ud	Urban land	64.0	9.7%
UeB	Urban land-Benson complex, 3 to 6 percent slopes	1.1	0.2%
Ug	Urban land-Cayuga complex	10.3	1.6%
UmA	Urban land-Collamer complex 1 to 6 percent slopes	9.8	1.5%
Ut	Urban land-Odessa complex	4.6	0.7%
Uu	Urban land-Schoharie complex	197.5	29.8%
Ux	Urban land-Wassaic	26.0	3.9%
W	Water	31.8	4.8%
WaA	Wassaic silt loam, 0 to 3 percent slopes	22.5	3.4%
WaB	Wassaic silt loam, 3 to 8 percent slopes	43.4	6.5%
Totals for Area of Interest (A	OI)	662.8	100.0%



#### MAP LEGEND

#### Area of Interest (AOI)

Area of Interest (AOI)

#### Soils

Soil Map Units

#### **Special Point Features**

 $\odot$ Blowout

X Borrow Pit

Ж Clay Spot

Closed Depression

× Gravel Pit

**Gravelly Spot** ٨

Ճ Landfill

Lava Flow

Marsh

Mine or Quarry 52

⊚ Miscellaneous Water

Rock Outcrop

◉ Perennial Water

Saline Spot

Sandy Spot

Severely Eroded Spot =

Sinkhole ٥

Slide or Slip

Sodic Spot

3 Spoil Area

Stony Spot

#### Very Stony Spot

Wet Spot

Other

#### **Special Line Features**

2 Gully

Short Steep Slope

11 Other

#### **Political Features**

#### Municipalities

Cities

**Urban Areas** 

#### **Water Features**



Oceans

Streams and Canals

#### Transportation



Rails

### Roads



Interstate Highways



**US Routes** 



State Highways



Local Roads



Other Roads

### MAP INFORMATION

Original soil survey map sheets were prepared at publication scale. Viewing scale and printing scale, however, may vary from the original. Please rely on the bar scale on each map sheet for proper map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL: http://websoilsurvey.nrcs.usda.gov Coordinate System: UTM Zone 17N

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Erie County, New York Survey Area Data: Version 6, Aug 24, 2007

Date(s) aerial images were photographed: 3/28/1995

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

### **Map Unit Legend**

	Erie County, Nev	w York (NY029)	
Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI
CfB	Cayuga silt loam, 3 to 8 percent slopes	45.3	7.7%
CgB	Cazenovia silt loam, 3 to 8 percent slopes	31.4	5.3%
CsA	Collamer silt loam, 0 to 3 percent slopes	6.0	1.0%
CtB	Collamer silt loam, till substratum, 3 to 8 percent slo pes	5.6	1.0%
GaB	Galen very fine sandy loam, 3 to 8 percent slopes	9.3	1.6%
SaA	Schoharie silt loam, 0 to 3 percent slopes	1.1	0.2%
Ud	Urban land	132.3	22.5%
UeB	Urban land-Benson complex, 3 to 6 percent slopes	69.9	11.9%
Ug	Urban land-Cayuga complex	115.2	19.6%
UmA	Urban land-Collamer complex 1 to 6 percent slopes	9.2	1.6%
Ux	Urban land-Wassaic	106.7	18.1%
W	Water	1.6	0.3%
WaA	Wassaic silt loam, 0 to 3 percent slopes		1.3%
WaB Wassaic silt loam, 3 to 8 percent slopes		47.5	8.1%
Totals for Area of Interest (A	OI)	588.9	100.0%



#### MAP LEGEND

### Area of Interest (AOI)

Area of Interest (AOI)

#### Soils

Soil Map Units

#### **Special Point Features**

Blowout

■ Borrow Pit

Clay Spot

Closed Depression

Gravel Pit

.. Gravelly Spot

Landfill

∧ Lava Flow

علد Marsh

Mine or Quarry

Miscellaneous Water

Perennial Water

Rock Outcrop

+ Saline Spot

"." Sandy Spot

Severely Eroded Spot

Sinkhole

Slide or Slip

Spoil Area

Stony Spot

#### Very Stony Spot

Wet Spot

▲ Other

#### Special Line Features

⊋ Gully

- -

Short Steep Slope

Other

#### **Political Features**

#### Municipalities



Cities

Urban Areas

#### Water Features



Oceans

Streams and Canals

#### Transportation



Rails

### Roads



Interstate Highways



US Routes



State Highways



Local Roads



Other Roads

### MAP INFORMATION

Original soil survey map sheets were prepared at publication scale. Viewing scale and printing scale, however, may vary from the original. Please rely on the bar scale on each map sheet for proper map measurements.

Source of Map: Natural Resources Conservation Service Web Soil Survey URL: http://websoilsurvey.nrcs.usda.gov Coordinate System: UTM Zone 17N

This product is generated from the USDA-NRCS certified data as of the version date(s) listed below.

Soil Survey Area: Erie County, New York Survey Area Data: Version 6, Aug 24, 2007


Date(s) aerial images were photographed: 3/28/1995

The orthophoto or other base map on which the soil lines were compiled and digitized probably differs from the background imagery displayed on these maps. As a result, some minor shifting of map unit boundaries may be evident.

### **Map Unit Legend**


Erie County, New York (NY029)						
Map Unit Symbol	Map Unit Name	Acres in AOI	Percent of AOI			
Uc	Udorthents, smoothed	75.3	13.9%			
Ud	Urban land	248.8	46.0%			
UeB	Urban land-Benson complex, 3 to 6 percent slopes	24.4	4.5%			
Ug	Urban land-Cayuga complex	67.4	12.5%			
UmA	Urban land-Collamer complex 1 to 6 percent slopes	80.3	14.9%			
Ux	Urban land-Wassaic	44.3	8.2%			
Totals for Area of Interest (A	OI)	540.5	100.0%			




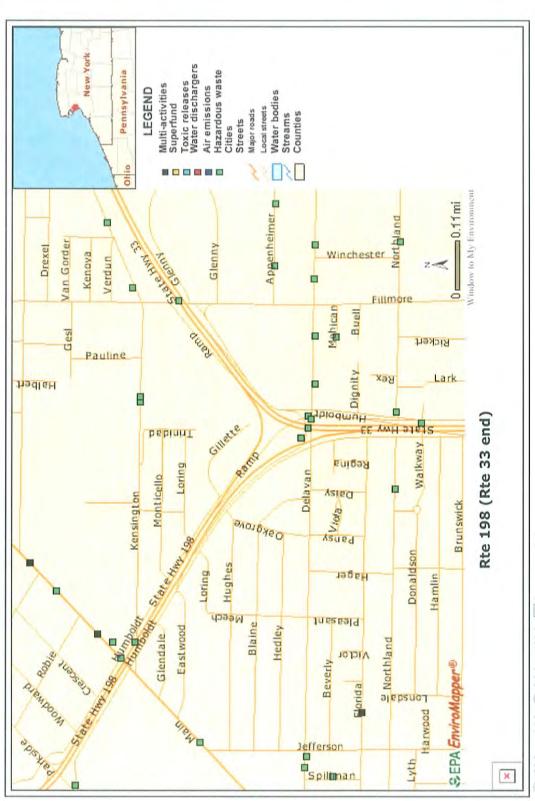

● 600 x 450 ○ 800 x 600 🗹 Locator Map

Submit | Cancel

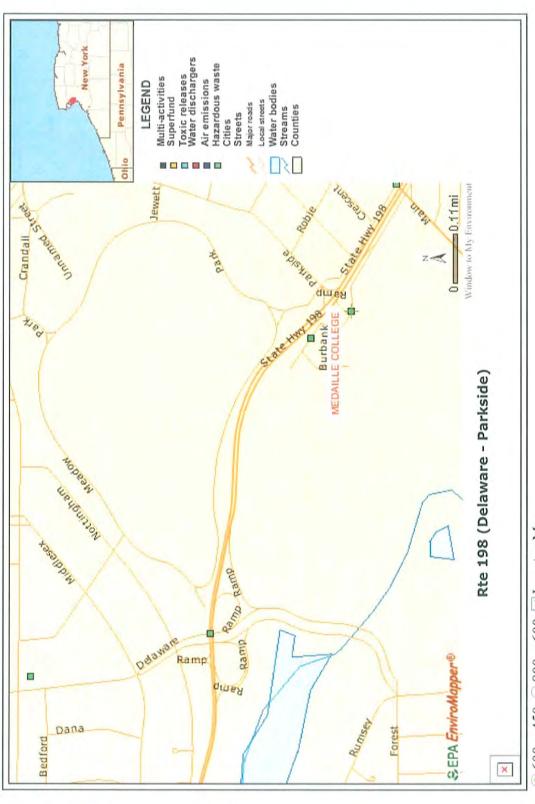


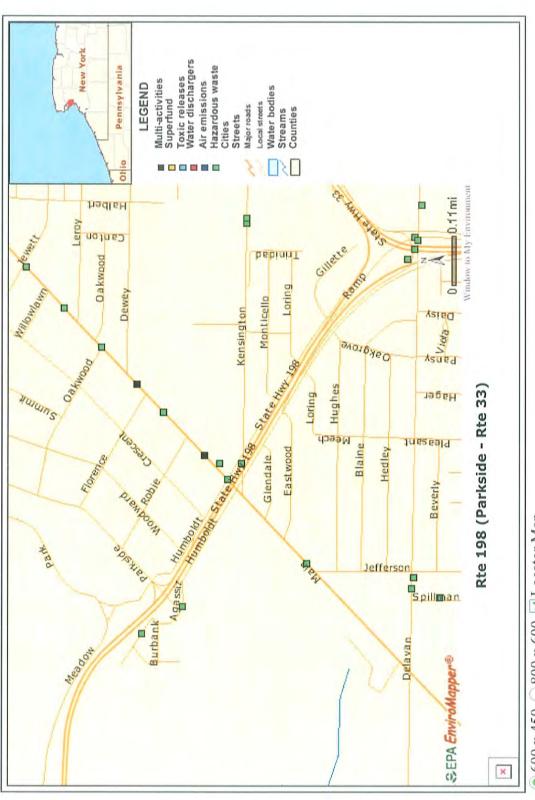

● 600 x 450 ○ 800 x 600 < Locator Map


Submit | Cancel



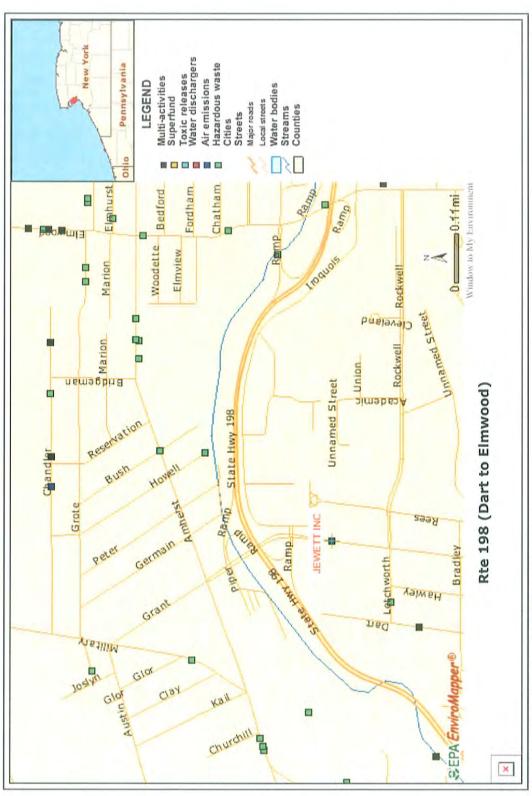

● 600 x 450 ○ 800 x 600 ☑ Locator Map

Cancel Submit

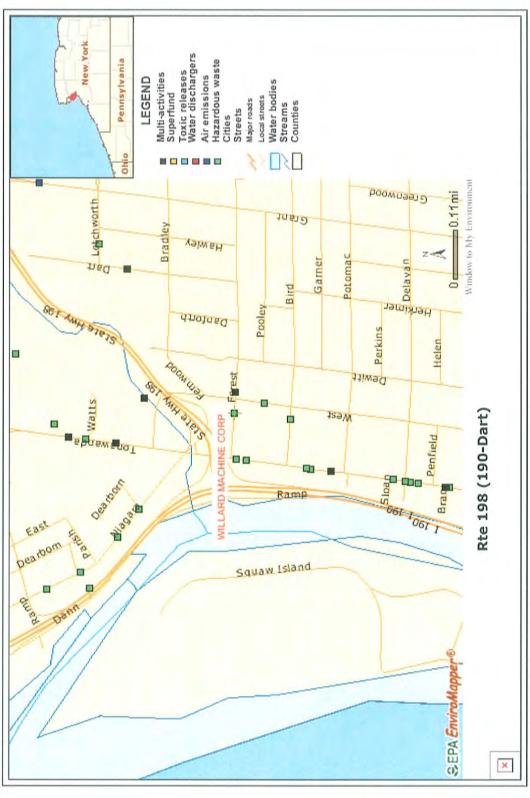



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYR000100982 Last updated on Thursday, May 29th, 2008.

# Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYR000100982

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: BUFFALO CITY OF PARKS DEPT HANDLER ID:

NY0000057240

STREET:

17 MEADOWVIEW PL

FACILITY INFORMATION: View Facility Information

CITY:

**BUFFALO** 

CORPORATE LINK:

No

STATE:

NY

COUNTY:

ERIE

ZIP CODE:

14214

MAPPING INFO:

MAP

EPA REGION:

### **Contact Information**

There is no Core, Notification or BRS contact information available for this handler

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE

Not in a universe

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYR000086207 Last updated on Thursday, May 29th, 2008.

### Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home **RCRAInfo** Query Results Envirofacts



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYR000086207

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: MEDAILLE COLLEGE HANDLER ID:

NYR000086207

STREET:

18 AGASSIZ CIR

FACILITY INFORMATION: View Facility Information CORPORATE LINK:

No

CITY: STATE: **BUFFALO** NY

COUNTY:

ERIE

ZIP CODE:

14214

MAPPING INFO:

MAP

**EPA REGION:** 

### CONTACT INFORMATION

NAME	STREET	CITY	STATE	ZIP CODE	PHONE	TYPE OF CONTACT
GARY BRITTAIN	18 AGASSIZ CIR	BUFFALO	NY	14214	7168843281	Public

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE

Conditionally Exempt Small Generator

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYR000113142

### Resource Conservation and Recovery Act 2008. (RCRAInfo)

You are here: EPA Home Envirofacts **RCRAInfo** Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYR000113142

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

**HANDLER** 

CANISIUS COLLEGE - CAMPION

HANDLER ID:

NYR000113142

NAME:

HALL

**FACILITY** 

View Facility

STREET:

2136 MAIN ST

INFORMATION:

Information

CITY:

**BUFFALO** 

CORPORATE LINK:

No

STATE:

NY

COUNTY:

ERIE

ZIP CODE:

14208

MAPPING INFO:

MAP

**EPA REGION:** 

### CONTACT INFORMATION

NAME	STREET	CITY	STATE	ZIP CODE	PHONE	TYPE OF CONTACT
ED COGAN	MAIN ST	BUFFALO	NY	14208	7168886600	Public

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Small Generator

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYD080328883 Last updated on Thursday, May 29th, 2008.

### Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYD080328883

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

PARKWAY CYTOLOGY LABORATORY HANDLER ID: **HANDLER** 

INC

NYD080328883

STREET: 2121 MAIN ST

FACILITY INFORMATION: View Facility Information

CITY:

CORPORATE LINK:

No

STATE:

NAME:

**BUFFALO** NY

COUNTY:

ERIE

ZIP CODE:

14214

MAPPING INFO:

MAP

EPA REGION:

### **Contact Information**

There is no Core, Notification or BRS contact information available for this handler

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Not in a universe

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/multisys2.get\_list?FACILITY\_UIN=110001568465 Last updated on Thursday, May 29th, 2008.

### Envirofacts Data Warehouse

You are here: EPA Home

Envirofacts

Multisystem

Report



### **MultiSystem Report**



### SISTERS HOSPITAL **2157 MAIN ST** BUFFALO, NY 14214

Map this facility

**EPA Facility Information** 

This guery was executed on MAY-29-2008

### AIRS / AFS Information

PLANT NAME:

COMPLIANCE SISTERS OF CHARITY HOSPITAL SYSTEM PLANT

00101

ID:

**AFS PLANT** 

ID:

9140200465

LATITUDE:

425545

LONGITUDE:

785111

DUNS NUMBER:

074023144

PRINCIPAL PRODUCT:

INVENTORY

90

**EMERGENCY** CONTROL:

YEAR:

POT EMISSIONS BELOW MAJR

CLASS CODE:

SOURCE THRESHOLDS IF

COMPLIANCE

IN VIOLATION WITH REGARD TO BOTH EMISSIONS AND

COMPLIES WITH FED

STATUS:

REGS/LIMITS

PROCEDURAL COMPLIANCE

The current AIRS/AFS database does not have any pollutant data for this facility.

### **RCRAInfo**

**HANDLER ID: NYD156390890** 

No NAICS Codes are available for the facility listed above.

HANDLER TYPE Small Generator	
No Process Information is available for the facility listed above.	
Additional Information can be obtained from Resource Conservation and Recovery I RCRAInfo Query.	Information



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYD982272577 Last updated on Thursday, May 29th, 2008.

## Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYD982272577

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: SEARS ROEBUCK & CO HANDLER ID: NYD982272577

STREET: 420 E DELAVAN AVE FACILITY INFORMATION: View Facility Information

CITY: BUFFALO CORPORATE LINK: No

STATE: NY COUNTY: ERIE

ZIP CODE: 14214 MAPPING INFO: MAP

EPA REGION: 2

### **Contact Information**

There is no Core, Notification or BRS contact information available for this handler

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Small Generator

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYR000044909

### Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYR000044909

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: MARCON ERECTORS INC HANDLER ID:

NYR000044909

STREET:

1 HOWELL ST

FACILITY INFORMATION: View Facility Information

CITY:

**BUFFALO** 

CORPORATE LINK:

No

STATE:

NY

COUNTY:

ERIE

ZIP CODE:

14207

MAPPING INFO:

MAP

EPA REGION:

### CONTACT INFORMATION

NAME	STREET	CITY	STATE	ZIP CODE	PHONE	TYPE OF CONTACT
DOUGLAS GIAMBRONE	1 HOWELL ST	BUFFALO	NY	14207	7168731051	Public

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Large Generator

Go To Top Of The Page



### http://laspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYR000044909

# Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



PAlein Data Disclaimer

Handler ID: Equal To: NYR000044909

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: MARCON ERECTORS INC HANDLER ID:

NYR000044909

STREET:

1 HOWELL ST

FACILITY INFORMATION: View Facility Information

CITY:

**BUFFALO** 

CORPORATE LINK: No

STATE:

NY

COUNTY:

ERIE

ZIP CODE:

14207

MAPPING INFO:

MAP

EPA REGION:

### CONTACT INFORMATION

NAME	STREET	CITY	STATE	ZIP CODE	PHONE	TYPE OF CONTACT
DOUGLAS GIAMBRONE	1 HOWELL ST	BUFFALO	NY	14207	7168731051	Public

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Large Generator

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYD987020625

### Resource Conservation and Recovery Act Last updated on Thursday, May 29th, 2008. (RCRAInfo)

Query Results You are here: EPA Home Envirofacts **RCRAInfo** 



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYD987020625

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME:

HOHL MACHINE & CONVEYOR

COMPANY INC

HANDLER ID:

NYD987020625

STREET:

1580 NIAGARA STREET

FACILITY

View Facility

INFORMATION:

Information

CITY:

**BUFFALO** 

CORPORATE LINK:

No

STATE:

NY

2

COUNTY:

ERIE

ZIP CODE:

14213

MAPPING INFO:

MAP

EPA REGION:

### **Contact Information**

There is no Core, Notification or BRS contact information available for this handler

### HANDLER / FACILITY CLASSIFICATION

HANDLER TYPE Not in a universe

Go To Top Of The Page



### http://iaspub.epa.gov/enviro/multisys2.get\_list?FACILITY\_UIN=110000326898 Last updated on Thursday, May 29th, 2008.

### Envirofacts Data Warehouse

You are here: EPA Home Envirofacts Multisystem Report



### **MultiSystem Report**



### FEDDERS AUTOMOTIVE CO 57 TONAWANDA STREET BUFFALO, NY 142073116

Map this facility

**EPA Facility Information** 

This query was executed on MAY-29-2008

### Toxic Releases for Reporting Year 2002

TRI FACILITY ID: 14207FDCTM57TON

### SIC Codes for 2002

SIC CODE	SIC CODE DESCRIPTION
3714	MOTOR VEHICLE PARTS AND ACCESSORIES

### **Chemicals Transferred to other Sites**

CHEMICAL NAME	TRI CHEM ID	DOCUMENT	RELEASE AMOUNTS LBS/YR	RELEASE BASIS CODE	TYPE OF WASTE MANAGEMENT	
COPPER COMPOUNDS	N100	1302200174997	187	MONITORING DATA	SOLIDIFICATION/STABILIZATION - METALS AND METAL COMPOUNDS ONLY	SI
COPPER COMPOUNDS	N100	1302200174997	52436	MASS BALANCE CALCULATIONS	METALS RECOVERY	L
LEAD COMPOUNDS	N420	1302200175002	2614	MONITORING DATA	SOLIDIFICATION/STABILIZATION - METALS AND METAL COMPOUNDS ONLY	CCSI
LEAD COMPOUNDS	N420	1302200175002	4658	MASS BALANCE CALCULATIONS	METALS RECOVERY	L
LEAD				MONITORING		A

COMPOUNDS N420 1302200175002	99672 DATA	METALS RECOVERY	MR
------------------------------	------------	-----------------	----

#### Chemicals Released to Air

CHEMICAL NAME	TRI CHEM ID	DOCUMENT	RELEASE AMOUNTS LBS/YR	RELEASE BASIS CODE	FUGITIVE OR STACK INDICATOR
LEAD COMPOUNDS	N420	1302200175002	76	I-MISSION	STACK OR POINT EMISSIONS

### Chemicals Released via Underground Injection

There was no data of this type reported for this facility.

### Chemicals Released to Land

There was no data of this type reported for this facility.

### Chemicals Released to Surface Water

There was no data of this type reported for this facility.

Additional Information can be obtained from the Toxics Release Inventory System TRIS Query.

### Additional links for TRI:

This information resource is not maintained, managed, or owned by the Environmental Protection Agency (EPA) or the Envirofacts Support Team. Neither the EPA nor the Envirofacts Support Team is responsible for their content or site operation. The Envirofacts Warehouse provides this reference only as a convenience to our Internet users.

National Library of Medicine (NLM) TOXMAP

• The Environmental Defense Fund's (EDF) Chemical Scorecard has on-line environmental information regarding this facility's reported TRI releases.

### AIRS / AFS Information

DIANT NAME.	FEDCO AUTOMOTIVE	COMPLIANCE	00016
PLANT NAME:	COMPONENTS COMPANY INC.	SYSTEM PLANT ID:	00016

**AFS PLANT** 9140200615

**LATITUDE:** 425543 **LONGITUDE:** 785354

DUNS PRINCIPAL PRODUCT:
INVENTORY 90 EMERGENCY CONTROL:

POTENTIAL UNCONTROLLED COMPLIANCE IN COMPLIANCE WITH

CLASS CODE: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YR STATUS: PROCEDURAL REQUIREMENTS

The current AIRS/AFS database does not have any pollutant data for this facility.

### **RCRAInfo**

**HANDLER ID: NYD002115087** 

### LIST OF NAICS CODES AND DESCRIPTIONS

NAICS CODE	NAICS DESCRIPTION
336399	All Other Motor Vehicle Parts Manufacturing
333415	Air-Conditioning and Warm Air Heating Equipment and Commercial and Industrial Refrigeration Equipment Manufacturing
336312	Gasoline Engine and Engine Parts Manufacturing

### HANDLER / FACILITY CLASSIFICATION

HAI	ND	L	ER	TYP	E
Not	in	a	un	TYP ivers	se

No Process Information is available for the facility listed above.

Additional Information can be obtained from Resource Conservation and Recovery Information RCRAInfo Query.



### http://iaspub.epa.gov/enviro/multisys2.get\_list?FACILITY\_UIN=110000326898 Last updated on Thursday, May 29th, 2008.

### Envirofacts Data Warehouse

You are here: EPA Home Envirofacts Multisystem

Report



### MultiSystem Report



### FEDDERS AUTOMOTIVE CO **57 TONAWANDA STREET BUFFALO, NY 142073116**

Map this facility

**EPA Facility Information** 

This guery was executed on MAY-29-2008

### Toxic Releases for Reporting Year 2002

TRI FACILITY ID: 14207FDCTM57TON

### SIC Codes for 2002

SIC CODE	SIC CODE DESCRIPTION
3714	MOTOR VEHICLE PARTS AND ACCESSORIES

### Chemicals Transferred to other Sites

CHEMICAL NAME	TRI CHEM ID	DOCUMENT	RELEASE AMOUNTS LBS/YR	RELEASE BASIS CODE	TYPE OF WASTE MANAGEMENT
COPPER COMPOUNDS	N100	1302200174997	187	MONITORING DATA	SOLIDIFICATION/STABILIZATION - METALS AND METAL COMPOUNDS ONLY
COPPER COMPOUNDS	N100	1302200174997	52436	MASS BALANCE CALCULATIONS	METALS RECOVERY
LEAD COMPOUNDS	N420	1302200175002	2614	MONITORING DATA	SOLIDIFICATION/STABILIZATION - METALS AND METAL COMPOUNDS ONLY
LEAD COMPOUNDS	N420	1302200175002	4658	MASS BALANCE CALCULATIONS	METALS RECOVERY
LEAD				MONITORING	

COMPOUNDS N420 130220017	5002 99672 DATA	METALS RECOVERY	MR
--------------------------	-----------------	-----------------	----

### Chemicals Released to Air

CHEMICAL NAME	TRI CHEM ID	DOCUMENT	RELEASE AMOUNTS LBS/YR	RELEASE BASIS CODE	FUGITIVE OR STACK INDICATOR
LEAD COMPOUNDS	N420	1302200175002	76	I-MISSION	STACK OR POINT EMISSIONS

### Chemicals Released via Underground Injection

There was no data of this type reported for this facility.

### Chemicals Released to Land

There was no data of this type reported for this facility.

### Chemicals Released to Surface Water

There was no data of this type reported for this facility.

Additional Information can be obtained from the Toxics Release Inventory System TRIS Query.

### Additional links for TRI:

This information resource is not maintained, managed, or owned by the Environmental Protection Agency (EPA) or the Envirofacts Support Team. Neither the EPA nor the Envirofacts Support Team is responsible for their content or site operation. The Envirofacts Warehouse provides this reference only as a convenience to our Internet users.

National Library of Medicine (NLM)

The Environmental Defense Fund's (EDF) Chemical Scorecard has on-line environmental information regarding this facility's reported TRI releases.

### AIRS / AFS Information

PLANT NAME:	FEDCO AUTOMOTIVE COMPONENTS COMPANY INC	COMPLIANCE SYSTEM PLANT ID:	00016
AFS PLANT ID:	9140200615		
LATITUDE:	425543	LONGITUDE:	785354
DUNS NUMBER:		PRINCIPAL PRODUCT:	
INVENTORY YEAR:	90	EMERGENCY CONTROL:	
CLASS CODE:	POTENTIAL UNCONTROLLED	COMPLIANCE	IN COMPLIAN

CLASS CODE: POTENTIAL UNCONTROLLED EMISSIONS < 100 TONS/YR COMPLIANCE STATUS:

IN COMPLIANCE WITH PROCEDURAL REQUIREMENTS

The current AIRS/AFS da	atabase does not l	have any pollutant	data for this facility.
-------------------------	--------------------	--------------------	-------------------------

### **RCRAInfo**

HANDLER ID: NYD002115087

### LIST OF NAICS CODES AND DESCRIPTIONS

NAICS CODE	NAICS DESCRIPTION
336399	All Other Motor Vehicle Parts Manufacturing
333415	Air-Conditioning and Warm Air Heating Equipment and Commercial and Industrial Refrigeration Equipment Manufacturing
336312	Gasoline Engine and Engine Parts Manufacturing

### HANDLER / FACILITY CLASSIFICATION

HAN	1D	L	ER	TYPE
Not	in	а	un	iverse

No Process Information is available for the facility listed above.

Additional Information can be obtained from Resource Conservation and Recovery Information RCRAInfo Query.



### http://laspub.epa.gov/enviro/rcris\_web.report?PGM\_SYS\_ID=NYD986888659 Last updated on Thursday, May 29th, 2008.

# Resource Conservation and Recovery Act (RCRAInfo)

You are here: EPA Home Envirofacts RCRAInfo Query Results



### **Query Results**



Data Disclaimer

Handler ID: Equal To: NYD986888659

Results are based on data extracted on JUN-08-2006

Note: Click on the underlined CORPORATE LINK value for links to that company's environmental

web pages.

Click on the underlined MAPPING INFO value to obtain mapping information for the facility.

Go To Bottom Of The Page

HANDLER NAME: WILLARD MACHINE CORP HANDLER ID:

NYD986888659

STREET:

73 FOREST AVE

FACILITY INFORMATION: View Facility Information

CITY:

BUFFALO

CORPORATE LINK: No

STATE:

NY

COUNTY:

ERIE

ZIP CODE:

14213

MAPPING INFO:

MAP

EPA REGION:


### **Contact Information**


There is no Core, Notification or BRS contact information available for this handler

### HANDLER / FACILITY CLASSIFICATION

Not in a universe

Go To Top Of The Page

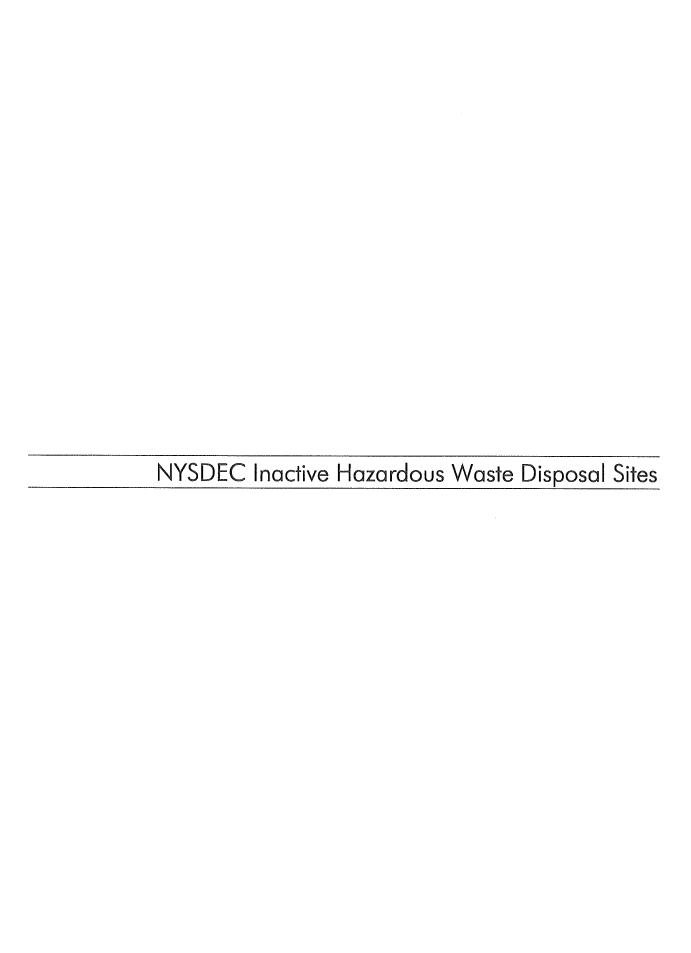

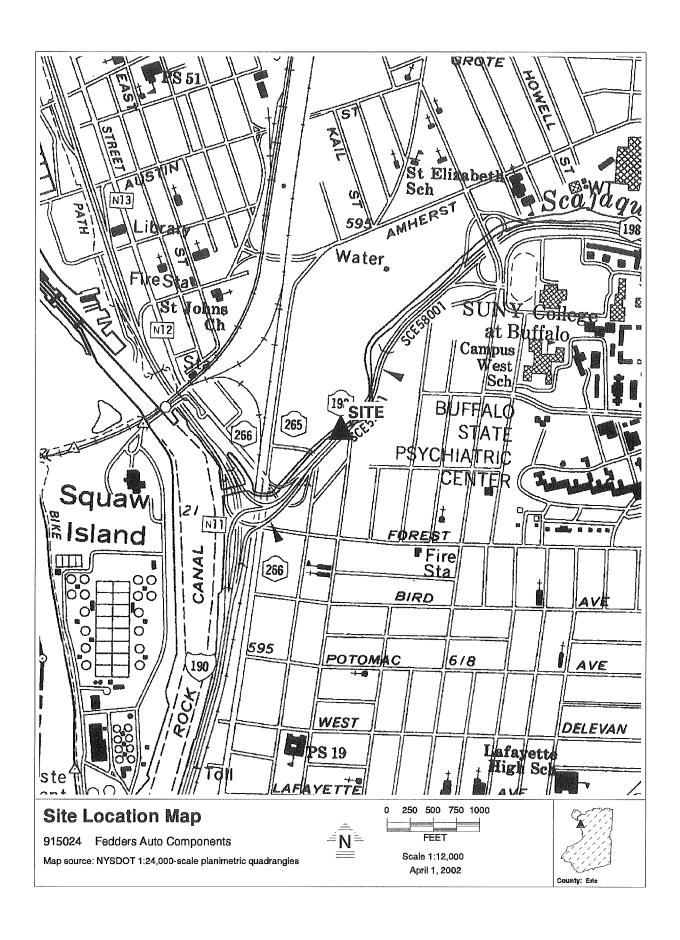

### NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION Division of Environmental Remediation

### **Inactive Hazardous Waste Disposal Report**

County: Erie

Site Name: Fedders Auto Components Site Code: 915024

Region: 9 Address: 57 Tonawanda Street / Buffalo, NY 14207 Latitude: 42° 55' 52" Longitude: 78° 53' 40"

Site Type: Estimated Size: 2 Acres

Site Owner / Operator Information:

Current Owner(s) Name: Fedco Automotive Components

Current Owner(s) Address: 57 Tonawanda Street / Buffalo, NY 14207

Owner(s) during disposal: Fedders Auto Components Operator(s) during disposal: Fedders Auto Components

Stated Operator(s) Address: 57 Tonawanda Street / Buffalo, NY 14207

Hazardous Waste Disposal Period: From: 1974 To: unknown

#### Site Description:

Class Code: 3

The site is the parking lot for the Fedco Automotive Components Company. Historically, waste oils (consisting of hydraulic fluids and light lubrication oils) were spread over the parking area as a dust suppressant. A 1978 Site Inspection reports that solvent still bottoms were used for this purpose as well. Conflicting reports exist as to when this spreading practice was discontinued (1976 vs 1981). In 1981, the lot was covered with gravel so no further dust control measures were necessary. It was alleged that the waste oil contained PCBs. The site is located in an urban commercial and industrial area within the City of Buffalo. The site is immediately adjacent to Scajaguada Creek, Investigations conducted at this site to date include a USEPA Site Inspection, NYSDEC Phase I and Phase II Investigations and a Site Investigation conducted on behalf of Fedco Automotive in 1989.As a result of remedial activities at the adjacent Iroquois Gas/Westwood Pharmaceutical Site # 915141, a highly concentrated oily material was found adjacent to Fedco property in 1998. This material will be removed with extraction wells as part of ongoing remediation for the Iroquois/Westwood Pharmaceutical Company.

Confirmed Hazardous Waste Disposal:

Solvent still bottoms (F001 Waste)

Quantity:

Depth to

165 gallons/year (est.)

Analytical Data Available for: Soil Sediment Groundwater Surface Water Applicable Standards Exceeded in: Groundwater **Drinking Water Surface Water** 

Geotechnical Information:

Soil/Rock Type: Urban fill over silt-rich clay and sand. Groundwater: Range: 1 to 5 feet.

Legal Action: Type: Status:

Remedial Action: Nature of action:

#### Assessment of Environmental Problems:


Volatile organics, PCBs and lead contaminants were detected in site soil and sediments of Scajaguada Creek, VOCs were detected in groundwater. The Scajaquada Creek sediment was remediated in 1998 - 1999 as part of site #915141. The remaining contamination is not currently posing a significant threat to the environment.

#### Assessment of Health Problems:

The site, which is located in an industrial area, is fenced and partially covered with gravel. Therefore, the potential for direct contact with contaminated soil is low. Exposures via drinking water are not expected because the community near the site is served by public water and there are no known private wells in the immediate area.

April 1, 2003

EPA ld: NYD002115087

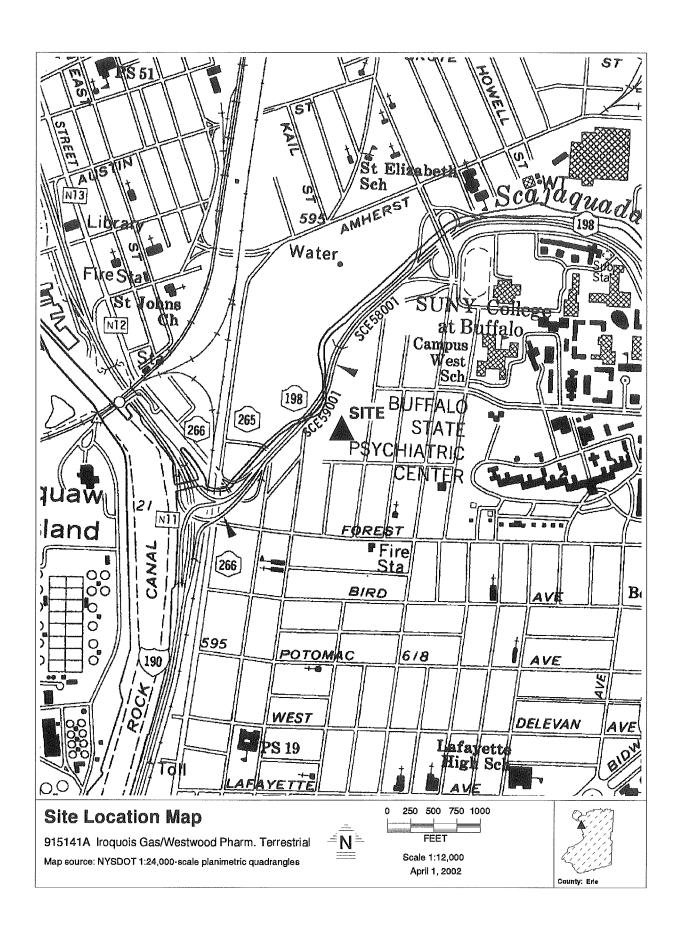

### NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION Division of Environmental Remediation

### **Inactive Hazardous Waste Disposal Report**

Site Name: Iroquois Gas/Westwood Pharm. Terrestrial Site Code: 915141A

Class Code: 4 Region: 9 County: Erie EPA Id:

Address: Dart Street / Buffalo, NY 14201

Latitude: 42° 55' 52" Longitude: 78° 53' 33"

Site Type: Dump Structure Estimated Size: 8.8 Acres

Site Owner / Operator Information:

Current Owner(s) Name: Westwood Squibb

Current Owner(s) Address: 100 Forest Avenue / Buffalo, NY 14213

Owner(s) during disposal: Iroquois Gas (National Fuel Gas)
Operator(s) during disposal: \*\*\* Multiple Site Operators \*\*\*

Stated Operator(s) Address:

Hazardous Waste Disposal Period: From: 1900 To: 1972

#### Site Description:

The site was used by the Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation for the manufacture and storage of gas. Westwood Squibb purchased the site from Iroquois Gas in 1972. During subsequent building construction at the site, soil and groundwater were found to be contaminated with polynuclear aromatic hydrocarbons (PAHs) and benzene, toluene, ethylbenzene and xylene (BTEX). A Remedial Investigation / Feasibility Study (RI/FS) was completed in 1993, and a Record of Decision (ROD) was issued in 1994. A Consent Decree issued by Federal Court in 1995 required Westwood to implement the approved remedy at this site. Westwood started the remedial construction in 1996 and completed the project in 1997. The remedy consists of contaminated groundwater and nonaqueous phase liquid (NAPL) containment and removal through the utilization of a pump and treat system. Six extraction wells were installed to pump contaminated groundwater and NAPL from the subsurface. An on-site treatment facility provides NAPL removal and pre-treatment of groundwater. The treated groundwater is then discharged to the municipal sewer system for further treatment at the Buffalo Sewer Authority (BSA). Recovered NAPL is disposed off site as hazardous waste. A sheet pile wall was installed to enhance the pump and treat system and to prevent migration of contaminated groundwater from the site to Scajaquada Creek. Surficial improvements to control storm water percolation into the subsurface were provided through a combination of site grading and soil and pavement covers. The system became operational in 1997. The site is now in long-term operation and maintenance (O&M).

Confirmed Hazardous Waste Disposal:

Sludges from gas manufacturing

Soils contaminated with oil

Chlorinated Hydrocarbons

Polynuclear Aromatic Hydrocarbons (PAHs)

Phenols

Heavy Metals

Quantity:

unknown

unknown

unknown

unknown

unknown

unknown

Analytical Data Available for: Groundwater Surface Water Soil Sediment

Applicable Standards Exceeded in: Groundwater

Geotechnical Information: Depth to

Soil/Rock Type: Fill mixed with silt, sand and gravel. Groundwater: Range: 5 to 10 feet.

Legal Action: Type: Federal Consent Decree Status: Order Signed

Remedial Action: Complete Nature of action: Contain + cap + pump & treat + runoff control.


#### **Assessment of Environmental Problems:**

Monitoring indicates that the wastes are effectively contained as a result of the remedial construction and the pump/treat operation. Long term pump and treat system and maintenance of the cap insures that the environmental problems are addressed.

#### Assessment of Health Problems:

Exposures via drinking water are not expected because homes in the area are served by public water and no known private wells exist in the immediate area. The entire site has been capped or paved and on-site access is restricted by fencing and 24-hour security which eliminates the potential for direct contact exposures to on-site contaminants.

April 1, 2003

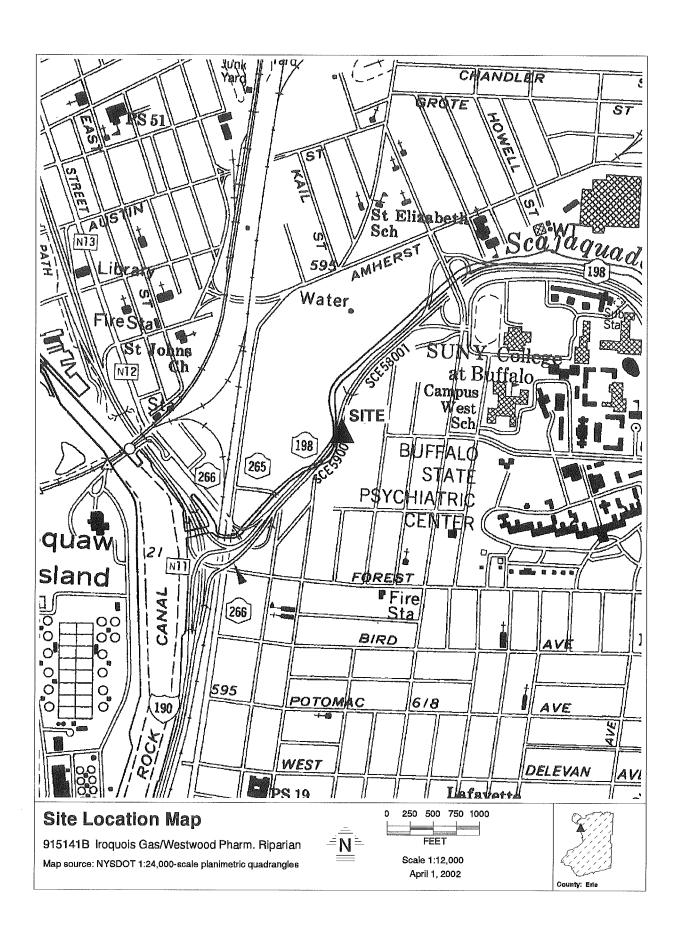

## NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION Division of Environmental Remediation

## **Inactive Hazardous Waste Disposal Report**

Site Name: Iroquois Gas/Westwood Pharm. Riparian Site Code: 915141B

Class Code: Region: 9 County: Erie EPA Id:

Address: Scajaguada Creek - upstream of West Ave. Bridge / Buffalo, NY 14201

Latitude: 42° 55' 56" Longitude: 78° 53' 35"

Site Type: Estimated Size: < 1 Acres

Site Owner / Operator Information:

Current Owner(s) Name: New York State

Current Owner(s) Address:

Owner(s) during disposal: Iroquois Gas (National Fuel Gas) Operator(s) during disposal: Iroquois Gas (National Fuel Gas)

Stated Operator(s) Address: 10 Lafayette Square / Buffalo, NY 14203

Hazardous Waste Disposal Period: From: 1900 To: 1972

## Site Description:

The site is a 1600 foot long section of the Scajaquada Creek, extending upstream from the West Ave. Bridge. Iroquois Gas Company, predecessor to National Fuel Gas Distribution Corporation operated a manufactured gas plant during the early and middle part of the 1900s, in an area on the south bank of the creek on Dart Street. The wastes from the plant operations entered the creek via discharges from piped outlets, spills, and movement of surface and groundwater. The creek sediments were contaminated with high levels of polynuclear aromatic hydrocarbons (PAHs), benzene, toluene, ethylbenzene, and xylene (BTEX), the same as those found at the Terrestrial Site #915141A... A Record of Decision (ROD) signed in 1994, selected a site remedy that required removal of contaminated stream sediments and off site disposal. A Consent Decree issued by Federal Court in 1995 directed National Fuel Gas to implement the remedy and remove the sediments to a depth of six feet, as was found contaminated during the remedial investigation. The presence of I-198 expressway bridge piers at the site did not allow the removal of all contaminated sediments to the maximum depth in some areas of the creek. Remedial Design was therefore, modified to include removal of the sediments, coupled with capping of the stream bed to contain any residual contaminants and long term pumping of two deep pockets of non-aqueous phase liquid (NAPL) from the substrata of the creek. Remedial Action (RA) was started in August 1998. and was completed in 2001. Approximately 19,000 cubic yards of contaminated sediments were excavated and disposed off-site. An 18 inch thick stream bed cap, comprised of geo-synthetic clay liner overlain by sand, geotextile and stones was installed after excavation and removal of the sediments. Restoration of aquatic habitat was included as a part of the RA to enhance the re-establishment of the stream fishery. Two NAPL recovery wells were installed using directional drilling technology to recover the NAPL from the substrata of the creek and both wells are operating. Long-term O&M is underway at the site.

Confirmed Hazardous Waste Disposal: polynuclear aromatic hydrocarbons (PAHs) benzene, toulene, ethylbenzene, xylene (BTEX) Quantity: unknown unknown

Analytical Data Available for: Surface Water Sediment

Soil/Rock Type: Fill mixed with silt, sand and gravel.

Applicable Standards Exceeded in:

Geotechnical Information:

Depth to

Groundwater: Range: 1 to 5 feet.

Legal Action: Type: Federal Consent Decree Status: **Order Signed** 

Remedial Action: Complete Nature of action: Remedial Construction.


#### Assessment of Environmental Problems:

Removal and off-site disposal of contaminated sediments, installation of the stream bed cap, aquatic habitat restoration and NAPL recovery under the long-term O&M plan have effectively addressed the environmental impacts at the site. The majority of wastes have been/or are being removed and containment of residuals is provided.

### Assessment of Health Problems:

Exposures via drinking water are not expected because homes and businesses in the area are served by public water and no known private wells or public water intakes exist in the immediate area. The remediation of Scajaguada Creek sediments reduced the potential for direct contact exposure to site-related contaminants.

April 1, 2003

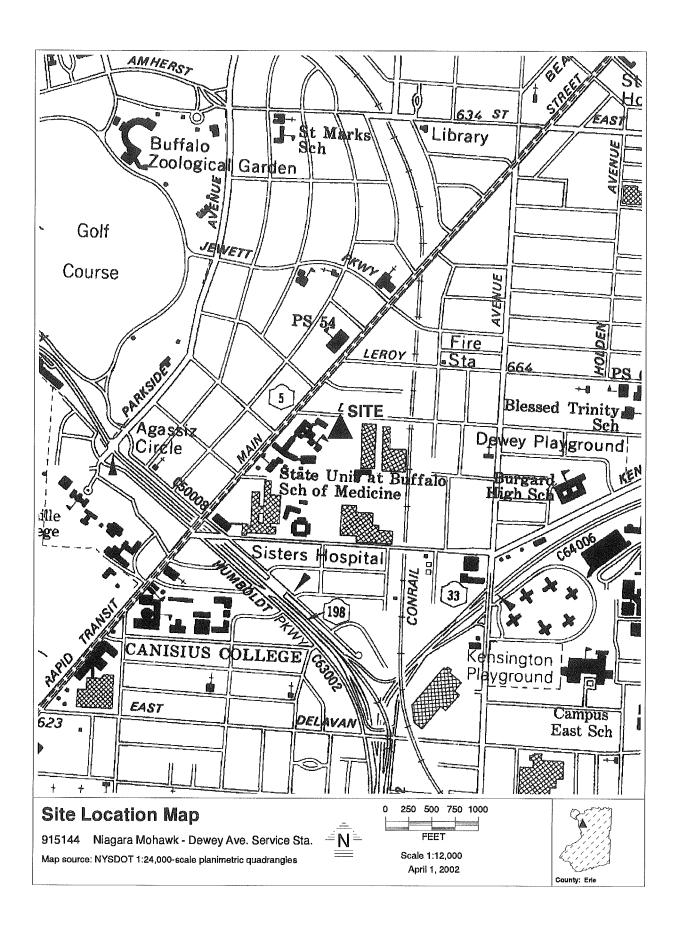

# NEW YORK STATE DEPARTMENT OF ENVIRONMENTAL CONSERVATION

Division of Environmental Remediation

**Inactive Hazardous Waste Disposal Report** April 1, 2003

Site Name: Niagara Mohawk - Dewey Ave. Service Sta. Site Code: 915144

Class Code: 5 Region: 9 County: Erie EPA Id:

Address: 144 Kensington Avenue / Buffalo, NY 14214 Latitude: 42° 55' 53" Longitude: 78° 50' 44"

Site Type: Structure Estimated Size: Acres

Site Owner / Operator Information:

Current Owner(s) Name: Niagara Mohawk Power Corporation

Current Owner(s) Address: 300 Erie Boulevard West / Syracuse, NY 13202

during disposal: Niagara Mohawk Power Corporation Operator(s) during disposal: Niagara Mohawk Power Corporation

Stated Operator(s) Address: 300 Erie Boulevard West / Syracuse, NY 13202

Hazardous Waste Disposal Period: From: early 30s To: present

## Site Description:

The Niagara Mohawk Dewey Ave. Service Station has been servicing electrical equipment with PCB's since the early 1930's, well before PCB's came under regulation.

Concerns about potential PCB contamination of soil and groundwater by prior operations was raised during the public meetings for a DEC permit for the new facility. A sampling analysis indicated three areas of PCB contamination along the property line bordering the St. Mary's School for the Deaf athletic field, with some migration onto the athletic field. Levels were 20 to 230 ppm PCB on Niagara Mohawk property, 0 to 54 ppm on the school athletic field.

Remedial measures were taken by Niagara Mohawk under a Consent Order work plan. The measures included excavation and removal of contaminated soils. The work was concluded in 1990. No further action is needed.

**Confirmed Hazardous Waste Disposal:** 

PCB's

Quantity:

unknown

Soil contamination as high as 230 ppm was encountered

Analytical Data Available for: Soil

Applicable Standards Exceeded in:

Geotechnical Information:

Depth to

Groundwater: Soil/Rock Type: Organic-rich silt and sand.

Legal Action: Type: State Consent Order Status: Order Signed

Remedial Action: Complete Nature of action: Contaminated soil removal.

## Assessment of Environmental Problems:

In response to community concern expressed at a public meeting during notice of a DEC permit, a soil sampling program was initiated. PCBs in soils found during this program were subsequently removed from the site. No further action is needed.

### Assessment of Health Problems:

Exposures via drinking water are not expected because public water serves the area. Contaminated soils were removed and replaced with clean soils. These actions eliminated the potential for exposure to site-related PCB contamination.

Range: 20 to 25 feet.

Parcel Information

Site B: B&B Collision – 1660 Niagara St

	Parcel Information			
PIN	1402000885800004008000	TOTAL ASSESSMENT	\$70,000	
SBL	88.58-4-8	LAND ASSESSMENT	\$32,800	
ADDRESS	1660 NIAGARA	COUNTY TAXES	\$70,000	
OWNER	RORES THEODORE J	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1457 E PARK RD	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	GRAND ISLAND NY, 14072 + 2318	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	433 - C - Auto body	ACTIVE	А	
CALCULATED ACREAGE	0.385	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	356.27999877	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10872	BEDS	0	
DEED PAGE	8833	BATHS	0	
DEED DATE	06/17/1994			

Site C: Zeller Electric – 1675 Niagara St

	Parcel Information			
PIN	1402000885800004001100	TOTAL ASSESSMENT	\$197,400	
SBL	88.58-4-1.1	LAND ASSESSMENT	\$10,900	
ADDRESS	1675 NIAGARA	COUNTY TAXES	\$197,400	
OWNER	ZELLER ERIC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	664 ROCK BEACH RD	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	ROCHESTER NY, 14617 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А	
CALCULATED ACREAGE	0.505	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	200	HEATING		
DEPTH	165	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10192	BEDS	0	
DEED PAGE	00766	BATHS	0	
DEED DATE	07/13/1990			

Site D: Railroad ROW – Niagara St

	Parcel I	nformation	
PIN	1402000885800004003000	TOTAL ASSESSMENT	\$0
SBL		LAND ASSESSMENT	\$0
ADDRESS	0	COUNTY TAXES	\$0
OWNER	CONRAIL	TOWN TAXES	\$0
OWNER2		SCHOOL TAXES	\$0
MAILING ADDRESS		VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	, +	SCHOOL DISTRICT	(0)
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	0	ACTIVE	
CALCULATED ACREAGE	0.487	SQFT LIVING AREA	0
ASSESSED ACREAGE	0	CONDITION	
FRONTAGE	0	HEATING	
DEPTH	0	BASEMENT	
DEED ROLL	0	FIREPLACE	0
DEED BOOK	8706	BEDS	0
DEED PAGE	513	BATHS	0
DEED DATE	10/11/1978		

Site E: Niagara Mohawk – 1626 Niagara St

	Parcel Information			
PIN	1402000885800004010000	TOTAL ASSESSMENT	\$21,600	
SBL	88.58-4-10	LAND ASSESSMENT	\$21,600	
ADDRESS	1626 NIAGARA	COUNTY TAXES	\$21,600	
OWNER	NIA MOHAWK POWER CORP	TOWN TAXES	\$0	
OWNER2	REAL ESTATE TAX DEPT	SCHOOL TAXES	\$0	
MAILING ADDRESS	300 ERIE BLVD WEST - BLDG	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	SYRACUSE NY, 13202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	882 - C - Elec Trans Imp	ACTIVE	А	
CALCULATED ACREAGE	0.181	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	148	HEATING		
DEPTH	75	BASEMENT		
DEED ROLL	6	FIREPLACE	0	
DEED BOOK	00533	BEDS	0	
DEED PAGE	00205	BATHS	0	
DEED DATE	09/01/1987			

Site G: City of Buffalo Park — Niagara St

	Parcel Information			
PIN	1402000885800004999000	TOTAL ASSESSMENT	\$0	
SBL		LAND ASSESSMENT	\$0	
ADDRESS	0	COUNTY TAXES	\$0	
OWNER		TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS		VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	, +	SCHOOL DISTRICT	(0)	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	0	ACTIVE		
CALCULATED ACREAGE	0.371	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	0	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	0	FIREPLACE	0	
DEED BOOK		BEDS	0	
DEED PAGE		BATHS	0	
DEED DATE				

Site H: City of Buffalo Park Bike Path Area beneath Route 198 – Niagara St

	Parcel Information			
PIN	1402000885800001999000	TOTAL ASSESSMENT	\$0	
SBL		LAND ASSESSMENT	\$0	
ADDRESS	0	COUNTY TAXES	\$0	
OWNER		TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS		VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	, +	SCHOOL DISTRICT	(0)	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	0	ACTIVE		
CALCULATED ACREAGE	0.475	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	0	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	0	FIREPLACE	0	
DEED BOOK		BEDS	0	
DEED PAGE		BATHS	0	
DEED DATE				

Site I: Hohl Machine & Conveyor Co. – 1540-1590 Niagara St

	Parcel Information			
PIN	1402000886600003002000	TOTAL ASSESSMENT	\$193,000	
SBL	88.66-3-2	LAND ASSESSMENT	\$15,300	
ADDRESS	1590 NIAGARA	COUNTY TAXES	\$193,000	
OWNER	HOHL MACHINE AND CONVEYOR	TOWN TAXES	\$0	
OWNER2	CO INC	SCHOOL TAXES	\$0	
MAILING ADDRESS	1590 NIAGARA ST	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 + 1158	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	A	
CALCULATED ACREAGE	0.743	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	611	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10185	BEDS	0	
DEED PAGE	00426	BATHS	0	
DEED DATE	06/20/1990			

Site J: Vincent's Self-Storage — 1573 Niagara St

	Parcel Information			
PIN	1402000886600001028000	TOTAL ASSESSMENT	\$100,000	
SBL	88.66-1-28	LAND ASSESSMENT	\$16,300	
ADDRESS	1569 NIAGARA	COUNTY TAXES	\$100,000	
OWNER	DIRE PROPERTIES LTD	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1589 NIAGARA	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	A	
CALCULATED ACREAGE	0.771	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	148.5	HEATING		
DEPTH	220	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11053	BEDS	0	
DEED PAGE	6280	BATHS	0	
DEED DATE	02/08/2008			

Site K: Infinity Architectural Windows — 1555 Niagara St

	Parcel Information			
PIN	1402000886600001027000	TOTAL ASSESSMENT	\$122,500	
SBL	88.66-1-27	LAND ASSESSMENT	\$16,300	
ADDRESS	1555 NIAGARA	COUNTY TAXES	\$122,500	
OWNER	INFINITY ARCHITECTURAL SYSTEMS	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1555 NIAGARA ST	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFAŁO NY, 14213 + 1101	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А	
CALCULATED ACREAGE	0.755	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	148.5	HEATING		
DEPTH	220	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11080	BEDS	0	
DEED PAGE	493	BATHS	0	
DEED DATE	07/26/2004			

Site L: G&G Sunoco Gas Station -1531-1543 Niagara St

	Parcel Information			
PIN	1402000886600001025100	TOTAL ASSESSMENT	\$150,000	
SBL	88.66-1-25.1	LAND ASSESSMENT	\$76,400	
ADDRESS	1531 NIAGARA	COUNTY TAXES	\$150,000	
OWNER	QUAL ECON LEASE CO INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1531-1543 NIAGARA ST	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	486 - C - Mini-mart	ACTIVE	А	
CALCULATED ACREAGE	0.878	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	214.5	HEATING		
DEPTH	280	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10818	BEDS	0	
DEED PAGE	310	BATHS	0	
DEED DATE	12/14/1993			

Site M: Rascal's Restaurant – 1516 Niagara St

	Parcel Information			
PIN	1402000886600003003000	TOTAL ASSESSMENT	\$125,000	
SBL	88.66-3-3	LAND ASSESSMENT	\$16,500	
ADDRESS	1516 NIAGARA	COUNTY TAXES	\$125,000	
OWNER	QUAL-ECON LEASING CO INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1516 NIAGARA	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	422 - C - Diner/lunch	ACTIVE	А	
CALCULATED ACREAGE	0.188	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	165	HEATING		
DEPTH	50	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10892	BEDS	0	
DEED PAGE	3697	BATHS	0	
DEED DATE	10/12/1995			

Site N: Contract Pharmaceuticals Limited Niagara Parking Lot -80 Forest Ave

	Parcel Information			
PIN	1402000885800001003100	TOTAL ASSESSMENT	\$49,600	
SBL	88.58-1-3.1	LAND ASSESSMENT	\$33,100	
ADDRESS	80 FOREST	COUNTY TAXES	\$49,600	
OWNER	WESTWOOD-SQUIBB	TOWN TAXES	\$0	
OWNER2	PHARMACEUTICALS INC.	SCHOOL TAXES	\$0	
MAILING ADDRESS	100 FOREST AVE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	331 - B - Com vac w/imp	ACTIVE	А	
CALCULATED ACREAGE	1.96	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	340	HEATING		
DEPTH	395	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11100	BEDS	0	
DEED PAGE	2611	BATHS	0	
DEED DATE	08/26/2005			

Site O: Vacant Lot – Former Pratt and Lambert, Lacquer Plant – 1451 West Ave

	Parcel Information			
PIN	1402000885800002002000	TOTAL ASSESSMENT	\$43,100	
SBL	88.58-2-2	LAND ASSESSMENT	\$43,100	
ADDRESS	1409 WEST	COUNTY TAXES	\$43,100	
OWNER	PRATT & LAMBERT INC	TOWN TAXES	\$0	
OWNER2	C/O ATTN: TAX DEPARTMENT	SCHOOL TAXES	\$0	
MAILING ADDRESS	PO BOX 6027	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	CLEVELAND OH, 44115 + 6027	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	A	
CALCULATED ACREAGE	2.249	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	344	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	01726	BEDS	0	
DEED PAGE	00004	BATHS	0	
DEED DATE	11/21/1923			

Site P: Contract Pharmaceuticals Limited Niagara – 100 Forest Ave

	Parcel Information			
PIN	1402000885800002004110	TOTAL ASSESSMENT	\$3,000,000	
SBL	88.58-2-4.11	LAND ASSESSMENT	\$158,200	
ADDRESS	100 FOREST	COUNTY TAXES	\$3,000,000	
OWNER	WESTWOOD-SQUIBB	TOWN TAXES	\$0	
OWNER2	PHARMACEUTICALS INC.	SCHOOL TAXES	\$0	
MAILING ADDRESS	100 FOREST AVE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А	
CALCULATED ACREAGE	8.415	SQFT LIVING AREA	0	
ASSESSED ACREAGE	8.97000026	CONDITION		
FRONTAGE	486	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11100	BEDS	0	
DEED PAGE	2611	BATHS	0	
DEED DATE	08/26/2005			

Site P: Contract Pharmaceuticals Limited Niagara — 100 Forest Ave

	Parcel Information			
PIN	1402000885000001005100	TOTAL ASSESSMENT	\$1,250,000	
SBL	88.50-1-5.1	LAND ASSESSMENT	\$79,100	
ADDRESS	40 BRADLEY	COUNTY TAXES	\$1,250,000	
OWNER	WESTWOOD-SQUIBB	TOWN TAXES	\$0	
OWNER2	PHARMACEUTICALS INC.	SCHOOL TAXES	\$0	
MAILING ADDRESS	100 FOREST AVE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А	
CALCULATED ACREAGE	4.725	SQFT LIVING AREA	0	
ASSESSED ACREAGE	4.65999984	CONDITION		
FRONTAGE	619.92999267	HEATING		
DEPTH	265.33999633	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11100	BEDS	0	
DEED PAGE	2611	BATHS	0	
DEED DATE	08/26/2005			

Site P: Contract Pharmaceuticals Limited Niagara - 100 Forest Ave

	Parcel Information			
PIN	1402000885000001005200	TOTAL ASSESSMENT	\$1,500,000	
SBL	88.50-1-5.2	LAND ASSESSMENT	\$81,200	
ADDRESS	120 DART	COUNTY TAXES	\$1,500,000	
OWNER	WESTWOOD-SQUIBB	TOWN TAXES	\$0	
OWNER2	PHARMACEUTICALS INC.	SCHOOL TAXES	\$0	
MAILING ADDRESS	100 FOREST AVE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	A	
CALCULATED ACREAGE	4.528	SQFT LIVING AREA	0	
ASSESSED ACREAGE	4.53999996	CONDITION		
FRONTAGE	466.76998901	HEATING		
DEPTH	456.54000854	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11100	BEDS	0	
DEED PAGE	2611	BATHS	0	
DEED DATE	08/26/2005			

Site Q: Pagan Auto Sales — 18 Tonawanda St

	Parcel Information			
PIN	1402000885800004006000	TOTAL ASSESSMENT	\$43,100	
SBL	88.58-4-6	LAND ASSESSMENT	\$9,500	
ADDRESS	18 TONAWANDA	COUNTY TAXES	\$43,100	
OWNER	RHOADES JAMES	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	18 TONAWANDA ST	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	482 - C - Det row bldg	ACTIVE	А	
CALCULATED ACREAGE	0.125	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	99.25	HEATING		
DEPTH	54	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11007	BEDS	0	
DEED PAGE	00768	BATHS	0	
DEED DATE	05/29/2002			

Site R: Fort Knox Business Center – 31 Tonawanda St

	Parcel Information			
PIN	1402000885800001001000	TOTAL ASSESSMENT	\$550,700	
SBL	88.58-1-1	LAND ASSESSMENT	\$42,200	
ADDRESS	31 TONAWANDA	COUNTY TAXES	\$550,700	
OWNER	BLACK ROCK TRADE CENTER INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	70 TONAWANDA	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А	
CALCULATED ACREAGE	1.854	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	367.9500122	HEATING		
DEPTH	230	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11091	BEDS	0	
DEED PAGE	9754	BATHS	0	
DEED DATE	03/09/2005			

Site R: Fort Knox Business Center – 31 Tonawanda St

	Parcel Inf	ormation	
PIN	1402000885000001008110	TOTAL ASSESSMENT	\$43,500
SBL	88.50-1-8.11	LAND ASSESSMENT	\$37,800
ADDRESS	71 TONAWANDA	COUNTY TAXES	\$43,500
OWNER	BLACK ROCK TRADE CENTER	TOWN TAXES	\$0
OWNER2		SCHOOL TAXES	\$0
MAILING ADDRESS	120 TONAWANDA ST	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А
CALCULATED ACREAGE	1.491	SQFT LIVING AREA	0
ASSESSED ACREAGE	1.75999999	CONDITION	
FRONTAGE	246	HEATING	
DEPTH	165	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	10120	BEDS	0
DEED PAGE	00627	BATHS	0
DEED DATE	03/09/2005	]	

Site R: Fort Knox Business Center – 31 Tonawanda St

	Parcel Information			
PIN	1402000885000001008210	TOTAL ASSESSMENT	\$210,000	
SBL	88.50-1-8.21	LAND ASSESSMENT	\$66,000	
ADDRESS	57 TONAWANDA	COUNTY TAXES	\$210,000	
OWNER	BLACK ROCK TRADE CENTER INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	70 TONAWANDA	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	464 - C - Office bldg.	ACTIVE	А	
CALCULATED ACREAGE	1.097	SQFT LIVING AREA	0	
ASSESSED ACREAGE	1.07000005	CONDITION		
FRONTAGE	32	HEATING		
DEPTH	165	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11091	BEDS	0	
DEED PAGE	9754	BATHS	0	
DEED DATE	03/09/2005			

Site S: Vacant Lot – Former Pratt and Lambert, Paint and Varnish Plant – 75 Tonawanda St

	Parcel Information			
PIN	1402000885000001010000	TOTAL ASSESSMENT	\$80,600	
SBL	88.50-1-10	LAND ASSESSMENT	\$80,600	
ADDRESS	73 TONAWANDA	COUNTY TAXES	\$80,600	
OWNER	PRATT & LAMBERT INC	TOWN TAXES	\$0	
OWNER2	C/O ATTN: TAX DEPARTMENT	SCHOOL TAXES	\$0	
MAILING ADDRESS	PO BOX 6027	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	CLEVELAND OH, 44115 + 6027	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	A	
CALCULATED ACREAGE	7.417	SQFT LIVING AREA	0	
ASSESSED ACREAGE	7.5999999	CONDITION		
FRONTAGE	307	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	06412	BEDS	0	
DEED PAGE	00197	BATHS	0	
DEED DATE	05/20/1940			

Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

	Parcel Information			
PIN	1402000885000001001100	TOTAL ASSESSMENT	\$375,000	
SBL	88.50-1-1.1	LAND ASSESSMENT	\$51,400	
ADDRESS	117 TONAWANDA	COUNTY TAXES	\$375,000	
OWNER	LYONS WILLIAM DAVID	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	111 TONAWANDA ST	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	A	
CALCULATED ACREAGE	2.36	SQFT LIVING AREA	0	
ASSESSED ACREAGE	2.35999989	CONDITION		
FRONTAGE	250	HEATING		
DEPTH	550	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10974	BEDS	0	
DEED PAGE	05897	BATHS	0	
DEED DATE	12/30/1975			

Site 1: Great Arrow Auto Repair, Gal Auto, Lanza Auto Works, Litt-Ruy Moius, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

	Parcel Information				
PIN	1402000885000001002000	TOTAL ASSESSMENT	\$15,000		
SBL	88.50-1-2	LAND ASSESSMENT	\$3,100		
ADDRESS	121 TONAWANDA	COUNTY TAXES	\$15,000		
OWNER	MARASCHIELLO JUNE TRUSTEE	TOWN TAXES	\$0		
OWNER2	TRIFILO PATTI JO TRUSTEE	SCHOOL TAXES	\$0		
MAILING ADDRESS	4 HENDRICKS BLVD	VILLAGE TAXES	\$0		
CITY/ZIP/ZIP4	AMHERST NY, 14226 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO		
MUNICIPALITY	City of Buffalo	YEAR BUILT	0		
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А		
CALCULATED ACREAGE	0.072	SQFT LIVING AREA	0		
ASSESSED ACREAGE	0	CONDITION			
FRONTAGE	78.87999725	HEATING			
DEPTH	80	BASEMENT			
DEED ROLL	1	FIREPLACE	0		
DEED BOOK	11080	BEDS	0		
DEED PAGE	6955	BATHS	0		
DEED DATE	08/05/2004				

Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

	Parcel Information			
PIN	1402000885000001004000	TOTAL ASSESSMENT	\$55,000	
SBL	88.50-1-4	LAND ASSESSMENT	\$11,800	
ADDRESS	125 TONAWANDA	COUNTY TAXES	\$55,000	
OWNER	CHAMELI MICHAEL J;ALTMAN	TOWN TAXES	\$0	
OWNER2	SUSAN M;CHAMELI JEFFERY J	SCHOOL TAXES	\$0	
MAILING ADDRESS	6440 CONNER RD	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	EAST AMHERST NY, 14051 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А	
CALCULATED ACREAGE	0.408	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	158.17999267	HEATING		
DEPTH	149.72000122	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10311	BEDS	0	
DEED PAGE	00499	BATHS	0	
DEED DATE	07/24/1991			

Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

Parcel Information			
PIN	1402000885000001003100	TOTAL ASSESSMENT	\$100,000
SBL	88.50-1-3.1	LAND ASSESSMENT	\$25,900
ADDRESS	129 TONAWANDA	COUNTY TAXES	\$100,000
OWNER	ANDROSS GEORGE R 2/3 INT	TOWN TAXES	\$0
OWNER2	WILKINSON JOAN P 1/3 INT	SCHOOL TAXES	\$0
MAILING ADDRESS	133 TONAWANDA ST	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14207 + 3116	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А
CALCULATED ACREAGE	1.136	SQFT LIVING AREA	0
ASSESSED ACREAGE	1.19000005	CONDITION	
FRONTAGE	7.2800002	HEATING	
DEPTH	362.86999511	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	11105	BEDS	0
DEED PAGE	6390	BATHS	0
DEED DATE	11/29/2005		

Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

Parcel Information			
PIN	1402000885000001003200	TOTAL ASSESSMENT	\$175,000
SBL	88.50-1-3.2	LAND ASSESSMENT	\$7,500
ADDRESS	133 TONAWANDA	COUNTY TAXES	\$175,000
OWNER	ANDROSS GEORGE R 2/3 INT	TOWN TAXES	\$0
OWNER2	WILKINSON JOAN P 1/3 INT	SCHOOL TAXES	\$0
MAILING ADDRESS	133 TONAWANDA ST	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14207 + 3116	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А
CALCULATED ACREAGE	0.354	SQFT LIVING AREA	0
ASSESSED ACREAGE	0	CONDITION	
FRONTAGE	55	HEATING	
DEPTH	285	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	11105	BEDS	0
DEED PAGE	6390 ·	BATHS	0
DEED DATE	11/29/2005		

Site T: Great Arrow Auto Repair, G&L Auto, Lanza Auto Works, Em-Kay Molds, Marsh Metal Plating, and Kellex Polymers — 125-137 Tonawanda St

Parcel Information			
PIN	1402000885000001003320	TOTAL ASSESSMENT	\$9,700
SBL	88.50-1-3.32	LAND ASSESSMENT	\$9,700
ADDRESS	137 TONAWANDA	COUNTY TAXES	\$9,700
OWNER	ANDROSS GEORGE R	TOWN TAXES	\$0
OWNER2		SCHOOL TAXES	\$0
MAILING ADDRESS	133 TONAWANDA ST	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14207 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	330 - B - Vacant comm	ACTIVE	А
CALCULATED ACREAGE	0.49	SQFT LIVING AREA	0
ASSESSED ACREAGE	0	CONDITION	
FRONTAGE	116	HEATING	
DEPTH	187	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	10965	BEDS	0
DEED PAGE	06990	BATHS	0
DEED DATE	04/24/2000		

Site U: Former Pratt and Letchworth — 189-205 Tonawanda St

Parcel Information			
PIN	1402000884200001002130	TOTAL ASSESSMENT	\$118,300
SBL	88.42-1-2.13	LAND ASSESSMENT	\$118,300
ADDRESS	189 TONAWANDA	COUNTY TAXES	\$118,300
OWNER	GOLF & RECREATIONAL	TOWN TAXES	\$0
OWNER2	FACILITIES INC	SCHOOL TAXES	\$0
MAILING ADDRESS	268 MAIN ST	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	А
CALCULATED ACREAGE	5.36	SQFT LIVING AREA	0
ASSESSED ACREAGE	5.42999982	CONDITION	
FRONTAGE	515.69000244	HEATING	
DEPTH	546	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	10992	BEDS	0
DEED PAGE	02902	BATHS	0
DEED DATE	11/13/2001		

Site U: Former Pratt and Letchworth - 189-205 Tonawanda St

Parcel Information			
PIN	1402000884200001002110	TOTAL ASSESSMENT	\$360,000
SBL	88.42-1-2.11	LAND ASSESSMENT	\$360,000
ADDRESS	205 TONAWANDA	COUNTY TAXES	\$360,000
OWNER	GOLF AND RECREATIONAL	TOWN TAXES	\$0
OWNER2	FACILITIES INC	SCHOOL TAXES	\$0
MAILING ADDRESS	268 MAIN ST STE 301	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	R
CALCULATED ACREAGE	18.247	SQFT LIVING AREA	0
ASSESSED ACREAGE	16.14999961	CONDITION	
FRONTAGE	134	HEATING	
DEPTH	0	BASEMENT	
DEED ROLL	1	FIREPLACE	0
DEED BOOK	11010	BEDS	0
DEED PAGE	07662	BATHS	0
DEED DATE	07/31/2002		

Site V: City of Buffalo Impound Lot - 166 Dart St

Parcel Information			
PIN	1402000885100004002000	TOTAL ASSESSMENT	\$460,000
SBL	88.51-4-2	LAND ASSESSMENT	\$113,300
ADDRESS	166 DART	COUNTY TAXES	\$0
OWNER	CITY BUFFALO REAL ESTATE	TOWN TAXES	\$0
OWNER2		SCHOOL TAXES	\$0
MAILING ADDRESS	2501 CITY HALL	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	651 - C - Highway gar	ACTIVE	A
CALCULATED ACREAGE	2.509	SQFT LIVING AREA	0
ASSESSED ACREAGE	0	CONDITION	
FRONTAGE	318	HEATING	
DEPTH	455	BASEMENT	
DEED ROLL	8	FIREPLACE	0
DEED BOOK	l1998	BEDS	0
DEED PAGE	10575	BATHS	0
DEED DATE	03/02/1999		

Site W: Buffalo State College Parking Lot – Grant St

Parcel Information			
PIN	1402000885100004003200	TOTAL ASSESSMENT	\$273,400
SBL	88.51-4-3.2	LAND ASSESSMENT	\$71,400
ADDRESS	2 LETCHWORTH	COUNTY TAXES	\$0
OWNER	PEOPLE OF THE STATE OF	TOWN TAXES	\$0
OWNER2	NEW YORK (THE)	SCHOOL TAXES	\$0
MAILING ADDRESS	1300 ELMWOOD AVE	VILLAGE TAXES	\$0
CITY/ZIP/ZIP4	BUFFALO NY, 14222 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO
MUNICIPALITY	City of Buffalo	YEAR BUILT	0
PROPERTY CLASS	613 - C - College/univ	ACTIVE	A
CALCULATED ACREAGE	1.661	SQFT LIVING AREA	0
ASSESSED ACREAGE	1.63999998	CONDITION	
FRONTAGE	266.1000061	HEATING	
DEPTH	265.26998901	BASEMENT	
DEED ROLL	8	FIREPLACE	0
DEED BOOK	10916	BEDS	0
DEED PAGE	2008	BATHS	0
DEED DATE	05/15/1997		

Site W: Buffalo State College Parking Lot – Grant St

	Parcel Information			
PIN	1402000885100004003100	TOTAL ASSESSMENT	\$15,700	
SBL	88.51-4-3.1	LAND ASSESSMENT	\$15,700	
ADDRESS	18 LETCHWORTH	COUNTY TAXES	\$0	
OWNER	PEOPLE OF THE STATE OF NY	TOWN TAXES	\$0	
OWNER2	C/O ATTN: STATE UNIVERSITY OF	SCHOOL TAXES	\$0	
MAILING ADDRESS	STATE UNIVERSITY PLAZA	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	ALBANY NY, 12246 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	А	
CALCULATED ACREAGE	0.528	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0.36000001	CONDITION		
FRONTAGE	234.92999267	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	11043	BEDS	0	
DEED PAGE	3292	BATHS	0	
DEED DATE	06/13/2003			

Site W: Buffalo State College Parking Lot – Grant St

	Parcel Information			
PIN	1402000885100004004000	TOTAL ASSESSMENT	\$9,300	
SBL	88.51-4-4	LAND ASSESSMENT	\$9,300	
ADDRESS	26 LETCHWORTH	COUNTY TAXES	\$0	
OWNER	THE PEOPLE OF THE STATE	TOWN TAXES	\$0	
OWNER2	OF NY	SCHOOL TAXES	\$0	
MAILING ADDRESS	COUNCIL'S OFFICE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	ALBANY NY, 12224 + 6000	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	А	
CALCULATED ACREAGE	0.257	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	161.94999694	HEATING		
DEPTH	58.06000137	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	09911	BEDS	0	
DEED PAGE	00489	BATHS	0	
DEED DATE	08/31/1988			

Site W: Buffalo State College Parking Lot – Grant St

	Parcel Information			
PIN	1402000885100004005000	TOTAL ASSESSMENT	\$91,500	
SBL	88.51-4-5	LAND ASSESSMENT	\$91,500	
ADDRESS	36 LETCHWORTH	COUNTY TAXES	\$0	
OWNER	THE PEOPLE OF THE STATE	TOWN TAXES	\$0	
OWNER2	OF NEW YORK	SCHOOL TAXES	\$0	
MAILING ADDRESS	1300 ELMWOOD AVE	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14222 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	340 - B - Vacant indus	ACTIVE	А	
CALCULATED ACREAGE	2.106	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	41.86000061	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	09598	BEDS	0	
DEED PAGE	00223	BATHS	0	
DEED DATE	07/31/1986			

Site X: Buffalo State College Athletic Stadium and Parking lot – 1300 Elmwood Ave

	Parcel Information			
PIN	1402000881200002001000	TOTAL ASSESSMENT	\$429,500	
SBL	88.12-2-1	LAND ASSESSMENT	\$229,500	
ADDRESS	673 GRANT	COUNTY TAXES	\$0	
OWNER	NEW YORK STATE	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	673 GRANT	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14213 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	592 - B - Athletic fld	ACTIVE	А	
CALCULATED ACREAGE	5.423	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	775.72998046	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	08153	BEDS	0	
DEED PAGE	00167	BATHS	0	
DEED DATE	04/05/1974			

Site Z: Tops Grocery Store/Burger King – 333-365 Amherst St

	Parcel Information			
PIN	1402000883500006001121	TOTAL ASSESSMENT	\$4,267,000	
SBL	88.35-6-1.121	LAND ASSESSMENT	\$571,600	
ADDRESS	333 AMHERST ST	COUNTY TAXES	\$4,267,000	
OWNER	345 AMHERST ST CO. LLC	TOWN TAXES	\$0	
OWNER2	C/O TOPS MARKETS REAL ESTATE C	SCHOOL TAXES	\$0	
MAILING ADDRESS	PO BOX 1027	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14240 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	454 - C - Supermarket	ACTIVE	А	
CALCULATED ACREAGE	9.89	SQFT LIVING AREA	0	
ASSESSED ACREAGE	8.98999977	CONDITION		
FRONTAGE	300	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11092	BEDS	0	
DEED PAGE	3524	BATHS	0	
DEED DATE	03/17/2005			

Site Z: Tops Grocery Store/Burger King – 333-365 Amherst St

	Parcel Information			
PIN	1402000883500006002112	TOTAL ASSESSMENT	\$320,000	
SBL	88.35-6-2.112	LAND ASSESSMENT	\$41,100	
ADDRESS	365 AMHERST ST	COUNTY TAXES	\$320,000	
OWNER	SPIRIT MASTER FUNDING II LLC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	14631 N SCOTTSDALE RD	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	SCOTTSDALE AZ, 85254 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	426 - C - Fast food	ACTIVE	А	
CALCULATED ACREAGE	0.756	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	153	HEATING		
DEPTH	180	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	11105	BEDS	0	
DEED PAGE	6728	BATHS	0	
DEED DATE	11/29/2005			

Site AA: Former Buffalo Fire Station — 395 Amherst St

	Parcel Information			
PIN	1402000883500007002000	TOTAL ASSESSMENT	\$4,100	
SBL	88.35-7-2	LAND ASSESSMENT	\$2,300	
ADDRESS	391 AMHERST ST	COUNTY TAXES	\$4,100	
OWNER	POLISH CADETS OF BFLO INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	927 GRANT	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 + 2811	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	331 - B - Com vac w/imp	ACTIVE	А	
CALCULATED ACREAGE	0.189	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	12	HEATING		
DEPTH	150	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	08161	BEDS	0	
DEED PAGE	00493	BATHS	0	
DEED DATE	05/02/1974			

Site AB: Wegman's – 601 Amherst St

	Parcel Information			
PIN	1402000882800006010210	TOTAL ASSESSMENT	\$5,750,000	
SBL	88.28-6-10.21	LAND ASSESSMENT	\$828,500	
ADDRESS	601 AMHERST ST	COUNTY TAXES	\$5,503,925	
OWNER	WEGMANS FOOD MARKETS INC	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1500 BROOKS AVE P O 844	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	ROCHESTER NY, 14692 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	454 - C - Supermarket	ACTIVE	А	
CALCULATED ACREAGE	14.949	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	605.33001708	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	10908	BEDS	0	
DEED PAGE	3456	BATHS	0	
DEED DATE	10/28/1996			

Site AC: Marcon Erectors – 1 Howell St

	Parcel Information			
PIN	1402000883600002006000	TOTAL ASSESSMENT	\$52,000	
SBL	88.36-2-6	LAND ASSESSMENT	\$11,500	
ADDRESS	1 HOWELL	COUNTY TAXES	\$52,000	
OWNER	GIAMBRONE DOUGLAS	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	1 HOWELL	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14207 + 2822	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А	
CALCULATED ACREAGE	0.725	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	115.33999633	HEATING		
DEPTH	200	BASEMENT		
DEED ROLL	1	FIREPLACE	0	
DEED BOOK	08958	BEDS	0	
DEED PAGE	00288	BATHS	0	
DEED DATE	10/29/1980			

Site AD: Contractor Storage Area - 18 Howell St

	Parcel Information			
PIN	1402000883600001014000	TOTAL ASSESSMENT	\$16,000	
SBL	88.36-1-14	LAND ASSESSMENT	\$16,000	
ADDRESS	18 HOWELL	COUNTY TAXES	\$0	
OWNER	CITY OF BUFFALO	TOWN TAXES	\$0	
OWNER2		SCHOOL TAXES	\$0	
MAILING ADDRESS	2501 CITY HALL	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	330 - B - Vacant comm	ACTIVE	А	
CALCULATED ACREAGE	0.462	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	111	HEATING		
DEPTH	289	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	10255	BEDS	0	
DEED PAGE	00187	BATHS	0	
DEED DATE	01/18/1991			

Site AE: Residential Property – 227 Middlesex Rd

	Parcel Information				
PIN	1402000893000002025000	TOTAL ASSESSMENT	\$465,000		
SBL	89.30-2-25	LAND ASSESSMENT	\$195,500		
ADDRESS	227 MIDDLESEX	COUNTY TAXES	\$465,000		
OWNER	LENAHAN CHRISTOPHER D	TOWN TAXES	\$0		
OWNER2	LENAHAN MICHELLE R	SCHOOL TAXES	\$0		
MAILING ADDRESS	227 MIDDLESEX RD	VILLAGE TAXES	\$0		
CITY/ZIP/ZIP4	BUFFALO NY, 14216 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO		
MUNICIPALITY	City of Buffalo	YEAR BUILT	1910		
PROPERTY CLASS	210 - R - 1 Family Res	ACTIVE	А		
CALCULATED ACREAGE	0.411	SQFT LIVING AREA	3648		
ASSESSED ACREAGE	0	CONDITION			
FRONTAGE	110	HEATING			
DEPTH	174	BASEMENT			
DEED ROLL	[1	FIREPLACE	2		
DEED BOOK	11076	BEDS	4		
DEED PAGE	7724	BATHS	2.5		
DEED DATE	06/03/2004				

Site AF: Buffalo Police Radio Tower – Route 198 Eastbound

	Parcel Information			
PIN	1402000890700001001000	TOTAL ASSESSMENT	\$20,024,300	
SBL	89.07-1-1	LAND ASSESSMENT	\$7,662,200	
ADDRESS	414 PARKSIDE	COUNTY TAXES	\$0	
OWNER	CITY OF BUFFALO	TOWN TAXES	\$0	
OWNER2	DELAWARE PARK	SCHOOL TAXES	\$0	
MAILING ADDRESS	511 CITY HALL	VILLAGE TAXES	\$0	
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO	
MUNICIPALITY	City of Buffalo	YEAR BUILT	0	
PROPERTY CLASS	963 - B - Municpl park	ACTIVE	A	
CALCULATED ACREAGE	4.226	SQFT LIVING AREA	0	
ASSESSED ACREAGE	0	CONDITION		
FRONTAGE	0	HEATING		
DEPTH	0	BASEMENT		
DEED ROLL	8	FIREPLACE	0	
DEED BOOK	00000	BEDS	0	
DEED PAGE	00027	BATHS	0	
DEED DATE	05/25/1985			

Site AG: City of Buffalo Park Labor Center – 17-25 Meadowview Pl

	Parcel Information					
PIN	1402000890700001001000	TOTAL ASSESSMENT	\$20,024,300			
SBL	89.07-1-1	LAND ASSESSMENT	\$7,662,200			
ADDRESS	414 PARKSIDE	COUNTY TAXES	\$0			
OWNER	CITY OF BUFFALO	TOWN TAXES	\$0			
OWNER2	DELAWARE PARK	SCHOOL TAXES	\$0			
MAILING ADDRESS	511 CITY HALL	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	963 - B - Municpl park	ACTIVE	А			
CALCULATED ACREAGE	4.226	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	0	HEATING				
DEPTH	0	BASEMENT				
DEED ROLL	8	FIREPLACE	0			
DEED BOOK	00000	BEDS	0			
DEED PAGE	00027	BATHS	0			
DEED DATE	05/25/1985					

Site AH: Delaware Park – Parkside Ave

	Parcel Information				
PIN	1402000890700001001000	TOTAL ASSESSMENT	\$20,024,300		
SBL	89.07-1-1	LAND ASSESSMENT	\$7,662,200		
ADDRESS	414 PARKSIDE	COUNTY TAXES	\$0		
OWNER	CITY OF BUFFALO	TOWN TAXES	\$0		
OWNER2	DELAWARE PARK	SCHOOL TAXES	\$0		
MAILING ADDRESS	511 CITY HALL	VILLAGE TAXES	\$0		
CITY/ZIP/ZIP4	BUFFALO NY, 14202 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO		
MUNICIPALITY	City of Buffalo	YEAR BUILT	0		
PROPERTY CLASS	963 - B - Municpl park	ACTIVE	А		
CALCULATED ACREAGE	214.017	SQFT LIVING AREA	0		
ASSESSED ACREAGE	0	CONDITION			
FRONTAGE	0	HEATING			
DEPTH	0	BASEMENT			
DEED ROLL	8	FIREPLACE	0		
DEED BOOK	00000	BEDS	0		
DEED PAGE	00027	BATHS	0		
DEED DATE	05/25/1985				

Site Al: Metro-Rail Subway Station — 2085 Main St

	Parcel Information					
PIN	1402000896600001001000	TOTAL ASSESSMENT	\$21,600,000			
SBL	89.66-1-1	LAND ASSESSMENT	\$78,300			
ADDRESS	2085 MAIN	COUNTY TAXES	\$0			
OWNER	N.F.T.A.	TOWN TAXES	\$0			
OWNER2		SCHOOL TAXES	\$0			
MAILING ADDRESS	PO BOX 5008	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	BUFFALO NY, 14203 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	841 - C - Motr veh srv	ACTIVE	А			
CALCULATED ACREAGE	0.336	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	93.26000213	HEATING				
DEPTH	0	BASEMENT				
DEED ROLL	8	FIREPLACE	0			
DEED BOOK	9007	BEDS	0			
DEED PAGE	63	BATHS	0			
DEED DATE	01/27/1981					

Site AJ: Buffalo Lining & Fabricating — 93 Gillette Ave

	Parcel Information					
PIN	1402000897500003003000	TOTAL ASSESSMENT	\$56,700			
SBL	89.75-3-3	LAND ASSESSMENT	\$20,500			
ADDRESS	93 GILLETTE	COUNTY TAXES	\$56,700			
OWNER	BUFFALO LINING &	TOWN TAXES	\$0			
OWNER2	FABRICATING CORP	SCHOOL TAXES	\$0			
MAILING ADDRESS	PO BOX 876	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	BUFFALO NY, 14215 + 0876	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	710 - C - Manufacture	ACTIVE	А			
CALCULATED ACREAGE	0.77	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	315.20999145	HEATING				
DEPTH	0	BASEMENT				
DEED ROLL	1	FIREPLACE	0			
DEED BOOK	06424	BEDS	0			
DEED PAGE	00114	BATHS	0			
DEED DATE	05/12/1959					

Site AK: WM Maunz Co. – 387 East Delavan Ave

	Parcel Information					
PIN	1402000898400001001110	TOTAL ASSESSMENT	\$94,000			
SBL	89.84-1-1.11	LAND ASSESSMENT	\$28,700			
ADDRESS	411 DELAVAN EAST	COUNTY TAXES	\$94,000			
OWNER	411 EAST DELAVAN ASSOC.	TOWN TAXES	\$0			
OWNER2	LLC	SCHOOL TAXES	\$0			
MAILING ADDRESS	26 SCHLEMMER RD	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	LANCASTER NY, 14086 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А			
CALCULATED ACREAGE	1.837	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	103	HEATING				
DEPTH	380	BASEMENT				
DEED ROLL	1	FIREPLACE	0			
DEED BOOK	10934	BEDS	0			
DEED PAGE	8989	BATHS	0			
DEED DATE	10/26/1966					

Site AM: Railroad ROW – East End

	Parcel Information					
PIN	1402000892000001013000	TOTAL ASSESSMENT	\$0			
SBL		LAND ASSESSMENT	\$0			
ADDRESS	0	COUNTY TAXES	\$0			
OWNER	CONSOLIDATED RAIL CORP	TOWN TAXES	\$0			
OWNER2		SCHOOL TAXES	\$0			
MAILING ADDRESS		VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	, +	SCHOOL DISTRICT	(0)			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	0	ACTIVE				
CALCULATED ACREAGE	3.059	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	0	HEATING				
DEPTH	0	BASEMENT				
DEED ROLL	0	FIREPLACE	0			
DEED BOOK	8706	BEDS	0			
DEED PAGE	513	BATHS	0			
DEED DATE	10/11/1978					

Site AN: Residential Property – 413 E. Delevan Ave

Parcel Information					
PIN	1402000898400001003000	TOTAL ASSESSMENT	\$1,100,000		
SBL	89.84-1-3	LAND ASSESSMENT	\$50,000		
ADDRESS	413 DELAVAN EAST	COUNTY TAXES	\$0		
OWNER	WOMEN FOR HUMAN RIGHTS	TOWN TAXES	\$0		
OWNER2	AND DIGNITY INC	SCHOOL TAXES	\$0		
MAILING ADDRESS	2278 MAIN ST	VILLAGE TAXES	\$0		
CITY/ZIP/ZIP4	BUFFALO NY, 14214 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO		
MUNICIPALITY	City of Buffalo	YEAR BUILT	2003		
PROPERTY CLASS	281 - R - Multiple res	ACTIVE	A		
CALCULATED ACREAGE	1.156	SQFT LIVING AREA	1250		
ASSESSED ACREAGE	0	CONDITION			
FRONTAGE	247	HEATING			
DEPTH	110	BASEMENT			
DEED ROLL	8	FIREPLACE	0		
DEED BOOK	10975	BEDS	2		
DEED PAGE	05210	BATHS	1.5		
DEED DATE	12/29/2000				

Site AO: Sears, Roebuck & Co. and North Extension – 370-440 E. Delevan Ave

	Parcel Information					
PIN	1402000892000001006000	TOTAL ASSESSMENT	\$1,372,000			
SBL	89.20-1-6	LAND ASSESSMENT	\$146,100			
ADDRESS	420 DELAVAN EAST	COUNTY TAXES	\$1,372,000			
OWNER	SEARS ROEBUCK & CO	TOWN TAXES	\$0			
OWNER2	C/O ATTN: SEARS ROEBUCK & CO	SCHOOL TAXES	\$0			
MAILING ADDRESS	3333 BEVERLY RD	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	HOFFMAN ESTATES IL, 60179 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	А			
CALCULATED ACREAGE	9.304	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	204.36999511	HEATING				
DEPTH	197	BASEMENT				
DEED ROLL	1	FIREPLACE	0			
DEED BOOK	10867	BEDS	0			
DEED PAGE	4670	BATHS	0			
DEED DATE	03/01/1994					

Site AO: Sears, Roebuck & Co. and North Extension – 370-440 E. Delevan Ave

Parcel Information					
PIN	1402000892000001012000	TOTAL ASSESSMENT	\$30,100		
SBL	89.20-1-12	LAND ASSESSMENT	\$30,100		
ADDRESS	440 DELAVAN EAST	COUNTY TAXES	\$30,100		
OWNER	SEARS ROEBUCK & CO	TOWN TAXES	\$0		
OWNER2	3333 BEVERLY ROAD	SCHOOL TAXES	\$0		
MAILING ADDRESS	B2 135A	VILLAGE TAXES	\$0		
CITY/ZIP/ZIP4	HOFFMAN ESTATES IL, 60179 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO		
MUNICIPALITY	City of Buffalo	YEAR BUILT	0		
PROPERTY CLASS	330 - B - Vacant comm	ACTIVE	А		
CALCULATED ACREAGE	0.922	SQFT LIVING AREA	0		
ASSESSED ACREAGE	0	CONDITION			
FRONTAGE	204.36999511	HEATING			
DEPTH	197	BASEMENT			
DEED ROLL	1	FIREPLACE	0		
DEED BOOK	08630	BEDS	0		
DEED PAGE	00061	BATHS	0		
DEED DATE	03/31/1978				

Site AP: Brookline Machine Inc. and North Extension – 1870-1896 Fillmore Ave

	Parcel Information					
PIN	1402000892000001005000	TOTAL ASSESSMENT	\$225,000			
SBL	89.20-1-5	LAND ASSESSMENT	\$17,000			
ADDRESS	1870 FILLMORE	COUNTY TAXES	\$225,000			
OWNER	JOHN S WHITING WAREHOUSE	TOWN TAXES	\$0			
OWNER2	CORP	SCHOOL TAXES	\$0			
MAILING ADDRESS	90 ANTWERP ST	VILLAGE TAXES	\$0			
CITY/ZIP/ZIP4	BRIGHTON MA, 02135 +	SCHOOL DISTRICT	(140200) CITY OF BUFFALO			
MUNICIPALITY	City of Buffalo	YEAR BUILT	0			
PROPERTY CLASS	449 - C - Warehouse	ACTIVE	A			
CALCULATED ACREAGE	0.995	SQFT LIVING AREA	0			
ASSESSED ACREAGE	0	CONDITION				
FRONTAGE	212.5	HEATING				
DEPTH	200	BASEMENT				
DEED ROLL	1	FIREPLACE	0			
DEED BOOK	08196	BEDS	0			
DEED PAGE	00282	BATHS	0			
DEED DATE	07/24/1974					







DEC REGION:	9			SPILL NUMBER:	0809549
SPILL NAME:	BUFFALO F	IRE DEPT LADDER 12		DEC LEAD:	fxgalleg
SPILL DATE:		11/24/2008		SPILL TIME:	12:00 pm
CALL RECEIV	ED DATE:	11/24/2008		RECEIVED TIME:	12:50 pm
		SPILL	LOC	ATION	
PLACE:	BUFFALO FIR	RE DEPT LADDER 12		COUNTY:	Erie
STREET:	AMHERST NEAR GRANT			TOWN/CITY:	Buffalo (c)
				COMMUNITY:	BUFFALO
CONTACT:				CONTACT PHONE	:
CONT. FACT	OR: Other			SPILL REPORTED	BY: Other
FACILITY TY	PE: Institu	utional, Educational, Gov., C	Othe	WATERBODY:	

#### **CALLER REMARKS:**

DISCOVERED PETROLEUM CONTAMINATION WHILE REMOVING A 550 GALLON DIESEL FUEL TANK. WILL EXCAVATE AND DISPOSE OF SOIL AND COLLECT EXCAVATION SAMPLES.

MATERIALCLASSSPILLEDRECOVEREDRESOURCES AFFECTEDDieselPetroleum0 G0 GSoil,

## **POTENTIAL SPILLERS**

COMPANY ADDRESS CONTACT
CITY OF BUFFALO FIRE DEPT NY

#### OTHER SPILLS / CLEANUPS / PBS AT SITE

SPILL NUMBER / PROGRAM NUMBER CLOSE DATE PROGRAM TYPE

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

### DEC REMARKS:

11/24/08 FG SITE INSPECTION. NATURE'S WAY HAD REMOVED THE 550 GAL DIESEL TANK. GASOLINE CONTAMINATION WAS EVIDENT FROM THE PRIOR INACTIVE SPILL AT THE SAME LOCATION. CONTAMINATED SOIL WAS STAGED AT ANOTHER CITY OF BUFFALO PROPERTY AND WILL BE DISPOSED OF. EXCAVATION SAMPLES WERE COLLECTED. SOME CONTAMINATION REMAINED UNDER THE BLDG AND UNDER THE STREET (AMHERST). THE EXCAVATION WILL BE BACKFILLED.

1/22/08 NATURE'S WAY SUBMITTED THE 1/16/09 TANK CLOSURE REPORT FOR THE SITE. ALL EXCAVATION SAMPLES WERE BELOW TAGM 4046 LEVELS. 25.2 TONS OF PETROLEUM CONTAMINATED SOIL WERE DISPOSED AT THE CHAFFEE WASTE MGT LANDFILL. 380 GALLONS OF PETROLEUM IMPACTED WATER WERE DISPOSED AT INDUSTRIAL OIL. NO FURTHER WORK IS REQUIRED. THE SITE IS CLOSED.

Created On: 11/24/2008

Date Printed: 1/9/2013 Last Updated: 01/22/2009





DEC REGION:9SPILL NUMBER:0809549SPILL NAME:BUFFALO FIRE DEPT LADDER 12DEC LEAD:fxgalleg

PIN T & A COST CENTER

CLASS: C3 CLOSE DATE: 01/22/2009 MEETS STANDARDS: False

Created On: 11/24/2008

Date Printed: 1/9/2013 Last Updated: 01/22/2009 2





DEC REGION:	9			SPILL NUMBER:	0906483
SPILL NAME:	DELAWARI	LABOR CENTER		DEC LEAD:	JFOTTO
SPILL DATE:		09/03/2009		SPILL TIME:	1:30 pm
CALL RECEIV	ED DATE:	09/04/2009		_ RECEIVED TIME:	12:04 pm
SPILL LOCATION					
PLACE:	DELAWARE	LABOR CENTER		COUNTY:	Erie
STREET:	17 MEADOWVIEW PLACE			TOWN/CITY:	Buffalo (c)
				COMMUNITY:	BUFFALO
CONTACT: GREG FALKNER		CONTACT PHONE:	(716) 858-2291		
CONT. FACT	OR: Hum	an Error		SPILL REPORTED B	Y: Responsible Party
FACILITY TY		tutional, Educational, Gov.	., Othe	WATERBODY:	

#### **CALLER REMARKS:**

PERSON LEFT VALVE OPEN ON 55 GALLON DRUM, SPILLED TO CONCRETE FLOOR INSIDE, RAN OUTSIDE TO CONCRETE ENTRANCE PAD AND THEN ONTO SOIL. CLEANUP STARTED.

MATERIAL	CLASS	SPILLED	RECOVERED	RESOURCES AFFECTED
Hydraulic Oil	Petroleum	10 G	10 G	Soil,
Hydraulic Oil	Petroleum	10 G	10 G	Imp Surf

### **POTENTIAL SPILLERS**

COMPANY ADDRESS CONTACT
ERIE COUNTY NY

### OTHER SPILLS / CLEANUPS / PBS AT SITE

SPILL NUMBER / PROGRAM NUMBER
9875365
CLOSE DATE
12/10/1999 12:00:00. Spill Number

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

#### **DEC REMARKS:**

09/04/09 JFO ON SITE MET WITH VINNY IN THE GARAGE. THE SPILL IS TO THE CONCRETE FLOOR. SOME SOIL WAS IMPACTED. SPEEDY DRY HAS BEEN PLACED ON THE SPILL AND THE WOODEN DEBRIS WAS REMOVED FROM THE SOIL AREA. VINNY SAID THE SPEEDY DRY WILL BE CLEANED UP SATURDAY. I WILL VISIT SIT WEDNESDAY.

09/09/09 JFO CALL TO GREG FALKNER GARAGE SUPERVISOR. THE FLOOR IS CLEANED UP. THEY WILL REMOVE ANY CONTAMINATED SOIL OUTSIDE AND STAGE FOR DISPOSAL. WHEN CLEANUP IS COMPLETE HE WILL CALL ME FOR AN INSPECTION.

09/14/09 JFO SITE VISIT MET WITH GREG FALKNER. THE SOIL HAS NOT BEEN DUG UP, THEY ARE WAITING FOR AN UNDERGROUND UTILITIES CHECK. THIS WILL BE DONE BY THURSDAY. THE COMM ISN JIM HORNUNG 858-8353 AND DEPUTY COMM IS STAN JEMIOLO 858-8350.

Created On: 09/04/2009

Date Printed: 1/9/2013 Last Updated: 10/02/2009 3





4

 DEC REGION:
 9
 SPILL NUMBER:
 0906483

SPILL NAME: DELAWARE LABOR CENTER DEC LEAD: JFOTTO

09/16/09 JFO ON SITE MET WITH GREG F. THE AREA HAS BEEN DUG AND THE CONTAMINATED SOIL IS STAGED ON PLASTIC (APPROX 1 TON). THE AREA LOOKS CLEAN. HE WILL CONTACT THE TRANSFER STATION TO SEE IF THEY CAN ACCEPT THE SOIL. HE WILL LET ME KNOW.

10/02/09 SOIL WAS DISPOSED AT THE TRANSFER STATION. NO FURTHER ACTION REQUIRED.

CLOSED ELECTRONIC FILE

PIN T&A COST CENTER

CLASS: C3 CLOSE DATE: 10/02/2009 MEETS STANDARDS: True

Created On: 09/04/2009

Date Printed: 1/9/2013 Last Updated: 10/02/2009





DEC REGION:	9			SPILL NUMBER:	0911317		
SPILL NAME:	BUFFALO S	TATE COLLEGE		DEC LEAD:	FXGALLEG		
SPILL DATE:		01/21/2010		SPILL TIME:	9:00 am		
CALL RECEIV	ED DATE:	01/21/2010		RECEIVED TIME:	9:15 am		
SPILL LOCATION							
PLACE:	BUFFALO STA	ATE COLLEGE		COUNTY:	Erie		
STREET:	STREET: ELMWOOD AVE.			TOWN/CITY:	Buffalo (c)		
				COMMUNITY:	BUFFALO		
CONTACT:			CONTACT PHONE:				
CONT. FACTOR: Unknown  FACILITY TYPE: Institutional, Educational, Gov., Othe		SPILL REPORTED BY: Other WATERBODY:					

#### **CALLER REMARKS:**

CALLER STATES THAT THEY ENCOUNTERED PCB CONTAMINATED SOIL, WHILE EXCAVATING NEAR BEACON HALL IN BUFF STATE...THEY WILL REMEDIATE

MATERIALCLASSSPILLEDRECOVEREDRESOURCES AFFECTEDPCB OILPetroleumSoil,

## **POTENTIAL SPILLERS**

COMPANY ADDRESS CONTACT

BUFFALO STATE COLLEGE BUFFALO NY

#### OTHER SPILLS / CLEANUPS / PBS AT SITE

SPILL NUMBER / PROGRAM NUMBER CLOSE DATE PROGRAM TYPE

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

#### **DEC REMARKS:**

01/22/10 JFO TELCON WITH CALLER MR PRADEEB SIMLOTE. THEY HAVE NOT UNCOVERED ANY CONTAMINATION YET, RIGHT NOW THEY ARE IN THE DESIGN PROCESS. HE SAID THE EXCAVATION WILL TAKE PLACE IN APRIL OR MAY. HE WILL CONTACT THIS OFFICE WHEN THEY SCHEDULE.

07/22/10 JFO CALL TO PRADEEP SIMLOTE. THE PROJECT HAS NOT STARTED YET. HE WILL CHECK AND GET BACK TO ME TODAY WITH THE COLLEGE CONTACT.

07/29/10 JFO CALL TO PRADEEP S. NOT IN LEFT A MSG ON HIS V-MAIL.

11/29/10 FG CONTACTED MR. PRADEEP SIMLOTE AND LEFT A MESSAGE TO RETURN THE CALL WITH AN UPDATE ON THE STATUS OF THE SITE.

12/23/10 FG LEFT A MESSAGE WITH THE ENVIRONMENTAL HEALTH AND SAFETY GROUP AT BUFF STATE 878-4038

Created On: 01/21/2010





DEC REGION:	9	SPILL NUMBER:	0911317
SPILL NAME:	BUFFALO STATE COLLEGE	DEC LEAD:	FXGALLEG

AND REQUESTED A RETURN CALL.

1/5/11 FG SPOKE TO DAVID GERBER WITH THE SUNY CONSTRUCTION FUND 518-320-1711. HE SAID HE WAS NOT AWARE THAT A SPILL HAD BEEN REPORTED ON THIS PROJECT. HE SAID HE WILL PROVIDE THE ANALYTICAL DATA AND THE REMEDIAL PLAN BY THE BEGINNING OF NEXT WEEK.

3/29/11 FG SPOKE TO DAVID GERBER WITH THE SUNY CONSTRUCTION FUND. HE SAID THAT THEY HIRED A FIRM TO ASSESS THE SITUATION AND THEY RECOMMEDED ADDITIONAL SAMPLING WHICH THEY ARE COMPLETING TODAY. MR. GERBER SAID THAT HE WILL SUBMIT A REMEDIAL ACTION PLAN WITHIN 30 DAYS.

6/7/11 FG CALLED MR. GERBER AND LEFT A MESSAGE FOR AN UPDATE ON THE STATUS OF THIS SITE.

11/8/11 FG SPOKE TO MR. GERBER AND SAID HE RETESTED THE AREA AND SAMPLED OTHER AREAS NEARBY. THEY HAVE THE SAMPLING RESULTS AND HAVE REPORTED IT TO THE EPA. THEY ARE DEVELOPING A REMEDIAL ACTION PLAN. THEY WILL PROVIDE AN UPDATE WITHIN THE NEXT TWO WEEKS.

12/23/11 WOODWARD & CURRAN SUBMITTED THE PCB SOIL REMEDIATION PLAN FOR THE SITE. THE PLAN WAS SENT TO JAMES HAKLAR, PCB COORDINATOR USEPA FACILITES. THEY PLAN ON REMEDIATING SOILS IMPACTED BY PCB CONTAMINATED WINDOW CALK. THE WORK IS PLANNED TO TAKE PLACE IN SPRING 2012 IF THE PROPOSAL IS APPROVED BY THE USEPA.

1/17/12 GPS INDICATED THIS SPILL SHOULD BE CLOSED BECAUSE IT IS NOT A SPILL. FG NOTIFIED DAVID GERBER THAT DEC WILL NO LONGER BE INVOLVED IN THE REVIEW OF THIS SITE'S REMEDIAL EFFORT AND THEY SHOULD CONTINUE TO NOTIFY USEPA.

SPILL NUMBER IS CLOSED.

PIN T & A COST CENTER

CLASS: B3 CLOSE DATE: 01/17/2012 MEETS STANDARDS: False

Created On: 01/21/2010





DEC REGION:	9	SPILL NUMBER:	1008362
SPILL NAME:	HOYT LAKE	DEC LEAD:	FXGALLEG
SPILL DATE:	11/09/2010	_ SPILL TIME:	3:00 pm

**RECEIVED TIME:** 

4:10 pm

**SPILL LOCATION** 

PLACE: HOYT LAKE COUNTY: Erie

STREET: NOTTINGHAM TERRACE & DELAWARE TOWN/CITY: Buffalo (c)
COMMUNITY: BUFFALO

CONTACT: CONTACT PHONE:

CONT. FACTOR: Unknown SPILL REPORTED BY: Fire Department

**FACILITY TYPE:** Institutional, Educational, Gov., Othe **WATERBODY**:

11/09/2010

**CALLER REMARKS:** 

**CALL RECEIVED DATE:** 

UNKNOWN FILM ON HOYT LAKE 3'X60'

MATERIAL CLASS SPILLED RECOVERED RESOURCES AFFECTED

UNKNOWN MATERIAL Other

**POTENTIAL SPILLERS** 

COMPANY ADDRESS CONTACT

UNKNOWN NY

OTHER SPILLS / CLEANUPS / PBS AT SITE

SPILL NUMBER / PROGRAM NUMBER CLOSE DATE PROGRAM TYPE

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

**DEC REMARKS:** 

11/9/10 DON IPPOLITO WITH THE CITY OF BUFFALO AND THE BUFFALO FIRE DEPT ON SITE. FG SITE INSPECTION. BLACK NATURAL MATERIAL ON TOP OF LAKE ACCUMULATED ALONG SHORE. NOT OIL OR CHEMICAL IN NATURE. MAY BE MULCH. CITY OF BUFFALO HIRED NATURES WAY TO REMOVE MATERIAL WHICH THEY DID AND PLACED IN THE GARBAGE. NO FURTHER WORK IS REQUIRED. THE SITE IS CLOSED.

ELECTRONIC FILE ONLY.

PIN T & A COST CENTER

CLASS: E6 CLOSE DATE: 11/10/2010 MEETS STANDARDS: False

Created On: 11/09/2010

Date Printed: 1/9/2013 Last Updated: 11/16/2010 7





DEC REGION:	9		SPILL NUMBER:	1100462		
SPILL NAME:	TRANSFOR	MER 178 @ DELEWARE F	PARK	DEC LEAD:	TDJOHNSO	
SPILL DATE:		04/12/2011		SPILL TIME:	2:01 pm	
CALL RECEIVED DATE:		04/13/2011 RECEIVED TIME:		2:00 pm		
SPILL LOCATION						
PLACE:	TRANSFORM	IER 178 @ DELEWARE PA	ARK	COUNTY:	_Erie	
STREET:	MAIN WALKING LOOP			TOWN/CITY:	Buffalo (c)	
				COMMUNITY:	BUFFALO	
CONTACT: MICHELLE WOLSNICK			CONTACT PHONE:	·		
CONT. FACTOR: Traffic Accident		SPILL REPORTED	BY: Citizen			
FACILITY TYPE: Commercial/Industrial		WATERBODY:				

#### **CALLER REMARKS:**

while walking in the park caller noticed a leaking transformer in the park the last two days. no containment or clean up appears, not known if it has been discovered by power company - fluid on soil

MATERIAL	CLASS	SPILLED	RECOVERED	RESOURCES AFFECTED
TRANSFORMER OIL	Petroleum			Soil,

## **POTENTIAL SPILLERS**

COMPANYADDRESSCONTACTUNKNOWNMAIN WALKING LOOP BUFFALO NYMICHELLE WOLSNICK

# OTHER SPILLS / CLEANUPS / PBS AT SITE

SPILL NUMBER / PROGRAM NUMBER CLOSE DATE PROGRAM TYPE

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

### DEC REMARKS:

04/13/11 TDJ WENT TO PARK AND DROVE AROUND AREAS WHERE VEHICLES CAN GO ANSD FOUND NO LEAKING X-FORMER. CALLED BACK INFORMANT BUT GOT VOICEMAIL.

04/14/11 TDJ CONTACTED INFORMANT AND GOT INFO ON LOCATION AND THAT IT WAS A PAD MOUNT UNIT. CONTACTED LISA MONTESSANO FROM NATIONAL GRID TO CHECK THE UNIT.

04/15/11 TDJ LISA CALLED BACK AND SAID THEY FOUND THE UNIT AND IT HAD SOME DEAD GRASS AND STAINING ON CONCRETE WHICH WILL BE ADDRESSED. THE UNIT HOLDS 60 GALLONS AND FEEDS SEVERAL AREAS. IT WILL BE CHANGED OUT.

08/08/11 TDJ TRANSFORMER CHANGED OUT AND SOIL REMEDIATED. RECEIVED DISPOSAL RECEIPT FOR SITE CLOSURE.

Created On: 04/13/2011

Date Printed: 1/9/2013 Last Updated: 08/08/2011 8





**TDJOHNSO** 

**DEC REGION:** 9 SPILL NUMBER: 1100462

**SPILL NAME**: TRANSFORMER 178 @ DELEWARE PARK DEC LEAD: NO FURTHER ACTION

FILE CLOSED


<u>PIN</u> <u>T & A</u>

**COST CENTER** 

CLASS: CLOSE DATE: 08/08/2011 MEETS STANDARDS: False

Created On: 04/13/2011

Date Printed: 1/9/2013 Last Updated: 08/08/2011 9

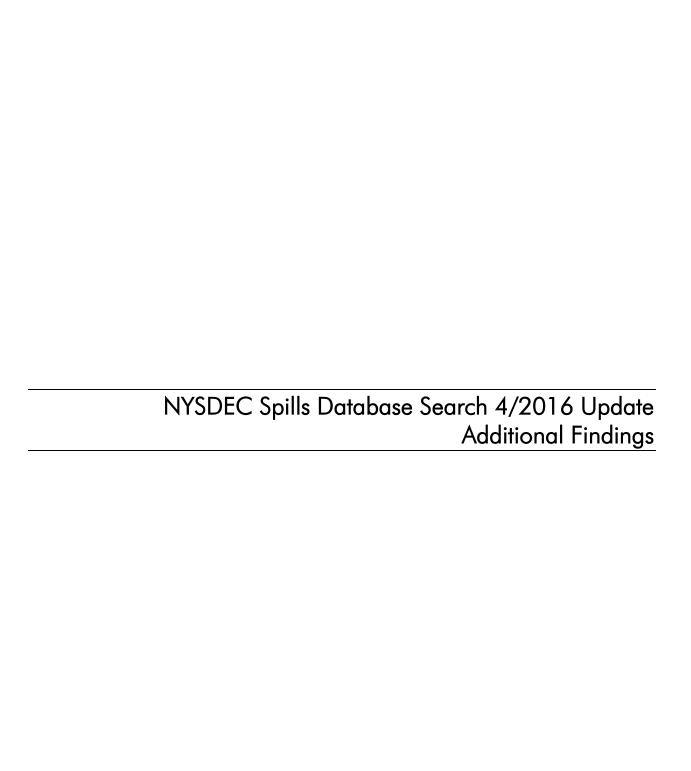





DEC REGION:	9			_ SPILL NUMBER:	1307337
SPILL NAME:	PARKIN	G LOT		_ DEC LEAD:	TDJOHNSO
SPILL DATE:		10/16/2013		SPILL TIME:	1:00 pm
CALL RECEIV	ED DATE	10/16/2013		RECEIVED TIME:	9:45 am
			SPILL LO	CATION	
PLACE:	PARKING	LOT		COUNTY:	Erie
STREET:	345 AMHERST STREET		TOWN/CITY:	Buffalo (c)	
				COMMUNITY:	BUFFALO
CONTACT:	ERIC RO	)SS		_ CONTACT PHONE:	(585) 370-2726
CONT. FACTOR	R: Oth	er		_SPILL REPORTED BY:_	Responsible Party
FACILITY TYPE: Commercial/Industrial		_WATERBODY:			

#### **CALLER REMARKS:**

Consultant stated that during test pit sampling for new gasoline station to be built at Tops Store old fill material showed elevated levels of oily material.

MATERIAL CLASS SPILLED RECOVERED RESOURCES AFFECTED lube oil Petroleum

## POTENTIAL SPILLERS

COMPANY ADDRESS CONTACT

tops market 345 amherst st buffalo NY

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

#### **DEC REMARKS:**

10/16/13 TDJ SPOKE WITH ERIC ROSS WHO WAS QUESTIONING DISPOSAL OF FILL MATERIAL WHICH WAS WITHIN THE CP-51 LIMITS FOR REGULATORY CONTAMINANTS BUT HAD ELEVATED LEVELS OF LUBE OIL FOUND IN TPH ANALYSIS. DEC SITE MANAGER STATED THAT THIS MATERIAL MUST BE DISPOSED AS PETROLEUM CONTAMINATED. SITE WILL BE MONITORED DURING THE NEW CONSTRUCTION OF TANK EXCAVATIONS AND LINE AND DISPENSOR EXCAVATIONS. SINCE NO GASOLINE STATION HAS EVER EXSISTED ON THIS LOCATION CONTAMINATION SHOULD BE HISTORIC FILL MATERIAL WHICH ERIC STATED IS FLY ASH MATERIAL.

01/15/14 TDJ WENT TO LOCATION WHERE ALL WORK HAD BEEN COMPLETED. CONTACTED ERIC ROSS WITH C.A. NORRIS FOR SOIL DISPOSAL DOCUMENTATION. CONFIRMED AGAIN THAT SITE HAS FILL MATERIAL TROUGHOUT WHICH HAS HISTORIC CONTAMINANTS. CONFIRMATORY SAMPLES WERE NOT WARRANTED FOR THIS REASON. SOIL DISPOSAL INFO WAS RECEIVED AND SITE WILL BE CLOSED WITH NO FURTHER ACTION BY DEC SITE MANAGER.

NO FURTHER ACTION FILE CLOSED

Created On: 10/16/2013

Date Printed: 4/25/2016 Last Updated: 01/15/2014 1





DEC REGION:9SPILL NUMBER:1307337SPILL NAME:PARKING LOTDEC LEAD:TDJOHNSO

PIN T & A COST CENTER

CLASS: CLOSE DATE: 01/15/2014 MEETS STANDARDS: False

Created On: 10/16/2013

Date Printed: 4/25/2016 Last Updated: 01/15/2014 2





DEC REGION:	9		SPILL NUMBER:	1508546
SPILL NAME:	FORMER G	AS STATION	DEC LEAD:	TDJOHNSO
SPILL DATE:		11/18/2015	SPILL TIME:	11:00 am
CALL RECEIV	ED DATE:	11/18/2015	RECEIVED TIME:	11:07 am
		SPILL	LOCATION	
PLACE:	FORMER GA		COUNTY:	_Erie
STREET:	1660 NIAGAF	A ST	TOWN/CITY:	Buffalo (c)
			COMMUNITY:	BUFFALO
CONTACT:	ADAM ZEBROWSKI		CONTACT PHONE:	t
				_
CONT. FACTOR: Unknown		/n	SPILL REPORTED BY:	Other
FACILITY TYPE: Gasoline Station or other PBS Facility		ity WATERBODY:		

#### **CALLER REMARKS:**

found 1000 gal ust with product/pump out underway

MATERIALCLASSSPILLEDRECOVEREDRESOURCES AFFECTEDgasolinePetroleumSoil,

## **POTENTIAL SPILLERS**

COMPANY ADDRESS CONTACT

1660 NIAGARA ST NY

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

#### **DEC REMARKS:**

11/18/15 TDJ WHILE PERFORMING TEST PIT DIG AT RIVER KEEPERS PROJECT TWO UNDERGROUND TANKS WERE EXPOSED. WHEN CAPS WERE REMOVED LIQUID WAS FOUND SIMILIAR TO GASOLINE. TANKS ARE NOT TO BE REMOVED UNTIL THE ENTIRE SITE IS EXAMIED SO I HAD THEM CONTRACT EP&S TO PUMP THE OLD LIQUIDS FROM THE TANKS. MINIMAL LEAKAGE ON SIDE OF TANK WILL BE ADDRESSED AT LATER DATE. CLAY LINED THE AREA AROUND THE TANKS.

11/20/15 TDJ EP&S ARRIVED ONSITE TO PUMP THE CONTENTS OF THE TANKS.

12/3/15 THE RESULTS OF THE TANK CONTENTS SAMPLES WERE PROVIDED. BOTH ARE GASOLINE AT LEVELS OF 8200 AND 2200 PPM FROM THE TWO TANKS. SOIL BORINGS IN THE HOT TEST PIT AREAS AND SEVERAL OTHER LOCATIONS ON THE PROPERTY WILL BEGIN ON 12/9.

2/23/16 From: Adam S. Walters [mailto:AWalters@phillipslytle.com]

Sent: Tuesday, February 23, 2016 4:42 PM

To: Gallego, Francine (DEC); Kibler, Christopher

Cc: Zebrowski, Adam; tytka@PBWORLD.com; Matt Mattison; cgrieco@jaeckle.com; Thomas DeSantis; Myriah V. Jaworski;

rabideau@buffalo.edu; Myriah Jaworski; anne.anpra@gmail.com; Johnson, Thomas (DEC)

Created On: 11/18/2015

Date Printed: 4/25/2016 Last Updated: 03/10/2016 3



## NYSDEC SPILL REPORT FORM



4

DEC REGION:	9	SPILL NUMBER:	1508546
SPILL NAME:	FORMER GAS STATION	DEC LEAD:	TDJOHNSO

Subject: RE: Draft Phase II ESA Report-1660 Niagara St., Buffalo, NY

Thanks Francine. With the report finalized, we'll begin to move forward with the BCP application. I would expect to set up a pre-application meeting before the end of next month.

Thanks much!

Adam

Adam S. Walters Partner

03/08/16 TDJ PLAN HAS BEEN SUBMITTED TO BCP PROGRAM FOR CAPPING OF SITE AFTER TANKS AND GREASE AREA HAS BEEN REMEDIATED.
LABELLA SUBMITTED THE FINAL VERSION OF THE PHASE II ENVIRONMENTAL SITE ASSESSMENT REPORT.

PIN T & A COST CENTER

CLASS: CLOSE DATE: MEETS STANDARDS: False

Created On: 11/18/2015

Date Printed: 4/25/2016 Last Updated: 03/10/2016



## NYSDEC SPILL REPORT FORM



DEC REGION:	9		_ SPILL NUMBER:	1508678
SPILL NAME:	HIGHWAY		DEC LEAD:	FXGALLEG
SPILL DATE:		11/22/2015	SPILL TIME:	12:42 pm
CALL RECEIV	ED DATE:	11/22/2015	RECEIVED TIME:	1:22 pm
		SPILL LO	CATION	
PLACE:	HIGHWAY		COUNTY:	Erie
STREET:	ROUTE 33 E/E	3 @ ROUTE 198 W/B	TOWN/CITY:	Buffalo (c)
			COMMUNITY:	BUFFALO
CONTACT:	MARVIN		_ CONTACT PHONE:	(716) 851-5510
ONT. FACTOR	R: Equipme	ent Failure	SPILL REPORTED BY:	Other

**CALLER REMARKS:** 

**FACILITY TYPE:** 

**CLASS MATERIAL SPILLED** RECOVERED RESOURCES AFFECTED Petroleum 5 G gasoline Sewer,

## POTENTIAL SPILLERS

**COMPANY ADDRESS CONTACT** UNKNOWN

ROUTE 33 E/B @ ROUTE 198 W/B BUFFALO NY MARVIN

**WATERBODY:** 

(716) 851-5510

Tank No. Tank Size Material Cause Source **Test Method** Leak Rate Gross Failure

#### **DEC REMARKS:**

11/20/15 FG CONTACTED BUFFALO DISPATCH AND THEY DID NOT REQUEST THE DEPARTMENTS ASSISTANCE OR RESPONSE. THE SPILL WAS FROM A CAR ACCIDENT AND WAS MINOR AND CLEANED UP.

11/23/15 FG SITE INSPECTION. NO EVIDENCE OF SPILL REMAINED. NO FURTHER WORK REQUIRED. CLOSED. ELECTRONIC FILE ONLY.

PIN T & A **COST CENTER** 

Passenger Vehicle

**CLASS: CLOSE DATE:** 11/23/2015 **MEETS STANDARDS:** False

Created On: 11/22/2015

Date Printed: 4/25/2016 Last Updated: 11/23/2015 5



## NYSDEC SPILL REPORT FORM



DEC REGION	: 9			_ SPILL NUMBER:	1511123
SPILL NAME:	STREET			_ DEC LEAD:	TDJOHNSO
SPILL DATE:		02/19/2016		SPILL TIME:	12:30 pm
CALL RECEIV	VED DATE:	02/19/2016		RECEIVED TIME:	6:00 pm
			SPILL LO	CATION	
PLACE:	STREET			COUNTY:	Erie
STREET:	GRANT & AM	IHERST		TOWN/CITY:	Buffalo (c)
				_ COMMUNITY:	BUFFALO
CONTACT:				_ CONTACT PHONE:	( <u> </u>
CONT. FACTO	<u> </u>	ent Failure ercial Vehicle		_SPILL REPORTED BY: _WATERBODY:	Fire Department

#### **CALLER REMARKS:**

Hydraulic oil spilled when line broke on truck.

MATERIALCLASSSPILLEDRECOVEREDRESOURCES AFFECTEDhydraulic oilPetroleum

## POTENTIAL SPILLERS

COMPANY ADDRESS CONTACT

city of buffalo NY

Tank No. Tank Size Material Cause Source Test Method Leak Rate Gross Failure

#### **DEC REMARKS:**

02/19/16 TDJ SPOKE WITH TERRY WHO STATED THAT SPEEDY DRY WAS SPREAD ON OIL AND WAS CLEANED WITH STREET SWEEPER. CONTAMINATED MATERIAL TO LANDFILL. NO DRAINS AFFECTED.

02/24/16 TDJ INSPECTED SITE AND FOUND THE CITY HAD CLEANED UP SPEEDY DRY. SITE WAS CLEANED TO SATISFACTION OF DEC SITE MANAGER.

NO FURTHER ACTION
FILE CLOSED TO ELECTRONIC ONLY

PIN T & A COST CENTER


CLASS: CLOSE DATE: 02/19/2016 MEETS STANDARDS: False

Created On: 02/19/2016

 MIRROR LAKE - JAPANESE GARDEN HI ELMWOOD AVE / MIDDLE SEX BUFFALO, NY

Inquiry Number: April 27, 2016

# **EDR Site Report**™

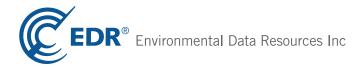

#### TABLE OF CONTENTS

The EDR-Site Report<sup>™</sup> is a comprehensive presentation of government filings on a facility identified in a search of federal, state and local environmental databases. The report is divided into three sections:

Section	on 1: Facility Summary
	Summary of facility filings including a review of the following areas: waste management, waste disposal, multi-media issues, and Superfund liability.
Section	on 2: Facility Detail Reports
	All available detailed information from databases where sites are identified.
Section	on 3: Databases and Update InformationPage
	Name, source, update dates, contact phone number and description of each of the databases for this report.

**Thank you for your business.**Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This report contains information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANYSUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this report "AS IS". Any analyses, estimates, ratings, or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assesment performed by an environmental professional can produce information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

# **SECTION 1: FACILITY SUMMARY**

FACILITY	FACILITY 1 MIRROR LAKE - JAPANESE GARDEN HISTORICAL S ELMWOOD AVE / MIDDLE SEX BUFFALO, NY
AREA	EDR ID #S114560675
WASTE MANAGEMENT Facility generates hazardous waste (RCRA)	NO
Facility treats, stores, or disposes of hazardous waste on-site (RCRA/TSDF)	NO
Facility has received Notices of Violations (RCRA/VIOL)	NO
Facility has been subject to RCRA administrative actions (RAATS)	NO
Facility has been subject to corrective actions (CORRACTS)	NO
Facility handles PCBs (PADS)	NO
Facility uses radioactive materials (MLTS)	NO
Facility is a FUSRAP Site	NO
Facility is a UXO Site	NO
Facility is a FUELS Site	NO
Facility is an ECHO Site	NO
Facility manages registered aboveground storage tanks (AST)	NO
Facility manages registered underground storage tanks (UST)	NO
Facility has reported leaking underground storage tank incidents (LUST)	NO
Facility has reported emergency releases to the soil (ERNS)	NO
Facility has reported hazardous material incidents to DOT (HMIRS)	NO
WASTE DISPOSAL Facility is a Superfund Site (NPL)	NO
Facility has a known or suspect abandoned, inactive or uncontrolled hazardous waste site (SEMS)	NO
Facility has a reported Superfund Lien on it (LIENS)	NO
Facility is listed as a state hazardous waste site (SHWS)	NO
Facility has disposed of solid waste on-site (SWF/LF)	NO
MULTIMEDIA Facility uses toxic chemicals and has notified EPA under SARA Title III, Section 313 (TRIS)	NO
Facility produces pesticides and has notified EPA under Section 7 of FIFRA (SSTS)	NO
Facility manufactures or imports toxic chemicals on the TSCA list (TSCA)	NO
Facility has inspections under FIFRA, TSCA or EPCRA (FTTS)	NO
Facility is listed in EPA's index system (FINDS)	NO
Facility is listed in other database records (OTHER)	YES - p4
POTENTIAL SUPERFUND LIABILITY Facility has a list of potentially responsible parties PRP	NO
TOTAL (YES)	1

#### **MULTIMEDIA**

#### Facility is listed in other database records

DATABASE: Other Database Records (OTHER)

MIRROR LAKE - JAPANESE GARDEN HISTORICAL SOCIETY ELMWOOD AVE / MIDDLE SEX BUFFALO, NY EDR ID #\$114560675

SPILLS:

Facility ID: 1307239 Facility Type: DER Facility ID: FR 443002 Site ID: DEC Region: Spill Date: 487896 2013-10-12

Spill Number/Closed Date: 1307239 / 2013-10-16

Spill Cause: Spill Class: Unknown

No spill occured. No DEC Response. No corrective action required.

SWIS: 1502

FXGALLEG Investigator: Referred To: Not reported Reported to Dept: 2013-10-12 Not reported MIRROR LAKE Water Affected: Spill Source: Unknown Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 2013-10-12 2013-10-16 Not reported

Spill Record Last Update: Spiller Name: Spiller Name:
Spiller Company:
Spiller Address:
Spiller City, St, Zip:
Spiller Company:
Contact Name:
Contact Phone: UNKNOWN Not reported NY

999

SUSAN VANDELDA (716) 864-4351 "10/12/13 FG SPOKE TO THE CALLER WHO SAID THERE WAS A GAS CAN ON THE DEC Memo:

LAKE AND THERE WAS A SHEEN AND PRODUCT ON THE WATER. FG SITE INSPECTION. NO GAS CAN WAS PRESENT AND NO PETROLEUM WAS ON THE LAKE. 10/16/13 NO FURTHER ACTION POSSIBLE. SPILL CLOSED. ELECTRONIC FILE

ONLY

Remarks: "10 gallon gasoline can floating in water leaking. sheen arouns can"

Material:

Site ID: 487896 Operable Unit ID: 1237528 Operable Unit: 01 Material ID: 2237199 Material Code: 0009 gasoline Not reported Petroleum 10.00 Material Name: Case No.: Material FA: Quantity: Gallons Units: Recovered: Not reported Resource Affected: Not reported Oxygenate: Not reported

Tank Test:

## **SECTION 3: DATABASES AND UPDATE DATES**

To maintain currency of the following federal, state and local databases, EDR contacts the appropriate government agency on a monthly or quarterly basis as required.

**Elapsed ASTM days:** Provides confirmation that this report meets or exceeds the 90-day updating requirement of the ASTM standard.

#### **DATABASES FOUND IN THIS REPORT**

#### NY SPILLS: Spills Information Database

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Data collected on spills reported to NYSDEC as required by one or more of the following:
Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/17/2016 Database Release Frequency: Varies Date of Last EDR Contact: 02/18/2016 Date of Next Scheduled Update: 05/30/2016 **STATE HIGHWAY** 198 AND 33 BUFFALO, NY

Inquiry Number: April 27, 2016

# EDR Site Report<sup>™</sup>



#### TABLE OF CONTENTS

The EDR-Site Report<sup>™</sup> is a comprehensive presentation of government filings on a facility identified in a search of federal, state and local environmental databases. The report is divided into three sections:

Section	on 1: Facility Summary
	Summary of facility filings including a review of the following areas: waste management, waste disposal, multi-media issues, and Superfund liability.
Section	on 2: Facility Detail Reports
	All available detailed information from databases where sites are identified.
Section	on 3: Databases and Update InformationPage
	Name, source, update dates, contact phone number and description of each of the databases for this report.

**Thank you for your business.**Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This report contains information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANYSUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this report "AS IS". Any analyses, estimates, ratings, or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assesment performed by an environmental professional can produce information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

# **SECTION 1: FACILITY SUMMARY**

FACILITY	FACILITY 1 STATE HIGHWAY 198 AND 33 BUFFALO, NY EDR ID #S117362808
WASTE MANAGEMENT Facility generates hazardous waste (RCRA)	NO
Facility treats, stores, or disposes of hazardous waste on-site (RCRA/TSDF)	NO
Facility has received Notices of Violations (RCRA/VIOL)	NO
Facility has been subject to RCRA administrative actions (RAATS)	NO
Facility has been subject to corrective actions (CORRACTS)	NO
Facility handles PCBs (PADS)	NO
Facility uses radioactive materials (MLTS)	NO
Facility is a FUSRAP Site	NO
Facility is a UXO Site	NO
Facility is a FUELS Site	NO
Facility is an ECHO Site	NO
Facility manages registered aboveground storage tanks (AST)	NO
Facility manages registered underground storage tanks (UST)	NO
Facility has reported leaking underground storage tank incidents (LUST)	NO
Facility has reported emergency releases to the soil (ERNS)	NO
Facility has reported hazardous material incidents to DOT (HMIRS)	NO
WASTE DISPOSAL Facility is a Superfund Site (NPL)	NO
Facility has a known or suspect abandoned, inactive or uncontrolled hazardous waste site (SEMS)	NO
Facility has a reported Superfund Lien on it (LIENS)	NO
Facility is listed as a state hazardous waste site (SHWS)	NO
Facility has disposed of solid waste on-site (SWF/LF)	NO
MULTIMEDIA Facility uses toxic chemicals and has notified EPA under SARA Title III, Section 313 (TRIS)	NO
Facility produces pesticides and has notified EPA under Section 7 of FIFRA (SSTS)	NO
Facility manufactures or imports toxic chemicals on the TSCA list (TSCA)	NO
Facility has inspections under FIFRA, TSCA or EPCRA (FTTS)	NO
Facility is listed in EPA's index system (FINDS)	NO
Facility is listed in other database records (OTHER)	YES - p4
POTENTIAL SUPERFUND LIABILITY Facility has a list of potentially responsible parties PRP	NO

#### **MULTIMEDIA**

#### Facility is listed in other database records

**DATABASE: Other Database Records (OTHER)** 

STATE HIGHWAY 198 AND 33 BUFFALO, NY EDR ID #S117362808

SPILLS:

Facility ID: 1406280 Facility Type: DER Facility ID: FR 454773 Site ID: DEC Region: Spill Date: 499741

2014-09-11 1406280 / 2014-09-23 Spill Number/Closed Date:

Traffic Accident Spill Cause: Spill Class: Not reported SWIS: 1502 TDJOHNSO Investigator: Referred To: Not reported Reported to Dept: 2014-09-11 Not reported Water Affected: Not reported

Spill Source: Commercial Vehicle Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 2014-09-11 Spill Record Last Update: 2014-09-23

Spiller Name: Not reported Spiller Name.
Spiller Company:
Spiller Address:
Spiller City,St,Zip:
Spiller Company: TRAFFIC ACCIDENT

Not reported

NY

999

Contact Name: Contact Phone:

ODISPATCHER 3
(716) 851-5510
"09/12/14 TDJ TRAFFIC ACCIDENT CAUSED SPILL OF OIL FROM TRUCK TO
"09/12/14 TDJ TRAFFIC ACCIDENT CAUSED SPILL OF OIL FROM TRUCK TO DEC Memo:

CONCRETE WALK/ROAD ALONG ROADWAY. NO GRASS NOR DRAINS WERE AFFECTED FROM THE SPILL AND FIRE DEPT. USED SPEEDY DRY TO ABSORB PETROLEUM. CONTAMINATED MATERIAL WAS TAKEN FROM SITE BY CITY HIGHWAY DEPT. FOR DISPOSAL. NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY!"

Remarks: cleanup pending, spilled on sideway/roadway'

Material:

Site ID: 499741 Operable Unit ID: 1249153 Operable Unit: 01 Material ID: 2250712 Material Code: 0006 Material Name: Case No.: crude oil Not reported Petroleum 15.00 Material FA: Quantity: Gallons Units: Recovered: Not reported Resource Affected: Not reported Oxygenate: Not reported

Tank Test:

## **SECTION 3: DATABASES AND UPDATE DATES**

To maintain currency of the following federal, state and local databases, EDR contacts the appropriate government agency on a monthly or quarterly basis as required.

**Elapsed ASTM days:** Provides confirmation that this report meets or exceeds the 90-day updating requirement of the ASTM standard.

#### **DATABASES FOUND IN THIS REPORT**

#### NY SPILLS: Spills Information Database

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Data collected on spills reported to NYSDEC as required by one or more of the following:
Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/17/2016 Database Release Frequency: Varies Date of Last EDR Contact: 02/18/2016 Date of Next Scheduled Update: 05/30/2016 **OIL SHEEN IN CREEK**BEHIND 1654 NIAGARA STREET
BUFFALO, NY 14202

Inquiry Number: April 27, 2016

# **EDR Site Report**™



#### TABLE OF CONTENTS

The EDR-Site Report<sup>™</sup> is a comprehensive presentation of government filings on a facility identified in a search of federal, state and local environmental databases. The report is divided into three sections:

Section 1: Facility Summary	Page	3
Summary of facility filings including a waste disposal, multi-media issues,	a review of the following areas: waste management, and Superfund liability.	
Section 2: Facility Detail Reports		4
All available detailed information from	m databases where sites are identified.	
Section 3: Databases and Update Inform	mation	9 9
Name, source, update dates, contact for this report.	et phone number and description of each of the databases	

**Thank you for your business.**Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This report contains information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANYSUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this report "AS IS". Any analyses, estimates, ratings, or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can produce information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

# **SECTION 1: FACILITY SUMMARY**

FACILITY	FACILITY 1 OIL SHEEN IN CREEK BEHIND 1654 NIAGARA STREET BUFFALO, NY 14202
AREA	EDR ID #\$117362830
WASTE MANAGEMENT Facility generates hazardous waste (RCRA)	NO
Facility treats, stores, or disposes of hazardous waste on-site (RCRA/TSDF)	NO
Facility has received Notices of Violations (RCRA/VIOL)	NO
Facility has been subject to RCRA administrative actions (RAATS)	NO
Facility has been subject to corrective actions (CORRACTS)	NO
Facility handles PCBs (PADS)	NO
Facility uses radioactive materials (MLTS)	NO
Facility is a FUSRAP Site	NO
Facility is a UXO Site	NO
Facility is a FUELS Site	NO
Facility is an ECHO Site	NO
Facility manages registered aboveground storage tanks (AST)	NO
Facility manages registered underground storage tanks (UST)	NO
Facility has reported leaking underground storage tank incidents (LUST)	NO
Facility has reported emergency releases to the soil (ERNS)	NO
Facility has reported hazardous material incidents to DOT (HMIRS)	NO
WASTE DISPOSAL Facility is a Superfund Site (NPL)	NO
Facility has a known or suspect abandoned, inactive or uncontrolled hazardous waste site (SEMS)	NO
Facility has a reported Superfund Lien on it (LIENS)	NO
Facility is listed as a state hazardous waste site (SHWS)	NO
Facility has disposed of solid waste on-site (SWF/LF)	NO
MULTIMEDIA Facility uses toxic chemicals and has notified EPA under SARA Title III, Section 313 (TRIS)	NO
Facility produces pesticides and has notified EPA under Section 7 of FIFRA (SSTS)	NO
Facility manufactures or imports toxic chemicals on the TSCA list (TSCA)	NO
Facility has inspections under FIFRA, TSCA or EPCRA (FTTS)	NO
Facility is listed in EPA's index system (FINDS)	NO
Facility is listed in other database records (OTHER)	YES - p4
POTENTIAL SUPERFUND LIABILITY Facility has a list of potentially responsible parties PRP	NO
TOTAL (YES)	1

#### **MULTIMEDIA**

Facility is listed in other database records

DATABASE: Other Database Records (OTHER)

OIL SHEEN IN CREEK BEHIND 1654 NIAGARA STREET BUFFALO, NY 14202 EDR ID #S117362830

SPILLS:

Facility ID: 1406307 Facility Type: DER Facility ID: FR 454802 Site ID: DEC Region: 499770

Spill Date: 2014-09-09 Spill Number/Closed Date: 1406307 / Not Reported

Spill Cause: Unknown Spill Class: Not reported 1502 TDJOHNSO Investigator: Referred To: Not reported Reported to Dept: 2014-09-09

Not reported Water Affected: SQAJAQUADA CREEK

Spill Source: Unknown Spill Notifier: DEC Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** Not reported Remediation Phase: 2014-09-12 2015-11-16 Not reported

Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Not reported Not reported Spiller City,St,Zip: Spiller Company: Not reported Not reported Contact Name: Contact Phone: DAMIANOS SKAROS

DEC Memo:

(716)851-7160
"10/10/14 TDJ GAVE SAMPLING JARS TO DAMIANOS FROM GRAT LAKES GROUP
"10/10/14 TDJ GAMPLING FROM FISHERIES BOAT. SAMPLES WILL BE SUBMITT "10/10/14 TDJ GAVE SAMPLING JARS TO DAMIANOS FROM GRAT LAKES GROUP FOR SEDIMENT SAMPLING FROM FISHERIES BOAT. SAMPLES WILL BE SUBMITTED TO TEST AMERICA FOR 8260,8270,DOH-310-13 AND PCB ANALYSIS. SAMPLES WILL BE COLLECTED ON 10/14/14. 10/15/14 TDJ ONE SAMPLE WAS COLLECTED FROM THE SCAJAQUADA CREEK EXTENSION USING A CORING TOOL. SEDIMENT WAS COLLECTED AT ONE POINT AND BEADS OF PETROLEUM WERE NOTED IN THE SAMPLE. THE SHEEN WAS NOT PREVALENT SINCE THE SEDIMENT WAS NOT DISTURBED AS MUCH AS THE POLNAR DRUDGE SAMPLE DOES. SAMPLE WAS TAKEN TO TEST AMERICA AND WILL BE TESTED FOR ANALYTES ABOVE. 10/31/14 TDJ RESULTS OF SEDIMENT SAMPLING WAS COMPLETED. A LIST OF ELEVATED SEMI-VOLATILE ORGANIC CONTAMINATS WAS PRESENT IN THE SAMPLE. NO ELEVATED PCB COMPOUNDS WERE DETECTED IN THE SEDIMENT. RESULTS WILL BE REVIEW BY REMEDIATION DIVISION FOR POSSIBLE WORK. 11/24/14 TDJ RECEIVED PAYMENT PACKAGE FOR LAB WORK AT TEST AMERICA. PAYMENT WAS RECEIVED PAYMENT PACKAGE FOR LAB WORK AT TEST AMERICA. PAYMENT WAS APPROVED AND DOCUMENTED IN FILE. 12/02/14 TDJ MAGGIES GIBBONS WITH RIVERKEEPERS INC. HAS BOUGHT PROPERTY AT 1660 NIAGARA WHICH IS DIRECTLY ALONG CREEK EXTENSION. WATERFRONT WIL BE USED TO CANOE/KAYAK ACCESS FOR COLLEGE STUDENTS AND POSSIBLY PUBLIC. SHE REQUESTED RESULTS OF DEC SAMPLING IN CREEK SEDIMENT. COPY WAS SENT VIA E-MAIL TO MAGGIE. SHE ALSO WAS QUESTIONING REMEDIAL WORK AND HEALTH ISSUES WITH CONTAMINATION FOUND. I DIRECTED HER TO MARTY DOSTER WHO WAS APPRISED OF THE SALE. 12/08/14 TDJ WENT TO LOCATION TO GET PHOTOS TO DOCUMENT AREA OF SAMPLING FOR CONTRACTOR. CONTACTED DAVE STEINER TO CHECK HIS EQUIPMENT FOR SEDIMENT SAMPLING. WE WILL DISCUSS POSSIBLE BOATS OR BARGE TO COLLECT SEDIMENT OVER ENTIRE AREA IN CANAL EXTENSION. 12/26/14 TDJ WENT TO LOCATION WITH DAVE STEINER WITH SJB EMPIRE AND DAMIANOS WITH DEC TO DISCUSS AND DETERMINE AN AREA TO EMPIRE AND DAMIANOS WITH DEC TO DISCUSS AND DETERMINE AN AREA TO PLACE PORATBLE BARGE INTO CREEK EXTENSION FOR SEDIMENT SAMPLING. DISCUSSED SAMPLING AREA AND AMOUNT OF SAMPLES TO BE COLLECTED. WILL DRAW UP A SAMPLING PLAN. 01/08/14 TDJ PREPARED CALLOUT FORM FOR SJB EMPIRE AND SUBMITTED TO SAME. 01/21/15 TDJ SJB ONSITE FOR SEDIMENT SAMPLING. COLD WEATHER HAD ICE ON SURFACE SAFE TO WALK ON TO MARK OUT (10) SEDIMENT SAMPLING POINTS. ICE WAS BROKEN OPEN AND FOUND TO BE 4-5 THICK. SEDIMENT IN FIRST SAMPLE WAS SOFT TO APPROX. 9' BELOW CREEK BASE AND SAMPLER COULD NOT PULL GOOD SAMPLE. AN ALTERNATE SAMPLER WAS USED TO COLLECT THE LOOSER SEDIMENT. THE DESCRIPTION OF THE MATERIAL WILL BE DOCUMENTED IN THE FINAL REPORT. THE ANALYSIS WILL INCLUDE

...Continued...

VOC'S,SVOC'S,TPH AND PCB'S. 2/9/15 FG REVIEWED THE CITY OF BUFFALO POLK DIRECTORIES. LOOKED AT LISTINGS BETWEEN 1654 AND 1700 NIAGARA ST, BUFFALO. 1938 - 1940 NO LISTINGS. 1941 1700 BOTSFORD RUSSELL A FILLING STATION 1946 1700 PERRETT GEO FILLING STATION 1956 & 1957 FILLING STATION 1946 1700 PERRETT GEO FILLING STATION 1956 & 1957
1700 SOOS ANDREW J GAS STA 1958, 1959, 1960, 1961 1700 GOOD SERVICE
GARAGE GAS STA 1962 1700 HANK'S SINCLAIR SERV 1963, 1964, 1966 1700
HAENTGE'S SINCLAIR SERV GAS STA 1967, 1968, 1969-70, 1971 NO LISTING
FOR A GAS STATION CITY OF BUFFALO FIRE RECORDS SHOW THE PRESENCE OF
GAS STATIONS AT NOV 10, 1944 1700 NIAGARA ST BUFFALO MARINE MART TWO
1000 AND ONE 1500 GALLON USTS ON SITE WITH 5 PUMPS, 2 OF THOSE ARE
REMOTE. MAY 4 & 14, 1963 1700 NIAGARA ST. HENRY CANAZZI ONE LEAKING
1000 GALLON TANK WAS REMOVED AND REPLACED WITH A 2000 GALLON TANK.
THE 1000 GAL TANK WAS FILLED WITH CONCRETE. JAN 6 & 23, 1941 1684
NIAGARA ST. BUFFALO MARINE MART APPLICATION TO INSTALL ONE 1500 AND
TWO 1000 GALLON TANKS CITY OF BUFFALO PERMITS WERE REVIEWED: JANUARY
21, 1941 1684 NIAGARA ST BFLO. MARINE MART PERMIT NO. 32882 CONSTRUCT
AND USE FRAME BLDG. FOR STATION AND STORAGE. ALSO PLACE TWO 1000 GAL.
AND 4 - 1500 GALLON GAS TANK MAY8, 1961 1700 NIAGARA STREET CRAIG
MANAGEMENT INC. 1700 NIAGARA ST CONTRACTOR NIAGARA TANK & PUMP CO.,
INC. 262 CARLTON STREET APPLICATION NO. 85391 PERMIT NO. A16794 PLACE
1 - 1000 GALLON GASOLINE STEEL TANK. LOT 512.5 X 67 IRR 5/13/63 1700 1 - 1000 GALLON GASOLINE STEEL TANK. LOT 512.5 X 67' IRR 5/13/63 1700 NIAGARA ST HENRY CANAZZI 1700 NIAGARA ST CONTRACTOR K&T PUMP SERVICE 277 DEARBORN ST. APPLICATION NO. 91068 PERMIT NO A23038 PLACE (1) 277 DEARBORN ST. APPLICATION NO. 91066 PERMIT NO A23036 PLACE (T)
2000 GAL. STEEL GASOLINE STORAGE TANK. LOT 145' X 55' 02/23/15 TDJ
SPOKE WITH DAVE SCRIVANI (716)310-0602 WHO IS CURRENTLY THE PROPERTY
OWNER AT 1700 NIAGARA STREET. HE STATED THAT GEORGE COLLINS FROM
COLLINS MARINE WHO WAS THE PAST OWNER OF 1700 NIAGARA. HE DID SPEAK
TO ROBERT COPELAND WHO HAS KNOWLEDGE OF THE AREA. HE STATED THAT
PROPERTIES IN THE 1600'S WERE ONCE A GAS STATION AND WERE KNOWN AS RORY'S PROPERTY AND NO TANK REMOVALS WERE COMPLETED. HE ALSO STATED THAT THE EXTENSION WATER WAS ALWAYS FULL OF OILS AND DEBRIS FROM THE FACTORIES UP THE SCAJAQUADA AND THE DRAIN PIPES LEADING INTO THE WATER. HE FELT ALL WASRTE SAT AT END OF EXTENSION WHERE THE PETROLEUM NUMBERS WERE THE HIGHEST. HE WILL SUPPLY THE DEPARTMENT A SURVEY FOR 1700. 05/05/15 TDJ SENT LETTER TO RIVERKEEPERS FOR POSSIBLE NOMBERS WERE THE HIGHEST. HE WILL SUPPLY THE DEPARTMENT A SURVEY FOR 1700. 05/05/15 TDJ SENT LETTER TO RIVERKEEPERS FOR POSSIBLE RESONSIBLE PARTY FOR TANK REMOVAL IF FOUND AND CONTAMINATION REMOVAL. 05/12/15 TDJ S CONTACTED BY RIVEREKEEPER ATTORNEY REGARDING LETTER. ONCE WE DISCUSSED SITE HE CLAIMED THAT THEY ARE IN THE PROCESS OF RETAINIG CONSULTANT TO PERFORM PHASE II ON PROPERTY. I AGREED TO LET THEM GET THEIR CONSULTANT ON-BOARD SO WE CAN WORK WITH THEM. ALL FUTURE CONTACT SHOULD BE THROUGH ADAM WALTERS W/ PHILLIP LYTLE. 06/02/15 TDJ RECEIVED LETTER FROM PHILLIPS LYTLE LLP DESCRIBING INTENT TO DEMOLISH BUILDINGS ON-SITE AND INVESTIGATE VIA PHASE II THE PROPERTY. IF TANKS ENCOUNTERED THEY WILL REMOVE WITH CONSULTING CONTRACTOR. STATEMENT THAT WE DO NOT BELIEVE CONTAMINATION CAAE FROM THEM WILL BE ADDRESSED. 06/03/15 TDJ CONTACTED ADAM WALTERS TO DISSCUSS THE COMMENT IN THE LETTER. IT WAS ESTABLISHED THAT IF CONTAMINATION FROM SITE HAS ADDED TO SEDIMENT CONTAMINATION THE COMPANY WILL DISCUSS THE BCP PROGRAM WITH THE DEPARTMENT. WORK WITH DEMOLITION IS TO START EARLY JULY 2015. 08/13/15 TDJ WAS CONTACTED BY ADAM WALTERS WHO STARTE DTHAL LABELLA IS THE CONSULTANT FOR THE SITE WORK AND ARE FINALIZING DETAILS FOR WORK. CONTRACTOR FOR DEMOLITION IS ALSO BEING FINALIZED AND WORK SHOULD BEGIN THE END OF AUGUST 2015. 09/30/15 TDJ WENT TO LOCATION WHERE DEMOLITION CREW WERE REMOVING 09/30/15 TDJ WENT TO LOCATION WHERE DEMOLITION CREW WERE REMOVING DEBRIS FROM CRUCHED WOODEN AND METAL BUILDINGS. WATER WAS BEING ADDED FOR DUST CONTROL AND METERS WERE HANGING ON FENCING. WORKER STATED THAT HE FOUND AN UNDERGROUND AUTO LIFT WHICH WAS APPROX 6' EXTENDED. HE PUSHED THE CYLINDER BACK INTO HOLE FOR WORK SPACE. NO PETROLEWUM WAS NOTED AROUND DEMO MATERIAL. WILL ISPECT WHEN DEBRIS IS GONE. 10/01/15 TDJ WENT TO LOCATION WHERE ALL OF THE BUILDINGS WERE LEVELED AND STEEL WAS BEING LOADED FOR SCRAP. A FEW PIPES WERE FOUND INTO THE CONCRETE FLOOR BESIDES THE LIFT IN THE ONE BUILDING. SITE WILL BE INSPECTED WHEN CLEANUP IS COMPLETE. 10/14/15 FG SPOKE TO ADAM ZEBROWSKI WITH LABELLA. HE IS THE PROJECT MANAGER FOR THIS SITE. MR. ZEBROWSKI SAID THAT A SCOPE OF WORK IS BEING PREPARED NOW INCLUDING GEOPHYSICAL, PHASE II, GW SAMPLING AND TEST PITS. HE CAN START WORK 2 WEEKS AFTER THE RIVERKEEPERS GIVE HIM APPROVAL. HE IS NOT APPROVED TO SEND THE WORK PLAN TO THE DEPARTMENT. MR. ZEBROWSKI WOULD LIKE A COPY OF THE SAMPLES FROM EMPIRE. FG SPOKE TO ADAM WALTERS WITH PHILLIP LYTLE. MR. WALTERS PROVIDED THE SCOPE OF WORK ELECTRONICALLY. HE SAID LYTLE. MR. WALTERS PROVIDED THE SCOPE OF WORK ELECTRONICALLY. HE SAID THERE IS A COMMITTEE OF ENVIRONMENTAL PROFESSIONALS REVIEWING THE WORK AND THEY WANTED THE ENTIRE SITE TO HAVE A GEOPHYSICAL SURVEY INSTEAD OF A LIMITED AREA. THE WORK PLAN SHOULD BE FINAL BY FRIDAY. THEY WILL COMPLETE THE GPR FIRST AND THEN DECIDE WHERE TO PLACE THE TEST PITS AND BORINGS. THEY SHOULD BE STARTING WORK BY THE FIRST WEEK IN NOVEMBER. 10/15/15 COMMENTS WERE PROVIDED TO ADAM WALTERS REGARDING THE SCOPE OF WORK PROVIDED: From: Gallego, Francine (DEC) Sent: Thursday, October 15, 2015 10:14 AM To: 'Adam S. Walters' Cc: 'Zebrowski, Adam'; Sutton, Gregory (DEC); Johnson, Thomas (DEC) Subject: RE: 1660 Niagara Street Adam, Thank you for providing Labella s Scope of Work for the property owned by BNRLT at 1660 Labella s Scope of Work for the property owned by BNRLT at 1660 Niagara St, Buffalo. I have the following comments for your consideration: Attached is the 2/2/15 Empire Sediment Sampling Scajaquada Creek Slip Report the Department completed. 1. There is no map with the property boundaries and identification of the

...Continued...

geophysical survey location. 2. Will a map be provided to NYSDEC for geophysical survey location. 2. Will a map be provided to NYSDEC for review along with proposed test pit locations once the geophysical work is completed? 3. What is the time period between the completion of the geophysical survey and the start of the test pitting? 4. You should collect at least one sample for analysis at each test pit location along with allowing for a field decision about the necessity of additional complex is a proposal to the proposal to location along with allowing for a field decision about the necessity of additional samples - ie you may want to know what the contents of the usts are identified as. 5. There is no plan to remove the usts if they are encountered. 6. Again, will there be a map showing all test pit locations with the proposed soil borings on them for the Departments review? And, what time period will there be between test pitting and borings? 7. The intent of the boring program should be to determine the extent of any impacts identified during the test pit investigation. You should allow for field decisions to increase the boring program if necessary. 8. At least one soil sample per boring should be collected for analysis. 9. Please incorporate the Empire should be collected for analysis. 9.Please incorporate the Empire 2/2/15 Sediment Sampling Report (attached) findings in the Phase II Report that is to be prepared. 10.What time frame will the report be provided subsequent to the completion of the soil boring program? 11. The 5/22/15 Adam Walters letter to the Department indicates that the Department does not believe that petroleum or related constituents are migrating off of the Property into the Creek . To clarify, the Department does not know if the Property has impacted the Creek. The work proposed in Labella s Scope of Work will aid in determining this. Please consider these comments in your scope of work and call me if there are any questions. Best Regards, Francine Gallego NYSDEC 270 Michigan Ave Buffalo, NY 14203 Francine.gallego@dec.ny.gov 716-851-7220 From: Adam S. Walters [mailto:AWalters@phillipslytle.com] Sent: Thursday, October 15, 2015 4:45 PM To: Gallego, Francine (DEC) Cc: Zebrowski, Adam; Sutton, Gregory (DEC); Johnson, Thomas (DEC) Subject: RE: 1660 Niagara Street Francine: Thank you for the Department's comments on the proposed scope of work for our Phase 2 investigation at 1660 Niagara Street. I have forwarded them on to our volunteer technical committee and we II provide a response on each item after we have had a chance to review. Thanks again! Adam 11/2/15 ADAM WALTERS PROVIDED A RESPONSE TO THE DEPARTMENT'S COMMENTS. THE GEOPHYSICAL SURVEY WAS COMPLETED ON 10/23/15 AND THE DEPARTMENT WAS NOT NOTIFIED AHEAD OF TIME. From: Gallego, Francine (DEC) Sent: Monday, November 02, 2015 2:17 PM To: 'Adam S. Walters' Cc: Zebrowski, Adam; Sutton, Gregory (DEC); Johnson, Thomas (DEC) Subject: RE: 1660 Niagara Street Adam, The collection of as much data as is relevant is important to understanding the nature and extent of impacts on the property. As such, the Department feels strongly about the collection of at least one sample (possibly more) for analysis at each test pit and boring location. The expansion of the test pit and boring program should be flexible enough to allow for additional locations as well. If Niagara provide a response on each item after we have had a chance to review. flexible enough to allow for additional locations as well. If Niagara Riverkeepers is unable to complete this additional collection and expansion, then the Department will be prepared to do the additional work based on field conditions. Of course, your client is a potentially responsible party and may be responsible for the Department s'costs for the work. The rulemaking initiative for PART 375 will begin early next year to address additional regulatory changes in the BCP, including BCP-EZ regulations. The program won t be available until we have the regs in place which probably won t be for another year or more. Other than the tax credits I doubt that there will be many other subsequent changes from what is required under the BCP and BCP-EZ since all the same sampling and standards will have to be met in order to get a release of liability from the State. All of DER-10 investigative requirements will also pertain. The inclusion of the Department s 2/2/15 sediment sampling study is of course relevant to the study of this area. Based on your response, we should expect to receive a proposed test pit location map with the ust locations on it as well no later than November 10, 2015. State offices are closed on November 11 in honor of Veterans Day. Please make sure that you notify the Department ahead of any field work planned as we will be prepared to be on site to possibly collect samples as is necessary. Best Regards, Francine Francine Gallego NYSDEC 270 Michigan Ave Buffalo, NY 14203 Francine.gallego@dec.ny.gov 716-851-7220 From: Adam S. Walters [mailto:AWalters@phillipslytle.com] Sent: Sunday, November 01, 2015 9:17 AM To: Gallego, Francine (DEC) Cc: Zebrowski, Adam; Sutton, Gregory (DEC); Johnson, Thomas (DEC) Subject: RE: 1660 Niagara Street Francine: Below please find each of your comments along with our responses (in italics). Please do not hesitate to contact us if you have any questions. Thank you! Adam 1. There is no map with the property boundaries and identification of the geophysical survey location. Response: The geophysical survey was completed on Friday, offices are closed on November 11 in honor of Veterans Day. Please location. Response: The geophysical survey was completed on Friday, October 23, 2015. It included the entire property. For your reference, a survey of the property is included herewith. 2. Will a map be provided to NYSDEC for review along with proposed test pit locations once the geophysical work is completed? Response: We would be pleased to do so. We expect the results from the geophysical survey early next week and will work to get a map with proposed test pit locations (based on the results of the geophysical survey) by

...Continued...

early next week. 3. What is the time period between the completion of the geophysical survey and the start of the test pitting? Response: The anticipated time period is approximately three to four weeks. As noted above, the geophysical survey was completed on Friday, October 23, 2015. Results of the survey are expected early next week. We anticipate one to two weeks to review the results and coordinate anticipate one to two weeks to review the results and coordinate proposed test pit locations with the you and another week or so to mobilize. 4. You should collect at least one sample for analysis at each test pit location along with allowing for a field decision about the necessity of additional samples - i.e. you may want to know what the contents of the usts are identified as. Response: The purpose of our scope of work at this point in time is to determine whether USTs are present on the property and what level of contamination may our scope of work at this point in time is to determine whether USTs are present on the property and what level of contamination may exist, if any. To the extent either tanks or contamination levels above unrestricted soil clean up objectives are discovered, we intend to immediately apply for entry into the Brownfield Cleanup Program as a volunteer. We would anticipate utilizing the new BCP-EZ program as we have no interest in tax credits. Any information that you have on the status of the new BCP-EZ regulations would be appreciated. 5.

There is no plan to remove the jist if they are encountered. There is no plan to remove the usts if they are encountered. Response: See response to #4 above. 6. Again, will there be a map showing all test pit locations with the proposed soil borings on them for the Departments review? And, what time period will there be between test pitting and borings? Response: As noted above, we would be pleased to share such a map prior to undertaking the test borings. The anticipated time period between test pits results and borings is approximately two to three weeks, assuming no significant delays as a result of coordinating boring locations with the Department. 7. The intent of the boring program should be to determine the extent of any impacts identified during the test pit investigation. You should allow for field decisions to increase the boring program if necessary. Response: We believe that the scope of the Phase II work is appropriate based on the intent of the investigation - see #4 above. To the extent that contamination is discovered, we would above. To the extent that contamination is discovered, we would anticipate additional testing as necessary once the property is accepted into the BCP. To the extent interim remedial measures are necessary, we will, of course, evaluate and discuss with the Department once test results are available. 8. At least one soil sample per boring should be collected for analysis. Response: See response to #4 and #7 above. 9. Please incorporate the Empire 2/2/15 Sediment Sampling Report (attached) findings in the Phase II Report that is to be prepared. Response: We appreciate the Department sharing the 2/2/15 Sediment Sampling Report. This report provides us with useful information regarding current sediment conditions in the Creek. However, we were not involved in this sampling program and, at Creek. However, we were not involved in this sampling program and, at this time, we see no reason to include the Sediment Sampling Report in our Phase II Report. 10. What time frame will the report be provided subsequent to the completion of the soil boring program? Response: The anticipated time frame is three to four weeks. 11. The 5/22/15 Adam Walters letter to the Department indicates that the Department does not believe that petroleum or related constituents are migrating off of the Property into the Creek . To clarify, the Department does not know if the Property has impacted the Creek. The work proposed in Labella s Scope of Work will aid in determining this. Response: As noted above, the purpose of our testing program is to determine whether there are USTs on-site and/or whether historic site operations have resulted in contamination of the Property. The focus will not quantify off-site impacts, if any, nor will this work rocks will for duantity off-site infacts, if any, from will this work provide information on the numerous potential up stream sources of sediment contamination. 11/16/15 ADAM WALTERS SUBMITTED THE PROPOSED TEST PIT LOCATIONS AND THE DEPARTMENT APPROVED. MR. WALTERS WILL LET THE DEPARTMENT KNOW WHEN WORK IS SCHEDULED." "Was collecting surface sediment sampling with polnars in creek. As soon as we dropped the polnars into the sediment, large plumes and potent petroleum like odors were observed. The sampling site was located near the first tributary entering the creek near the mouth of Scajaguada.

Remarks:

Material:
Site ID:
Operable Unit ID:
Operable Unit:
Material ID:
Material Code:
Material Name:
Case No.:
Material FA:
Ouantity:
Not reported
Not reported
Not reported
Not reported

Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported
Oxygenate: Not reported

Tank Test:

...Continued...

## **SECTION 3: DATABASES AND UPDATE DATES**

To maintain currency of the following federal, state and local databases, EDR contacts the appropriate government agency on a monthly or quarterly basis as required.

**Elapsed ASTM days:** Provides confirmation that this report meets or exceeds the 90-day updating requirement of the ASTM standard.

#### **DATABASES FOUND IN THIS REPORT**

#### NY SPILLS: Spills Information Database

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Data collected on spills reported to NYSDEC as required by one or more of the following:
Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/17/2016 Database Release Frequency: Varies Date of Last EDR Contact: 02/18/2016 Date of Next Scheduled Update: 05/30/2016 **SOIL** 643 AMHERST ST BUFFALO, NY

Inquiry Number: April 27, 2016

# **EDR Site Report**™



#### TABLE OF CONTENTS

The EDR-Site Report<sup>™</sup> is a comprehensive presentation of government filings on a facility identified in a search of federal, state and local environmental databases. The report is divided into three sections:

Section	on 1: Facility Summary
	Summary of facility filings including a review of the following areas: waste management, waste disposal, multi-media issues, and Superfund liability.
Section	on 2: Facility Detail Reports
	All available detailed information from databases where sites are identified.
Section	on 3: Databases and Update InformationPage
	Name, source, update dates, contact phone number and description of each of the databases for this report.

**Thank you for your business.**Please contact EDR at 1-800-352-0050 with any questions or comments.

#### **Disclaimer - Copyright and Trademark Notice**

This report contains information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANYSUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES.ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this report "AS IS". Any analyses, estimates, ratings, or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assesment performed by an environmental professional can produce information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2016 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

# **SECTION 1: FACILITY SUMMARY**

FACILITY	FACILITY 1 SOIL 643 AMHERST ST
AREA	BUFFALO, NY EDR ID #S118261232
WASTE MANAGEMENT Facility generates hazardous waste (RCRA)	NO
Facility treats, stores, or disposes of hazardous waste on-site (RCRA/TSDF)	NO
Facility has received Notices of Violations (RCRA/VIOL)	NO
Facility has been subject to RCRA administrative actions (RAATS)	NO
Facility has been subject to corrective actions (CORRACTS)	NO
Facility handles PCBs (PADS)	NO
Facility uses radioactive materials (MLTS)	NO
Facility is a FUSRAP Site	NO
Facility is a UXO Site	NO
Facility is a FUELS Site	NO
Facility is an ECHO Site	NO
Facility manages registered aboveground storage tanks (AST)	NO
Facility manages registered underground storage tanks (UST)	NO
Facility has reported leaking underground storage tank incidents (LUST)	NO
Facility has reported emergency releases to the soil (ERNS)	NO
Facility has reported hazardous material incidents to DOT (HMIRS)	NO
WASTE DISPOSAL Facility is a Superfund Site (NPL)	NO
Facility has a known or suspect abandoned, inactive or uncontrolled hazardous waste site (SEMS)	NO
Facility has a reported Superfund Lien on it (LIENS)	NO
Facility is listed as a state hazardous waste site (SHWS)	NO
Facility has disposed of solid waste on-site (SWF/LF)	NO
MULTIMEDIA Facility uses toxic chemicals and has notified EPA under SARA Title III, Section 313 (TRIS)	NO
Facility produces pesticides and has notified EPA under Section 7 of FIFRA (SSTS)	NO
Facility manufactures or imports toxic chemicals on the TSCA list (TSCA)	NO
Facility has inspections under FIFRA, TSCA or EPCRA (FTTS)	NO
Facility is listed in EPA's index system (FINDS)	NO
Facility is listed in other database records (OTHER)	YES - p4
POTENTIAL SUPERFUND LIABILITY Facility has a list of potentially responsible parties PRP	NO
TOTAL (YES)	1

#### **MULTIMEDIA**

#### Facility is listed in other database records

**DATABASE: Other Database Records (OTHER)** 

643 AMHERST ST BUFFALO, NY EDR ID #S118261232

SPILLS:

Facility ID: 1506005 Facility Type: DER Facility ID: FR 467921 Site ID: DEC Region: Spill Date: 513403

2015-09-04 Spill Number/Closed Date:

1506005 / 2015-09-11 Equipment Failure Spill Cause: Spill Class: Not reported SWIS: 1502 TDJOHNSO Investigator: Referred To: Not reported Reported to Dept: 2015-09-04 Not reported

Water Affected: Not reported

Spill Source: Commercial/Industrial Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase: Date Entered In Computer: 2015-09-04

Spill Record Last Update: 2015-09-11 Spiller Name: Not reported Spiller Name:
Spiller Company:
Spiller City, St, Zip:
Spiller Company:
Contact Name:
Contact Name:
Contact Name: NATIONAL GRID Not reported NY 999

UISA MONTESAON
(716) 479-5339
"09/04/15 TDJ MINOR SPILL TO BE CLEANED BY CONTRACTOR NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY"
"Caller advised wood preservative was weeping out of the pole and served self-and payement. Clean up is pending." DEC Memo:

spilled onto soil and pavement. Clean up is pending.

Material:

Remarks:

Site ID: 513403 Operable Unit ID: 1262628 Operable Unit: 01 Material ID: 2266203 Material Code: 1907A

Material Name: wood preservative Not reported Other Case No. Material FA: Quantity: 1.00 Gallons Not reported Not reported Units: Recovered:

Resource Affected: Oxygenate: Not reported

Tank Test:

## **SECTION 3: DATABASES AND UPDATE DATES**

To maintain currency of the following federal, state and local databases, EDR contacts the appropriate government agency on a monthly or quarterly basis as required.

**Elapsed ASTM days:** Provides confirmation that this report meets or exceeds the 90-day updating requirement of the ASTM standard.

#### DATABASES FOUND IN THIS REPORT

#### NY SPILLS: Spills Information Database

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Data collected on spills reported to NYSDEC as required by one or more of the following:
Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 02/17/2016 Database Release Frequency: Varies Date of Last EDR Contact: 02/18/2016 Date of Next Scheduled Update: 05/30/2016 Map ID Site Database(s) EPA ID Number

#### E B ATLAS STEEL CORP. (Continued)

A100147317

E00 - Piping Secondary Containment - None J02 - Dispenser - Suction Dispenser K00 - Spill Prevention - None B00 - Tank External Protection - None F00 - Pipe External Protection - None C01 - Pipe Location - Aboveground

Tank Location: 3

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
Pipe Model: Not reported
Install Date: 04/01/2005
Capacity Gallons: 700
Tightness Test Method: NN

Date Test:
Not reported
Next Test Date:
Not reported
Date Tank Closed:
Not reported
Register:
True
Modified By:
LDGOMEZ
Last Modified:
01/20/2009
Material Name:
Not reported

69 ALONG STREET TONAWANDA STREET & WATTS BUFFALO, NY 14203 NY Spills S117267886 N/A

SPILLS:

 Facility ID:
 1403149

 Facility Type:
 ER

 DER Facility ID:
 451418

 Site ID:
 496497

 DEC Region:
 9

Spill Date: 2014-06-20

Spill Number/Closed Date: 1403149 / 2014-08-11

Spill Cause: Deliberate Spill Class: Not reported SWIS: 1502 Investigator: **TDJOHNSO** Not reported Referred To: 2014-06-23 Reported to Dept: CID: Not reported Water Affected: Not reported Spill Source: Unknown Spill Notifier: Fire Department Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** Not reported

Remediation Phase: 0

Date Entered In Computer: 2014-06-23 Spill Record Last Update: 2014-08-11 Not reported Spiller Name: Spiller Company: Not reported Spiller Address: Not reported Spiller City, St, Zip: Not reported Spiller Company: Not reported Contact Name: Not reported Not reported Contact Phone:

Map ID Site Database(s) **EPA ID Number** 

#### **ALONG STREET (Continued)**

#### S117267886

DEC Memo:

"06/23/14 TDJ WENT TO LOCATION WHICH WAS ON TONAWANDA STREET CURB NEAR WATTS STREET. A PILE OF JUNK TIRES AND THE TWO DRUMS WERE FOUND. ONE DRUM WAS MISSING THE SMALL BUNG ON AN EXPANDED CONTAINER. A RESIN MATERIAL WAS DOWN EDGE AND WAS APPROX 1/4 FULL. A SMALL AREA, APPROX 3'X 3' HAD SPILLED RESIN ON GROUND. THE FIRE DEPT. HAD PLACED AN OVERPACK AROUND LEAKER BUT OVER WEEKEND SOMEONE STOLE THE OVERPACK CONTAINER. I CONTACTED TIM AT NATIONAL VAC WHO WAS IN AREA SO HE STOPPED TO CHECK SITE FOR DISPOSAL. HE WILL RETURN WITH OVERPACK TO REMOVE THE TWO DRUMS. HE WILL ALSO REMEDIATE THE SPILLED MATERIAL. 06/23/14 TDJ TIM FROM NATIONAL VAC CALLED LATE IN DAY TO SAY DRUMS WERE REMOVED AND SOIL CLEANED. WHILE AT SITE SOMEONE STOPPED TO SAY HE SAW PERSON WITH TRUCK WHO DUMPED TIRES AND DRUMS. TIM GAVE HIM PHONE # FOR DEC OFFICE TO GIVE INFO. 08/11/14 TDJ PREPARED APPROVAL FOR PAYMENT PACKAGE FROM NATIONAL VAC. PAYMENT WAS APPROVED FOR \$778.53 AND SUBMITTED. SITE WAS CLEANED TO SATISFACTION OF DEC SITE

Remarks: "Caller advised that (2) fifty-five gallon metal drums were found

abandoned on the grassy shoulder of street, some leakage has occureed

MANAGER. NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY "

and drums were overpacked. Require removal of spill and drums."

Material:

Site ID: 496497 Operable Unit ID: 1245983 Operable Unit: Material ID: 2247062 1585A Material Code: Material Name: resins Case No.: Not reported Material FA: Other Quantity: 1.00 Gallons Units: Not reported Recovered: Resource Affected: Not reported Oxygenate: Not reported

Tank Test:

#### 70 INTERNATIONAL RAILWAY BRIDGE 1765 NIAGARA ST/BLACK ROCK YARD OFFICE **BUFFALO, NY 14207**

FINDS:

Registry ID: 110019768928

Environmental Interest/Information System

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking

environmental facility information found across the State.

ECHO:

1007814343 Envid: Registry ID: 110019768928 FIPS Code: 36029 02

EPA Region:

1007814343

N/A

**FINDS** 

**ECHO** 

Map ID Site Database(s) EPA ID Number

G & G MART (Continued) 1010031001

RCRA Days Last Evaluation: Not reported **RCRA Informal Count:** Not reported Not reported **RCRA Formal Action Count:** RCRA Date Last Formal Action: Not reported **RCRA Penalties:** Not reported RCRA Last Penality Date: Not reported RCRA Last Penality Amount: Not reported RCRA QTRS in NC: Not reported RCRA Curr Compliance Status: Not reported

RCRA Curr SNC Flag:

RCRA 3yr Compl Qtrs Status:

SDWA IDS:

SDWA System Types:

SDWA Informal Count:

SDWA Formal Action Count:

SDWA Curr Compliance Status:

Not reported

Not reported

Not reported

Not reported

SDWA Curr SNC Flag: N

TRI IDS: Not reported
TRI Releases Transfers: Not reported
TRI on Site Releases: Not reported
Tri off Site Transfers: Not reported
TRI Reporter in Past: Not reported
FEC Case IDS: 02-2012-7501
FEC Number of Cases: 1

FEC Last Case Date: 06/29/2012
FEC Total Penalties: 317061
GHG IDS: Not reported
GHG CO2 Release: Not reported

DFR URL: http://echo.epa.gov/detailed\_facility\_report?fid=110028215820

Facility SIC Codes: Not reported Facility NAICS Codes: Not reported Facility Date Last Inspection EPA: 08/18/2011 Facility Date Last Inspection State: Not reported Facility Date Last Formal ACT EPA: 06/29/2012 Facility Date Last Formal ACT ST: Not reported Facility Date Last Inforamal ACT EPA: Not reported Facility Date Last Informal ACT ST: Not reported Facility Federal Agency: Not reported TRI Reporter: Not reported Facility IMP Water Flag: Not reported

87 MANHOLE #42 NY Spills S118261137 BIRD AVE @ NIAGARA ST N/A BUFFALO, NY

SPILLS:

 Facility ID:
 1505905

 Facility Type:
 ER

 DER Facility ID:
 467826

 Site ID:
 513299

 DEC Region:
 9

Spill Date: 2015-09-02

Spill Number/Closed Date: 1505905 / Not Reported

Spill Cause: Unknown
Spill Class: Not reported
SWIS: 1502
Investigator: TDJOHNSO
Referred To: Not reported

Map ID Site Database(s) EPA ID Number

## MANHOLE #42 (Continued)

S118261137

Reported to Dept: 2015-09-02 CID: Not reported Water Affected: Not reported Spill Source: Unknown Spill Notifier: Other Cleanup Ceased: Not reported Cleanup Meets Std: False Last Inspection: Not reported Recommended Penalty: False **UST Trust:** False Remediation Phase:

Date Entered In Computer: 2015-09-02
Spill Record Last Update: 2015-09-23
Spiller Name: LISA MONTESANO

Spiller Company: TBD

Spiller Address: BIRD AVE @ NIAGARA ST

Spiller City, St, Zip: BUFFALO, NY

Spiller Company: 999

Contact Name: DAVID MELONSON

Contact Phone: 7168625058

DEC Memo: "09/02/15 TDJ WHEN NATIONAL GRID OPENED MANHOLE FOR SERVICE A

GASOLINE ODOR WAS PRESENT AND A FILM ON TOP OF THE WATER. OP-TECH WAS CALLED TO LOOK AND IT WAS DECIDED TO VAC OUT ON 9/3. 09/03/15 TDJ WENT TO LOCATION WHERE THICK OILY FILM WAS ON SURFACE OF VAULT WHICH IS 6'X 6'X 6'. APPROX. 3' OF WATER/SLUDGE WAS REMOVED WITH VAC TRUCK. VAULT WAS POWER WASHED WITH SIMPLY GREEN WHEN EMPTY. NO FLOW OF ANY

LIQUIDS WERE SEEN IN THE CLEAN PIT. NO VISUAL SIGNS OF DUMPING IN THE

VAULT WAS NOTICED AND COVER IS APPROX 300 LBS."

"unknown spiller, unknown amount, OPTech has been contracted, for

9/3. all contained within manhole"

Material:

Remarks:

 Site ID:
 513299

 Operable Unit ID:
 1262525

 Operable Unit:
 01

 Material ID:
 2266057

 Material Code:
 0066A

Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Resource Affected: Not reported

Oxygenate: Not reported Not reported

Tank Test: